

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES REGISTRATION FORM

1. Name of Property

historic name: **Columbia North Residential Historic District**
other names/site number:

2. Location

street & number: **Roughly bounded by High School Street and North Main Street on the west and Park Avenue and Branton Avenue on the east. On the north roughly bounded by North Main Street and Lafayette Street and on the south by Dale and Gill Streets.**

not for publication n/a
city or town: **Columbia**

state: **Mississippi**

code **MS**

county: **Marion** code **091**

vicinity n/a
zip code **39429**

3. State/Federal Agency Certification

As the designated authority under the National Historic Preservation Act of 1966, as amended, I hereby certify that this X nomination request for determination of eligibility meets the documentation standards for registering properties in the National Register of Historic Places and meets the procedural and professional requirements set forth in 36 CFR Part 60. In my opinion, the property X meets does not meet the National Register Criteria. I recommend that this property be considered significant nationally statewide X locally. (See continuation sheet for additional comments.)

Signature of certifying official _____ Date _____

State Historic Preservation Officer

State or Federal agency and bureau

In my opinion, the property meets does not meet the National Register criteria. (See continuation sheet for additional comments.)

Signature of commenting or other official _____ Date _____

State or Federal agency and bureau

4. National Park Service Certification

I, hereby certify that this property is:
 entered in the National Register
 See continuation sheet.

 determined eligible for the
National Register

 See continuation sheet.

 determined not eligible for the
National Register

 removed from the National Register

 other (explain): _____

Signature of the Keeper

Date of Action

5. Classification

Ownership of Property:

Category of Property:

Number of Resources within Property: (Do not include previously listed resources in the count)

X	private					
X	public-local	X	buildings	Contributing	Noncontributing	
	public-State		district	345	164	buildings
	public-Federal		site			sites
			structure			structures
			object			objects
				345	164	Total

Name of related multiple property listing:

Number of contributing resources previously National Register:

0

6. Function or Use

Historic Functions:

Domestic: single dwelling
 Domestic: multiple dwelling
 Domestic: secondary structure
 Commerce/Trade: specialty store
 Education: schools
 Religion: religious facility

Current Functions:

Domestic: single dwelling
 Domestic: multiple dwelling
 Domestic: secondary structure
 Commerce/Trade: specialty store
 Education: schools
 Religion: religious facility

7. Description

Architectural Classification(s):

Queen Anne
 Free Classic Queen Anne
 Neoclassical Revival
 Tudor Revival
 Spanish Colonial Revival
 Bungalow/Craftsman
 Minimal Traditional
 Ranch
 Contemporary

Materials:

foundation: brick
 concrete
 roof: asphalt
 asbestos
 metal
 walls: weatherboard
 brick
 stucco
 other: vinyl

Narrative Description:

See Continuation Sheets

8. Statement of Significance

Applicable National Register Criteria

- X **A** Property is associated with events that have made a significant contribution to the broad patterns of our history.
- B** Property is associated with the lives of persons significant in our past.
- X **C** Property embodies the distinctive characteristics of a type, period, or method of construction or represents the work of a master, or possesses high artistic values, or represents a significant and distinguishable entity whose components lack individual distinction.
- D** Property has yielded, or is likely to yield information important in prehistory or history.

Areas of Significance

- Architecture
- Community Planning and Development

Period of Significance

c. 1895 - 1959

Significant Dates

N/A

Significant Person(s)

N/A

Criteria Considerations:

Property is:

- ___ **A** owned by a religious institution or used for religious purposes.
- ___ **B** removed from its original location.
- ___ **C** a birthplace or a grave.
- ___ **D** a cemetery.
- ___ **E** a reconstructed building, object, or structure.
- ___ **F** a commemorative property.
- ___ **G** less than 50 years of age or achieved significance within the past 50 years.

Cultural Affiliation(s)

N/A

Architect/Builder

N.W. Overstreet
Mattingly & Biggers Architects

Narrative Statement of Significance:

See continuation sheets.

9. Major Bibliographical References

Bibliography

See continuation sheet.

Previous documentation on file (NPS)

- ___ preliminary determination of individual listing (36 CFR 67) has been requested.
- ___ previously listed in the National Register
- ___ previously determined eligible by the National Register
- ___ designated a National Historic Landmark
- ___ recorded by Historic American Buildings Survey

- ___ recorded by Historic American Engineering Record

Primary Location of Additional Data

- State Historic Preservation Office
- ___ Other State agency
- ___ Federal agency
- ___ Local government
- ___ University
- ___ Other

Name of repository:

Mississippi Department of Archives and History

10. Geographical Data

Acreage of Property: approximately 228 acres

UTM References:		Zone	Easting	Northing		Zone	Easting	Northing
	A	16	231858	3461925	C	16	229666	3460993
	B	16	231845	3460971	D	16	229673	3461981

___ See continuation sheet.

Verbal Boundary Description See continuation sheet.

Boundary Justification: See continuation sheet.

11. Form Prepared By

name/title:	David Preziosi / Executive Director	date:	March 10, 2009
organization:	Mississippi Heritage Trust	telephone:	(601) 354-0200
street & number:	P.O. Box 577	city or town:	Jackson
city or town:	Jackson	state:	MS
		zip code:	39205

Additional Documentation

Submit the following items with the completed form:

Continuation Sheets

Maps

A USGS map (7.5 or 15 minute series) indicating the property's location.

A sketch map for historic districts and properties having large acreage or numerous resources.

Photographs

Representative black and white photographs of the property.

Additional items (Check with the SHPO or FPO for any additional items)

Property Owner(s)

name:		telephone:	
street & number:		city or town:	
city or town:		state:	
		zip code:	

Paperwork Reduction Act Statement: This information is being collected for applications to the National Register of Historic Places to nominate properties for listing or determine eligibility for listing, to list properties, and to amend existing listings. Response to this request is required to obtain a benefit in accordance with the National Historic Preservation Act, as amended (16 U.S.C. 470 et seq.).

Estimated Burden Statement: Public reporting burden for this form is estimated to average 18.1 hours per response including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding this burden estimate or any aspect of this form to the Chief, Administrative Services Division, National Park Service, P.O. Box 37127, Washington, DC 20013-7127; and the Office of Management and Budget, Paperwork Reductions Project (1024-0018), Washington, DC 20503.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 1

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Narrative Description

The Columbia North Residential Historic District is composed of 509 buildings. The district is located in Columbia, Marion County, Mississippi and is roughly bounded by High School Street and North Main Street on the west, by Park Avenue and Branton Avenue on the east, by North Main Street and Lafayette Street on the north, and by Dale and Gill Streets on the south. The district is comprised mostly of residential structures with a few scattered religious buildings, one historic school, a couple of historic commercial buildings, and historic residential structures converted to office and commercial use. The character of the district is that of a residential area which grew from an earlier residential area to the south of the district. That area south of the district was listed on the National Register of Historic Places in 2008 as the Broad Street - Church Street Historic District. With the expansion of the city from commercial and industrial development the need for additional housing, churches, and schools prompted the growth of the residential area north from the original residential section of the city.

In Columbia there was only one logical direction of growth for the city as the population increased. The Pearl River and the railroad had a large part to play in the early development and the lumber mill and industry in the later development. The Pearl River is located just west of the downtown commercial area and was once used for transportation of goods to Columbia. Once the railroad came in 1899 the river was no longer the primary transportation route. The railroad tracks were built parallel to Main Street and curved around the courthouse square with a small spur just south of Broad Street. The railroad enabled the timber industry to grow in the early twentieth century and lumber mills sprang up along the railroad tracks. Thus the only logical pattern of residential growth for Columbia was east of Main Street and the commercial core of Columbia and north of Broad Street and the lumber mill development. A majority of the streets existing today east of Main Street show up on the 1915 Sanborn map, the earliest for Columbia. However, it seems that the southern portion of these streets developed first as the Sanborn coverage of residential buildings starts there and expands east and north with later maps. That majority of the early residential development took place south of the current district and then expanded into the district as the population of Columbia expanded and additional housing was needed due to the prominence of the lumber industry, manufacturing, and the rail line. Even though the majority of the earlier residential development took place south of the district there were some scattered houses built north of that area and west of Main Street. The mostly residential Columbia North Residential Historic District area now includes an interesting mix of houses of different sizes, styles, and prominence, with additional churches, and a school.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 2 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

The composition of the Columbia North Residential Historic District is typical of land subdivided for residential building in the early 1900s in a typical grid pattern streets running in a north-south, east-west direction. There are a few streets which are exceptions and run in southeast to northwest and southwest to northeast directions. The district is roughly a rectangular shape with two extensions, one from the northwest corner extending in a northwest direction including both sides of North Main Street until the intersection with the railroad tracks and the other extending north along both sides of Park Avenue. The southern boundary is the southern half of the lots facing Dewey, Dale, Royal, and Gill Streets. The northern boundary is the northern half of the lots along Lafayette Street. The western boundary of the district with exception of the North Main Street area is the western half of High School Street, and along Dewey Street before the creek. The eastern boundary is the western lots along Branton Street and the lots before the creek on Gill Street. There are nineteen streets in the district that run in a north-south direction and include from west to east: Peach Street, Main Street, High School Street, Martin Luther King Street, Jackson Street, Garden Avenue, Oak Street, West Avenue, Central Avenue, East Avenue, Wilks Avenue, Rogers Avenue, Camellia Court, Park Avenue, Alberta Avenue, Broadmor Street, Branton Avenue, Meadowood Street, and Beauvoir Street. There are ten streets going in the east-west direction that intersect with the majority of the north-south streets including from south to north, Royal Street, Dale Street, Gill Street, Ford Street, Beatrice Street, Pope Street, Dewey Street, Westwood Court, Greymont Drive, and Lafayette Street. Two streets, North Main Street, and First Street, run in a southeast to northwest direction. Running in the southwest to northeast direction are Hawkins and Alberta Streets. The east-west direction streets are the longer streets in the district with Dale, Gill, and Lafayette Streets being the largest and most defining in the district. The north-south direction streets are much smaller and connect the major east-west direction streets at certain points.

The grid pattern to the streets in the district is not regular and there does not seem to be a common pattern to the size of the blocks. For the most part the lots closer to the western boundary, or the commercial downtown area, are larger and they get progressively smaller toward the eastern boundary, although there are few exceptions here and there. Most of the lots on a single block are fairly close in width size giving a very regular pattern to the houses. The streetscape is also enhanced by very similar setbacks within the blocks. In fact there are only a very few examples of structures that sit much farther back than their neighbors. Some of the blocks have large scale development including those with churches and the school. Those developments are spread throughout the district. The topography of the district is relatively flat. Most of the lots in the district have a degree of casual landscaping and there are numerous old growth trees throughout the district.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 3

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Very little commercial development has taken place in the district with only two specifically built commercial structures surviving which were most likely neighborhood stores. One is located at 1002 West Street (#421, Photo #25) and the other is located at 1103 Park Avenue (#362). Scattered throughout the district a few historic residential buildings have been converted into office or commercial space.

There are two important religious structures in the district built during the period of significance. One is the First Baptist Church located at 409 Dale Street (#93, Photo #6) built in 1959 in the Neoclassical Revival style and the First Assembly of God Church at 1001 Park Avenue (#354, Photo #23) built in 1957 in the Modern style. The First Baptist Church takes up a full city block and over the years has been expanded with educational buildings, a daycare, and parking.

There is one historic school in the district, the Columbia Primary School located at 501 Dale Street (#103). The one-story school was constructed in 1951 in the Modern style which was popular for schools at that time. According to Sanborn Maps there was an earlier school on the site which the 1951 school replaced. The architect for the Columbia Primary School was the prolific Mississippi architect N.W. Overstreet who also designed the 1937-38 Art Moderne style Columbia High School in the Broad Street – Church Street Historic District.

There are no properties in the Columbia North Residential Historic District that have been previously listed on the National Register.

The majority of the contributing resources in the district are representative of residential development typical in Mississippi for the time. They vary in size, style, and construction dates from large two-story homes, to more modest one-story homes, to small cottages, and even duplexes and one apartment building. The larger more architecturally impressive homes in the district tend to be closer to the commercial core of the city along the 400 block of Dale Street, 800 and 900 blocks of High School Street, and North Main Street. There are other impressive and architecturally significant homes spread throughout the district but not in the concentration of the blocks previously mentioned. There are several areas of the district with a good collection of more modest homes that retain a good deal of integrity including: the 400 block of Ford Street, 900 blocks of Jackson, Garden, and Oak Streets, 1000 block of Broadmor Street, 400 block of Lafayette Street, and the 1000 block of Beatrice Street. Towards the eastern edge of the district, and farthest away from the commercial downtown area of Columbia, the houses are not as old; however, they are still significant as they are over fifty years old and retain architectural integrity from their original construction. Major architectural styles represented in Columbia are those of the late nineteenth to mid-twentieth century and include: Queen Anne, Free Classic

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 4

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Queen Anne, Neoclassical Revival, Tudor Revival, Spanish Revival, Craftsman, Minimal Traditional, Ranch, and Modern.

The oldest documented house in the district, built circa 1895, is located at 930 High School Street (#229) not too far east of the upper end of Main Street.¹ The early homes in the district being built close to town favored the Queen Anne, Free Classic Queen Anne, and Neoclassical Revival styles. This is very logical since the railroad came to town in 1899 allowing for the delivery of the mass produced architectural features that are a staple of the Queen Anne and Neoclassical Revival styles of architecture fashionable at the time. These architectural features were available due to production techniques of the "Industrial Age" that produced standardized house parts such as machine-planed siding, structural lumber, and decorative details such as turned columns, balustrades, frieze work, and decorative trim.

Excellent examples of the Queen Anne style can be found at 516 Dale Street (#107a), 923 High School Street (#235), 934 Main Street (#298), 1209 Main Street, North (#312a, Photo #22), and 811 West Street (#409a). There is also one Queen Anne style house located at 935 Alberta Avenue (#18) which at the time it was built would have been considered out in the county with almost no development around it and far from the commercial core of Columbia. Also popular in Columbia was the Free Classic Queen Anne style featuring houses with Queen Anne massing and Colonial Revival details, especially the use of classical order columns. Significant examples can be found at 433 Dale Street (#102) and 611 Dale Street (#112a, Photo #10). Housing styles transitioned from Queen Anne to Neoclassical Revival and there were several houses of the Neoclassical Revival style built in the 400 block of Dale Street including 419 Dale (#94a), 421 Dale (#96a), 423 Dale (#97), and a significant one-and-a-half-story example at 425 Dale (#99, Photo #7). A later and very grand example of the Neoclassical style can be found in the First Baptist Church at 409 Dale (#93, Photo #6). It does not appear that there are any surviving examples of the Colonial Revival style in the district even with the prominence of the style in Broad Street – Church Street Historic District south of the Columbia North Residential Historic District.

The Craftsman style became very popular in Columbia, most likely due to the availability of materials via the railroad, and a move to a simpler, more restrained style from the previous highly decorative Queen Anne homes and the classical Neoclassical and Colonial Revival homes. The Craftsman homes constructed in the district were much more modest than previous homes with simplified massing, low-pitched roofs with open eaves and exposed rafters, decorative knee braces in gable ends, gable-front or other porches including matching porte

¹ Marion County Historical Society, *History of Marion County*, p.141.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 5

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

cocheres, low porch walls, and masonry piers with simple wood boxed columns. Craftsman style homes are scattered throughout the district. There are several outstanding examples in the district of the Craftsman style including a two-story example at 433 Ford Street (#153, Photo #11), a brick example at 429 Ford Street (#151), 811 High School Street (#227a), 926 High School Street (#237a) with a matching porte cochere, and 820 Rogers Street (#403). Other good examples of the style include 809 Beauvoir Street (#35), 704 Dale Street (#115), 222 Dewey Street (#131), 808 East Street (#133a), 1121 Gill Street (#194a), 1219 Gill Street (#204), 312 Lafayette Street (#248), 404 Lafayette Street (#254a), 1214 Main Street, North (#316a), 1218 Main Street North (#317a), 907 Oak Street (#325), 911 Oak Street (#326), 921 Oak Street (#328), and 814 Rogers Street (#402).

Interestingly there was one Spanish Colonial Revival house built in the district circa 1935 at 1003 Main Street, North (#304, Photo #20).

The Tudor Revival style was also used in Columbia; however it was not as popular as previous styles and there is only one restrained brick example built in the district at 936 Main Street (#300, Photo #19).

Just before World War II a new style called Minimal Traditional emerged combining elements of earlier styles. The new houses also started to incorporate garages as part of the structure instead of relegating them to outbuildings or using a porte cochere for vehicles. The new Minimal Traditional style favored smaller type cottages embellished with Colonial Revival details, and used simple side gable, cross gable or hip roofs. Also incorporated were multi-paned windows with applied shutters. A number of these houses were constructed in the district, mostly at the eastern end, including a small subdivision of the Minimal Traditional style houses on Broadmor Street called the G&K Subdivision. Outstanding examples of the style include 1006 Broadmor (#64), 1019 Broadmor Street (#75), 408 Dale Street (#92a, Photo #5), 916 Park Avenue (#349), 1213 Park Avenue (#384), and 1219 Park Avenue (#387, Photo #24). Good examples include 1003 Beatrice (#22) 1004 Broadmor Street (#63), 1008 Broadmor Street (#65), 1010 Broadmor Street (#66), 1013 Broadmor Street (#69), 1015 Broadmor Street (#71a), 1107 Gill Street (#191), and 902 Lafayette Street (#295a, Photo #18).

The boom of housing construction after World War II used the Minimal Traditional style but also started using the Ranch style featuring more streamlined and horizontally massed houses with less classical detail. Again the majority of the Ranch Houses were built at the eastern end of the district. Good examples of the style include 1009 Beatrice Street (#28), 1011 Beatrice

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 6

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Street (#30, Photo #1)), 811 Central Street (#90), 723 Dale Street (#122), 803 Lafayette Street (#282), and 1000 Park Avenue (#353).

There are two outstanding examples of the Modern style in the district. One is the Columbia Primary School at 501 Dale Street (#103) built in 1951 and the other is the First Assembly of God Church at 1001 Park Avenue (#354, Photo #23) built in 1957. Both have strong horizontal lines and use brick and glass.

Unfortunately there is one modern subdivision in the district that it is outside of the period of significance. It is located on Greymont Drive and Camellia Court and includes houses built in the 1960s to 1970s.

Interestingly there are still several free-standing historic garage structures left in the district including some two-story versions with apartments above the garages. Some of the significant one-story versions are located at 408 Dale Street (#92b, Photo #5), 421 Dale Street (#96b), 313 Hawkins Street (#224b), 811 High School Street (#277b), 404 Lafayette Street (#254b), and 916 West Street (#414b). The two-story versions with apartments above are located at 611 Dale Street (#112b), 415 Ford Street (#143b), 906 Jackson Street (#224b), and 1021 North Main Street, (#306a). The free-standing garages were constructed between the 1930s and the 1950s.

Throughout the district some of the houses have been sided in vinyl or aluminum siding and some of the original windows have been replaced with new modern windows mostly of metal. Several residential structures with front porches have been modified with new columns and removal of decorative features. The vast majority of the non-contributing elements in the district were either constructed after the period of significance or built during the period of significance and have been heavily altered and no longer retain their historic integrity.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 7

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Inventory of Resources

C = Contributing element; NC = Non-contributing element
PL = Previously listed on the National Register

The inventory is arranged alphabetically by street name in ascending numerical order. Buildings are classified as "contributing" (C) or "non-contributing" (NC) to the historic character of the district. Properties that have already been listed on the National Register are designated as "previously listed" (PL).

Alberta Avenue

1. C 805 Alberta Avenue c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a double front facing gable roof of asphalt shingles on a brick foundation. Front facing gable roof projecting and undercut entry porch supported by tapered wood columns on half height brick piers with cast stone caps. Wood porch deck with concrete steps. The façade is three-bays (D, W, W-paired) with horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash. The door is covered with a wood panel and the entry door faces the side and is a wood slab door with three upper step lights. There is a rectangular louvered vent in the upper gable. Exposed rafter tips are visible.
2. C 806 Alberta Avenue c 1950 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation with vents. There is a concrete entry stoop with concrete steps and a metal rail. The façade is five-bays (W-paired, D, W-paired, W, carport) with asbestos shingle siding. The windows are 2/2 wood double-hung sash horizontally divided. The entry door is a wood slab with an upper diamond light. There are pent metal awnings over the windows and door. The carport is supported by decorative metal posts. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 8 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

3. C 808 Alberta Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a double front facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting and undercut entry porch is supported by wood posts on a wood porch deck with concrete steps and a square wood balustrade between the posts. The porch also has a pent metal awning which forms a carport supported by metal poles. The façade is three-bays (W-paired, D, W-paired) and is sided in horizontal wood Dutch lap siding and corner boards. The windows are 3/1 wood double-hung sash and the entry door is wood with three vertical lights over three horizontal recessed panels. There is a triangular louvered vent in the upper gable. Exposed rafter tips are visible.
4. NC 810 Alberta Avenue c 1945 Craftsman
Two-story, wood frame altered Craftsman with a side facing gable roof of asphalt shingles on a concrete block foundation. One-story, front facing gable roof projecting entry porch is supported by wood posts on a concrete deck with a concrete step. The façade on the first floor is three-bays (W-paired, D, W-paired) and on the second floor is two-bays (W-paired, W-paired) with Hardiboard siding. The windows are 6/6 metal frame single-hung sash and the entry door is metal clad wood with nine lights over two vertical panels with an outer metal and glass storm door. There is a set of stairs on the left side of the house to a shed roof porch for entry to the second floor. The change in the windows, siding, and door has altered the historic character of the Craftsman style.
5. NC 811 Alberta Avenue c 1945 Craftsman Bungalow
One-story, wood frame altered Craftsman Bungalow with a side facing gable roof of asphalt shingles on a painted brick pier foundation with brick infill. Cantilevered front facing gable roof partial width projecting entry porch is supported by knee braces over a concrete stoop and steps. The façade is three-bays (W-paired, D, W-paired) and sided in vinyl. The windows are 2/2 metal frame single-hung sash horizontally divided and the entry door is wood with six recessed panels and an outer metal and glass storm door. The eaves are boxed. The change in the windows and siding has altered the historic character of the Craftsman style.
6. C 900 Alberta Avenue c 1945 Craftsman Bungalow
One-story, brick veneer Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a brick stoop and steps. There is horizontal wood lap siding in the porch gable. The façade is six-bays (W-paired, W-tripled, W-paired, D, W, W-paired). The windows are all 3/1 wood double-hung sash except for the far left paired window which is made up of 6/6 metal frame single-hung sash windows. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 9 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

7. C 901 Alberta Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. Partial width shed roof projecting entry porch with metal panels supported by decorative metal posts on a concrete porch deck with concrete steps. The façade is four-bays (W-paired, D, W-paired, Porch) with asphalt shingle siding. The windows are 3/1 wood double-hung sash. The entry door is not visible through the metal screen door. The side screened porch is supported by wood posts and has an x patterned railing. Exposed rafter tips are visible.
8. C 903 Alberta Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of composition shingles on a brick pier foundation. Partial width front facing gable roof projecting entry porch is supported by wood posts on a concrete stoop and steps. The façade is four-bays (W-paired, D, W-paired, W) with asbestos shingle siding. The windows are 6/6 wood double-hung sash. The entry door is wood with jalousie lights. There is a shed roof carport attached to the left side of the house supported by wood posts. The eaves are boxed.
9. C 908 Alberta Avenue c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with front facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Full width undercut entry porch is supported by wood box columns on a wood porch deck with concrete steps. The façade is four-bays (W, D, D, W) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash with applied louvered shutters. The doors are wood with three vertical lights over three horizontal recessed panels. There is a rectangular louvered vent in the gable. Exposed rafter tips are visible along with knee braces. The house recently burned suffering damage to the interior and side of the house.
10. NC 910 Alberta Avenue c 1940 Craftsman Bungalow
One-story, altered wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation. The partial width front facing gable roof projecting entry porch has been enclosed with siding and windows. The concrete steps to the porch are still visible. The façade is four-bays (D, W-paired, W-tripled, W-paired) with horizontal Masonite siding. The paired windows are 2/2 metal frame single-hung sash horizontally divided and the tripled window is made up of 6/6 metal frame single-hung sash windows. The entry door is metal clad wood with an oval leaded glass light. Exposed rafter tips are visible. The enclosure of the porch and replacement of the windows and siding have contributed to diminishing the historic character of the Craftsman style.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 10 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

11. C 914 Alberta Avenue c 1940 Craftsman Bungalow
One-story, altered wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation. The partial width front facing gable roof projecting entry porch has been enclosed with siding and door. There are concrete steps to the door. The façade is four-bays (W, W, D, W) with asbestos shingle siding except for the enclosed porch which has horizontal wood Dutch lap siding between the wood posts. The windows are 3/1 wood double-hung sash. The entry door is metal clad wood with a fanlight over four projecting panels. Exposed rafter tips are visible.

12. C 920 Alberta Avenue c 1955
One-story, wood frame residence with a front facing gable roof of asphalt shingles on a brick foundation. Partial width flat roof entry porch is supported by decorative metal posts resting on low brick walls. The porch deck is concrete with concrete steps. The façade is three-bays (W-tripled, D, W-tripled) with cedar shake siding. The tripled windows are made up of a central picture window flanked by 1/1 wood double-hung sash windows. The entry door is wood with two recessed panels. There is a shed roof carport supported by wood posts attached to the left side of the house. A triangular louvered vent is located in the gable. The eaves are boxed.

13. NC 922 Alberta Avenue c 1920
One-story, wood frame residence with a cross-gable roof of asphalt shingles on a brick pier foundation with lattice infill. Undercut entry porch supported by wood Tuscan columns on a wood porch deck with concrete steps. The façade is three-bays (W, D, W) with board-and-batten siding under the porch and thin strip horizontal wood lap siding and corner boards on the rest of the house. The window on the left is wood with five lights and applied louvered shutters. The window on the right is a picture window. The entry door is metal clad wood with two vertical lights over two vertical projecting panels. Underneath the front facing gable roof the wall corners are chamfered. The eaves are boxed. The alterations to the windows, door, porch and siding have diminished the historic character of this house.

14. NC 924 Alberta Avenue c 1965 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There are curved brick steps below the entry door. The façade is four-bays (W, D, W-tripled, W). The windows are 2/2 metal frame single-hung sash horizontally divided and the tripled window has a picture window between the 2/2 windows. All of the windows have angled brick sills, outer security bars and applied louvered shutters. The eaves are boxed. There is a shed roof carport attached to the right side of the house supported by wood posts.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 11 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

15. NC 929 Alberta Avenue c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation. Undercut entry porch is supported by decorative metal posts on a concrete stoop with a brick step. The façade is four-bays (Carport, W-paired, D, W-paired). The paired windows on the left are 12/8 metal frame single-hung sash and the ones on the right are 6/6 metal frame single-hung sash. The windows have applied louvered shutters. The entry door is wood with six recessed panels. The carport is supported by decorative metal posts. The eaves are boxed.

16. NC 931 Alberta Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of metal panels on a foundation covered with vertical vinyl panels. Partial width front facing gable roof projecting entry porch is supported by square fluted columns. There are concrete steps to the door and no porch deck. The façade is three-bays (W-paired, D, W-paired) and is sided in vinyl. The windows are 2/2 metal frame single-hung sash horizontally divided. The entry door is metal clad wood with a fanlight over four projecting panels. The eaves are boxed. There is a shed roof carport attached to the right side of the house and supported by square poles. The change in the roofing, siding, windows, door, and porch has diminished the Craftsman character of the house.

17a. C 933 Alberta Avenue c 1940 Craftsman Bungalow
One-story, Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation. Partial width front facing gable roof projecting entry porch is supported by wood box columns on a concrete porch deck with concrete steps. The façade is five-bays (W-paired, W-paired, W-paired, D, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash. All of the windows except those under the porch have applied louvered shutters. The entry door is a wood slab with a fanlight. Exposed rafter tips are visible.

17b. C Outbuilding c 1940
One-story, wood frame outbuilding with a front facing gable roof of metal panels on a concrete foundation. The façade is two-bays (W, D) with asbestos shingle siding. The window is 4/4 wood double-hung sash and the door is wood with five recessed panels. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 12 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

18. C 935 Alberta Avenue c 1910 Queen Anne
One-story, wood frame L-shaped Queen Anne with two front facing gable roofs on a side facing gable roof of composition shingles all on a brick pier foundation with brick infill. Partial width hip roof projecting wrap around entry porch is supported by wood posts on a wood porch deck with concrete steps. Both front facing gables have pent roofs. The façade is seven-bays (W-paired, W, W, D, W, W, D) with horizontal wood lap siding and corner boards. The windows are 2/2 wood double-hung sash. The main entry door on the left is wood with six lights over eight recessed panels and a single light transom above. The other door is wood with two vertical arched lights over two recessed panels. Both doors have an outer wood screen door. Two internal chimneys are visible with corbelled tops. The eaves are boxed.

Beatrice Street

19. C 999 Beatrice Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a double front facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch under the lower gable is supported by a wood post on a concrete deck with concrete steps. The façade is three-bays (W, D, W-paired) with vinyl siding. The single window is a 6/6 wood double-hung sash unit and the paired window is made up of 6/6 metal frame single-hung sash windows. The windows have applied louvered shutters. The entry door is wood with two lights over four recessed panels with an outer metal and glass storm door. There is a rectangular louvered vent in the lower gable. The eaves are boxed. This house is the same plan as 913 Branton Street and a mirror image of 917 Branton Street.

20. C 1001 Beatrice Street c 1955 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. There is a slight projection of the roof over the concrete entry stoop and brick steps. The façade is three-bays (W-tripled, D, W-paired) with aluminum siding. The windows are 6/6 metal frame single-hung sash with applied louvered shutters. The entry door is wood with six recessed panels. There is a small gable over the tripled window unit with a triangular louvered vent in the gable. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 13 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

21. C 1002 Beatrice Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) with a portion of the front façade having a brick veneer wainscot with an angled sill and horizontal wood Dutch lap siding with corner boards above and on the rest of the house. The windows are three light metal frame awning windows with applied louvered shutters. The entry door is wood with three vertical lights over three recessed horizontal panels with an outer metal and glass storm door. Exposed rafter tips are visible. There is a shed roof carport attached to the rear right side of the house supported by metal poles.
22. C 1003 Beatrice Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Slight projection of the roof over the concrete entry stoop with concrete steps is supported by wood posts. The façade is three-bays (W-tripled, D, W-paired) with horizontal wood Dutch lap siding and corner boards. The windows are 6/6 wood double-hung sash. There is a gable with a triangular louvered vent over the paired window. The entry door is wood with two lights over four recessed panels. The eaves are boxed.
23. C 1004 Beatrice Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation covered with lattice. Partial width undercut entry porch is supported by metal fluted columns on a wood porch deck with concrete steps. The façade is three-bays (W-paired, D, W) with asbestos shingle siding. The windows are 3/1 wood double-hung sash with applied louvered shutters. The entry door is metal clad wood with six projecting panels. There is a rectangular louvered vent in the gable. Exposed rafter tips are visible.
24. C 1005 Beatrice Street c 1955
One-story, wood frame residence with a gable-on-hip and side facing gable roof of asphalt shingles on a brick foundation. Partial width flat roof projecting entry porch is supported by wood posts on a low brick wall. There is a concrete porch deck with concrete steps. The façade is four-bays (W-paired, W-paired, D, W-paired) with a brick veneer wainscot with an angled sill and horizontal wood lap siding with corner boards above. The windows are 2/2 wood double-hung sash horizontally divided. The entry door is wood with six recessed panels and an outer metal and glass storm door. The eaves are boxed. There is a shed roof garage addition to the right rear of the house with a thirty-two projecting panel metal garage door.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 14 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

25. C 1006 Beatrice Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a painted brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood posts on a wood porch deck with concrete steps. There is a triangular louvered vent in the gable of the porch. The façade is three-bays (W-paired, D, W-paired) with a combination of vinyl siding and asbestos shingle siding. The windows are 3/1 wood double-hung sash and the entry door is wood with three vertical lights over three horizontal recessed panels with an outer metal and glass storm door. Exposed rafter tips are visible. There is a shed roof carport addition to the rear left side of the house supported by metal poles.

26. C 1007 Beatrice Street c 1955
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a painted concrete block foundation with metal vents. There is a slight projection of the roof for the entry porch over a concrete stoop and steps with metal railings. The façade is three-bays (W-paired, D, W-paired) with vinyl siding. The windows are 6/6 wood double-hung sash with applied louvered shutters. The entry door is a wood slab with three stepped lights and an outer metal and glass storm door. There is a side facing gable roof carport addition to the left side of the house supported by decorative metal posts with lattice panels between. The eaves are boxed.

27. C 1008 Beatrice Street c 1940 Craftsman Bungalow
One-story, brick veneer Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired). The windows are 3/1 wood double-hung sash and the entry door is wood with six recessed panels. There is a triangular louvered vent in the main gable and asbestos shingle siding in the porch gable. There is a shed roof carport addition attached to the left side of the house supported by brick columns. The eaves are boxed.

28. C 1009 Beatrice Street c 1955 Ranch
One-story, wood frame Ranch with a side facing gable roof of metal panels on a brick foundation with brick vents. There is a partial width flat roof projecting entry porch, which extends to become a carport, supported by wood posts on a concrete deck. There are concrete steps from the deck to the entry door. The façade is three-bays (W-paired, W-tripled, W-paired) with horizontal Masonite siding. The windows are 2/2 wood double-hung sash horizontally divided with paneled shutters. The entry door faces the side and is wood with six recessed panels. The eaves are boxed. This house is the same plan as 1011 Beatrice Street.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 15 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

29a. NC 1010 Beatrice Street c 1970 Ranch

One-story, brick veneer Ranch with a rear two-story addition. The one-story portion of the house has a side facing gable roof of asphalt shingles on a brick foundation. The two-story portion has a front facing gable roof of asphalt shingles. Partial width undercut entry porch over a concrete deck. The façade on the one-story portion of the house is five-bays (W, W-tripled, D, W, Carport). The windows are 2/2 metal frame single-hung sash horizontally divided with applied louvered shutters. The entry door is a wood slab with an outer metal and glass storm door. The carport is supported by a decorative metal post. The two-story addition is sided in wood panels and has a paired 2/2 metal frame single-hung sash horizontally divided window unit. A triangular louvered vent is located in the gable of the addition. The eaves are boxed.

29b. NC Garage c 1980

One-story, wood frame garage with a side facing gable roof of asphalt shingles on a concrete foundation. There is an off-set one-car garage wood door with four lights and twelve recessed panels. There is also a wood slab pedestrian door. The garage is sided in board-and-batten.

29c. NC Outbuilding c 1965

One-story, wood frame outbuilding with a side facing gable roof of corrugated metal panels on a concrete foundation. There is a large wood paneled sliding door on the front. The siding on the building is wood panels.

30. C 1011 Beatrice Street c 1955 Ranch

One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. There is a shed roof projecting entry porch, which extends to become a carport, supported by wood posts on a concrete deck. There are brick steps from the deck to the entry door. The façade is four-bays (W-paired, W-tripled, D, W-paired) with horizontal Masonite siding. The windows are 2/2 wood double-hung sash horizontally divided with paneled shutters. The entry door is wood with six recessed panels. The eaves are boxed. This house is the same plan as 1009 Beatrice Street. [Photo #1]

31. NC 1013 Beatrice Street c 1970 Ranch

One-story, brick veneer Ranch on a brick foundation with a side facing gable roof of metal panels. Partial width undercut entry porch is supported by brick columns on a concrete deck. The façade is four-bays (W, D, W, Garage door). The windows are 8/8 metal frame single-hung sash and the entry door is a wood slab with an outer metal and glass storm door. The garage door is metal with sixteen projecting panels. There is a small gable over the left window. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 16 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

32. NC 1015 Beatrice Street c 1980 Ranch
One-story, brick veneer Ranch on a brick foundation with a side facing gable roof of asphalt shingles. The façade is four-bays (W, D, W, W-tripled). The single windows are 8/8 metal frame single-hung sash with board shutters. The tripled window unit looks to be in an infilled garage opening and is made up of 9/6 metal frame single-hung sash windows, also with applied board shutters. The entry door is a wood with three recessed panels and a outer metal and glass storm door. There are brick steps to the door. There is a small gable over the left window. The eaves are boxed.

Beauvoir Street

33. C 806 Beauvoir Street c 1945 Ranch
One-story, wood frame L-shaped Ranch with a cross-gable roof of asphalt shingles on a stucco foundation. The façade is four-bays (W, D, W-paired, W-paired) and is sided in stucco. The windows are 6/6 wood double-hung sash with applied louvered shutters and the entry door is wood with six recessed panels. There is a concrete stoop and steps to the entry door which has a pent metal awning. There is a triangular louvered vent in the front facing gable. There is an undercut porch to the left of the entry door supported by decorative metal posts on a concrete stoop. To the right of that is a carport supported by wood posts. Exposed rafter tips are visible.

34. C 807 A&B Beauvoir Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow duplex with a front facing gable roof of asphalt shingles on a brick foundation. The façade is four-bays (W-paired, D, D, W-paired) with brick veneer wainscoting and vinyl siding above. The windows are 3/1 wood double-hung sash. The entry doors are both wood with six lights over three horizontal recessed panels.

35. C 809 Beauvoir Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing clipped gable roof of composition shingles on a brick pier foundation with brick infill. Small cantilevered front facing gable roof projecting entry porch is supported by knee braces over a concrete stoop and steps with concrete wing walls. The façade is three-bays (W-tripled, D, W-tripled) with horizontal wood lap siding without corner boards. The windows are 3/1 wood double-hung sash and the entry door is wood with six recessed panels. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 17 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Bennett Street

36. NC 898 Bennett Street c 1980 Ranch
One-story, brick veneer Ranch with a side facing gable of asphalt shingles on a concrete foundation. There is a slight roof projection for the entry porch which becomes the carport and is supported by full height brick columns. The façade is five-bays (Carport, W-paired, D, W, W). The paired windows are 9/6 metal frame single-hung sash and the other windows are 6/6 metal frame single-hung sash. All of the windows have applied louvered shutters and angled brick sills. The entry door is metal clad wood with six projecting panels with an outer metal and glass storm door. The eaves are boxed.
37. C 899 Bennett Street c 1950 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a stucco foundation. There is no entry porch and the façade is three-bays (W-tripled, D, W) with stucco siding. The tripled window unit is made up of a central picture window flanked by 4/4 wood double-hung sash windows. The other window is an 8/8 wood double-hung sash unit. The entry door is wood with an upper four-division fan light over four recessed panels with an outer metal and glass storm door. It looks as though a carport or garage has been enclosed with concrete block. The eaves are boxed.
38. C 900 Bennett Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a covered foundation. Partial width undercut entry porch is supported by wood posts on a concrete deck with a concrete step. The façade is three-bays (W, D, W) with flat panel siding with a stucco finish. The window on the left is a 4/4 wood double-hung sash and the one on the right is a 4/4 metal frame single-hung sash. The entry door is metal clad wood with six projecting panels with an outer metal and glass storm door. Exposed rafter tips are visible.
39. NC 901 Bennett Street c 1950
One-story, wood frame residence with side facing gable roof of metal panels on a brick pier foundation. Front facing gable roof projecting entry porch is supported by knee braces over a concrete entry stoop. The façade is three-bays (W, D, W) with vinyl siding. The windows are 2/2 metal frame single-hung sash horizontally divided and the entry door is metal clad wood with a single large projecting panel over two smaller projecting panels. The house has been greatly altered with the new siding, metal roof, and the change in the doors and windows.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 18 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

40. C 902 Bennett Street c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a cross gable roof of asphalt shingles on a brick pier foundation. A partial width front projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. The façade is four-bays (W, D, W, W-paired) with asbestos shingle siding. The window on the left and the paired windows are all 2/2 wood double-hung sash horizontally divided and the other window is 4/4 wood double-hung sash. The entry door is a wood slab door with an outer metal and glass storm door. There is a four light wood frame window in the gable. The porch gable has a rectangular louvered vent. Exposed rafter tips are visible.
41. C 903 Bennett Street c 1945 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a concrete block pier foundation. The entry porch and carport are undercut and supported by wood posts. There is a concrete deck for the entry porch. The façade is four-bays (Carport, W, W-paired, W-paired) with horizontal wood Dutch lap siding and corner boards. The windows are 2/2 wood double-hung sash horizontally divided. The entry door faces the side and is a wood slab door with an outer wood screen door. Exposed rafter tips are visible.
42. NC 904 Bennett Street c 1980 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front projecting entry porch supported by full height brick columns on a concrete porch deck. The façade is five-bays (W, W, D, W, Carport) with a low brick wainscot with angled brick cap and aluminum siding above. The windows are 1/1 metal frame single-hung sash and the entry door is a single French door. The carport is supported by full height brick columns. The eaves are boxed.
43. NC 905 Bennett Street c 1965
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a concrete block foundation. There is no entry porch. The façade is three-bays (W, D, W) with horizontal Masonite siding. The windows are 2/2 metal frame single-hung sash horizontally divided. The entry door is wood with a four division fanlight over four recessed panels. The eaves are boxed.
- 44a. NC 906 Bennett Street c 1970 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is a slight projection of the roof for the entry porch with no supports over a concrete entry stoop. The façade is five-bays (W, W, D, W, Carport). The windows are two-part metal frame sliding windows and the one to the right of the entry door is a three-part window with a central picture window and flanked by two sliding windows. The windows all have applied board shutters. The entry door is metal clad wood with six projecting panels with an outer metal and glass storm door. The carport is supported by metal poles.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 19 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

- 44b. NC Garage c 1980
One-story, wood frame garage with a shed roof of asphalt shingles on a concrete foundation. There are three metal garage doors on the front. The garage is sided in corrugated metal panels.
- 44c. NC Outbuilding c 1980
One-story, wood frame outbuilding with a side facing gable roof of asphalt shingles on a concrete foundation. The façade is four-bays (W, W, D, W) with horizontal Masonite siding. The windows are two-part metal frame sliding windows. The entry door is a wood slab. The eaves are boxed.
45. NC 907 Bennett Street c 1945
One-story, altered Craftsman Bungalow with a front facing gable roof of metal panels on a brick pier foundation. The façade is three-bays (W, D, W) with vinyl siding. The window on the right is a 2/2 metal frame single-hung sash horizontally divided and the other window is a two-part metal frame sliding window; both windows have applied louvered shutters. The entry door is metal clad wood with six projecting panels and a concrete step to the door. There is a rectangular louvered vent in the gable. It appears as if there was originally an undercut entry porch which has been enclosed. Exposed rafter tips are visible. With the alterations to the roof, siding, windows, door and porch enclosure the Craftsman character of the house has been greatly diminished.
46. NC 909 Bennett Street c 1970 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a concrete foundation. There is a slight projection of the roof for an entry porch supported by wood posts on a concrete deck. The façade is four-bays (Bay Window, W, D, W-paired). The windows in the bay are 1/1 metal frame single-hung sash. The single window is a three-part slider and the paired windows are 2/2 metal frame single-hung sash horizontally divided. The windows have applied paneled shutters except for those on the bay. The entry door is wood with an oval leaded light. It appears that the original carport or garage has been enclosed with horizontal wood lap siding and the bay window. The eaves are boxed.
47. C 911 Bennett Street c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a concrete block foundation. A partial width front facing gable roof projecting entry porch is supported by pierced wood columns on a wood porch deck with concrete steps. The façade is three-bays (W, D, W) with horizontal wood Dutch lap siding and corner boards. The windows were 3/1 wood double-hung sash however the upper sash divisions have been broken out. The entry door was wood with two recessed panels; however, the panels have been broken out. Exposed rafter tips are visible. The house is currently abandoned.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 20 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Branton Avenue

48. C 908 Branton Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Slight projection of the roof for an undercut entry porch supported by decorative metal posts on low brick walls. There are concrete steps to the entry door. The façade is three-bays (W-paired, D, W-tripled) with brick veneer wainscot with angled sills and asbestos shingle siding above. The windows are 2/2 wood double-hung sash horizontally divided. The entry door is a wood slab with an outer metal security door. The eaves are boxed.
49. C 910 Branton Avenue c 1945
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a painted brick foundation. Partial width flat roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. There is a front facing gable roof projection with a triangular louvered vent in the gable to the right of the porch. The façade is six-bays (W, W, W-paired, D, W-paired, W) of asbestos shingle siding. The windows are all 6/6 wood double-hung sash except for the far right window which is a 4/4 wood double-hung sash window. The windows have applied louvered shutters. The entry door is wood with a fan light over four recessed panels. The eaves are boxed.
50. C 911 Branton Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation. Partial width undercut entry porch supported by a wood Tuscan column under the gable section. Concrete porch deck with concrete steps. The facade is three-bays (W-paired, D, W-paired) with asbestos shingle siding. The windows are 6/6 metal frame single-hung sash with applied louvered shutters. The entry door is metal clad wood with an oval light over two projecting panels. The eaves are boxed.
51. C 912 Branton Avenue c 1955 Minimal Traditional
One-story, wood frame Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation. Partial width undercut entry porch supported by doubled wood posts on a concrete porch deck. The facade is four-bays (W-paired, W-paired, D, W-paired) with asbestos shingle siding. The windows are 2/2 wood double-hung sash horizontally divided with applied louvered shutters. The entry door is wood with three stepped lights. The eaves are boxed. There is a side facing gable roof carport attached to the right side of the house supported by doubled wood posts on half height brick piers with cast stone caps.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 21 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

52. C 913 Branton Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a front facing double gable roof of asphalt shingles on a brick foundation. Undercut entry porch under the lower gable supported by a decorative metal post on a concrete deck with a concrete step. There is a triangular louvered vent in the lower gable. The façade is three-bays (W, D, W-paired) with asbestos shingle siding. The windows are 6/6 metal frame single-hung sash with applied louvered shutters. The entry door is metal clad wood with six projecting panels and an outer metal and glass storm door. The eaves are boxed. The plan of the house is a mirror image of 917 Branton Street.

53. NC 914 Branton Avenue c 1965
One-story, brick veneer residence with a front facing gable roof of asphalt shingles on a concrete foundation. The façade is three-bays (W-paired, D, W). The windows are 2/2 metal frame single-hung sash horizontally divided. The door is a wood slab with an outer metal and glass storm door. The gable has Masonite lap siding in a diagonal pattern meeting at the center of the gable. There is a shed roof carport attached to the right side of the house supported by wood posts. The eaves are boxed.

54. C 915 Branton Avenue c 1955 Minimal Traditional
One-story, wood frame Minimal Traditional with a front facing double gable roof of asphalt shingles on a brick foundation. Undercut entry porch under the lower gable supported by a decorative metal post on a concrete deck with a concrete step. The façade is three-bays (W, D, W-paired) with asbestos shingle siding. The windows are 6/6 metal frame single-hung sash with applied louvered shutters. The entry door is metal clad wood with six projecting panels with an outer metal and glass storm door. The eaves are boxed.

55. NC 916 Branton Avenue c 1965
One-story, brick veneer residence with a front facing gable roof of asphalt shingles on a brick foundation. Partial width shed roof projecting entry porch becomes a side facing gable roof carport both supported by decorative metal posts. There is a concrete deck for the entry. The façade is four-bays (Carport, W, D, W-paired). The single window is a 6/6 metal frame single-hung sash and the paired window is made up of 9/6 metal frame single-hung sash. The windows have applied louvered shutters. The entry door is a wood slab with an outer metal and glass storm door. There is a triangular louvered vent in the gable which is sided in horizontal Masonite siding. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 22 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

56. C 917 Branton Avenue c 1955 Minimal Traditional
One-story, wood frame Minimal Traditional with a front facing double gable roof of asphalt shingles on a brick foundation. Undercut entry porch under the lower gable supported by a decorative metal post on a concrete deck with a concrete step. There is a triangular louvered vent in the lower gable. The façade is three-bays (W-paired, D, W) with asbestos shingle siding. The windows are 6/6 wood double-hung sash with applied paneled shutters. The entry door is a wood slab with an outer wood screen door with louvers for the lower half. The eaves are boxed. The plan of the house is a mirror image of 913 Branton Street.

57. C 918 Branton Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a double front facing gable roof of asphalt shingles on a stucco foundation. Partial width, front facing gable roof projecting entry porch supported by walls with lattice panels on them. The façade is three-bays (W-paired, D, W) with stucco siding. The windows are 1/1 wood double-hung sash with applied louvered shutters. The entry door is a wood slab with three stepped upper lights and an outer metal and glass storm door. There is a pent metal awning porch to the right of the entry. There is a side facing gable roof carport attached to the left side of the house supported by metal poles. A rectangular louvered vent is located in the lower gable. Exposed rafter tips are visible.

58. NC 919 Branton Avenue c 1965
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood Tuscan columns. The façade is four-bays (W-paired, D, W-tripled, Garage door). The windows are 2/2 metal frame single-hung sash horizontally divided with applied louvered shutters. The tripled window has a picture window flanked by the 2/2 metal frame single-hung sash windows. The entry door is wood with six recessed panels. The garage door is metal with four rows of seven projecting panels and one row of lights. The eaves are boxed.

59. NC 920 Branton Avenue c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of composition shingles on a brick foundation. There is a slight projection of the roof for the entry porch which extends to the carport. There is a concrete entry stoop. The façade is five-bays (W, W, D, W, Carport). The windows are 6/6 metal frame single-hung sash with applied louvered shutters. The entry door is wood with six recessed panels and an outer metal and glass storm door. The carport is supported by wood posts. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 23 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

60. NC 921 Branton Avenue c 1980 Ranch
One-story, brick veneer Ranch with a side facing gable roof of metal panels on a brick foundation. There is a slight projection of the roof for the entry porch which extends to the carport and is supported by brick columns. The façade is four-bays (W, D, W-paired, Carport). The windows are 6/6 metal frame single-hung sash with applied louvered shutters. The entry door is wood with six recessed panels and an outer metal and glass storm door. The carport is supported by brick columns. The eaves are boxed.

61. C 922 Branton Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with concrete block infill. The partial width front facing gable roof projecting entry porch has been enclosed with glass. The façade is three-bays (W-paired, D, W-paired) with vinyl siding. The windows are 3/1 wood double-hung sash. The entry door is wood with three vertical lights over three recessed horizontal panels. There is a rectangular vent in the gable covered with vinyl siding. Exposed rafter tips are visible with knee braces.

Broadmor Avenue

62. C 1002 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps. The façade is five-bays (W, D, W, W, D) with asbestos shingle siding. The windows are 8/8 wood double-hung sash. The doors are metal clad wood with six projecting panels. There are pent metal awnings over the right window and door. The eaves are boxed.

63. C 1004 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps. The façade is four-bays (W, W, D, W) with a brick veneer wainscot with angled sills and asbestos shingle siding above. The windows are 8/8 wood double-hung sash with applied louvered shutters. The door is wood with six recessed panels with an outer wood screen door with the lower half wood louvers. The eaves are boxed. There is a shed roof carport and storage shed attached to the rear left side of the house and supported by metal poles. There are two doors to the shed and both are wood with two recessed panels.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 24 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

64. C 1006 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a hip roof of asphalt shingles on a painted brick foundation. Partial width hip roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps. The façade is four-bays (W, D, W, Porch) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters. The door is wood with two lights over four recessed panels. The undercut porch runs the right side of the house and is supported by decorative metal posts on a concrete porch deck. The eaves are boxed.
65. C 1008 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a painted brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood posts with a square wood balustrade on a concrete porch deck with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters. The door is metal clad wood with nine lights over two vertical projecting panels with a metal and glass storm door. There is a triangular louvered vent in the gable of the porch. The eaves are boxed.
66. C 1010 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with a wood handicap ramp extending from the deck. The façade is four-bays (W, W-paired, D, W-paired) with asbestos shingle siding. The windows are 6/6 wood double-hung sash with applied louvered shutters. The door is wood with two lights over four recessed panels. The eaves are boxed.
67. C 1011 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps. The façade is four-bays (W, D, W, W) with asbestos shingle siding. The windows are 8/8 metal frame single-hung sash with board shutters. The door is a wood slab with three upper stepped lights. The eaves are boxed.
68. C 1012 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters. The door is wood with two lights over four recessed panels. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 25 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

69. C 1013 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with hip roof of asphalt shingles on a brick foundation. Partial width hip roof projecting entry porch is supported by metal fluted columns on a concrete porch deck with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters. The door is wood with six recessed panels. The eaves are boxed.

70a. NC 1014 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by metal fluted columns on a concrete porch deck with concrete steps. The façade is four-bays (W, W-paired, D, W-paired) with vinyl siding. The windows are 6/6 metal frame single-hung sash. The door is wood with two lights over four recessed panels. The eaves are boxed. The change in the windows, siding and porch columns have all diminished the historic integrity of the building.

70b. NC Outbuilding c 1970
One-story, concrete block outbuilding with a side facing gable roof of metal panels on a concrete block foundation. The façade is three-bays (D, W, W). The windows are 6/6 metal frame single-hung sash and the door is metal clad wood with nine lights over two projecting panels.

71a. C 1015 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood box columns with a square wood balustrade between the columns. The porch deck is concrete with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters. The door is wood with two lights over four recessed panels. There is a triangular louvered vent in the gable of the porch. The eaves are boxed.

71b. C Garage c 1955
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. There is single car opening with a wood double-leaf door. The garage is sided in horizontal Masonite siding.

72. C 1016 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of composition shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood box columns on a concrete porch deck with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash. The door is metal clad wood with six projecting panels. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 26 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

73. C 1017 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by metal poles on a concrete porch deck with concrete steps. The façade is four-bays (W, D, W, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with board shutters. The door is wood with two lights over four recessed panels. The eaves are boxed.

74. C 1018 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood box columns on a concrete porch deck with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters. The door is metal clad wood with nine lights over two projecting panels. There is a triangular louvered vent in the gable of the porch. The eaves are boxed.

75. C 1019 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a hip roof of asphalt shingles on a brick foundation. Partial width hip roof projecting entry porch is supported by turned wood columns on a concrete porch deck with concrete steps. The façade is three-bays (W, D, W) with board-and-batten wainscot under the porch with asbestos shingle siding above and on the rest of the house. The windows are 8/8 wood double-hung sash with applied louvered shutters. The door is wood with two lights over four recessed panels. The eaves are boxed. There is a shed roof carport attached to the rear left of the house supported by metal poles.

76. C 1020 Broadmor Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps. The porch gable has a segmental arch connected to the columns. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied paneled shutters. The door is wood with two lights over four recessed panels with an outer metal and glass storm door. The eaves are boxed.

77. NC 1021 Broadmor Avenue 2008
One-story, brick veneer residence with a pyramidal roof of composition shingles on a concrete foundation. Undercut entry porch with no supports over a concrete deck. The façade is four-bays (W, W, D, W) with quoining on the corners. The windows are 6/6 metal frame single-hung sash. The door is wood with an oval sandblasted glass light. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 27 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Camellia Court

78. NC 900 Camellia Court c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch is supported by decorative metal posts on a concrete stoop. The façade is five-bays (Carport, W, D, W, W). The window to the left of the door is a metal frame picture window with six divisions. The other windows are metal frame two-part sliding windows. The entry door is wood with fourteen projecting panels and one upper central light the same size as the panels. The carport is supported by brick columns with a concrete lattice screen between the columns. The eaves are boxed.

79. NC 901 Camellia Court c 1970
One-story, brick veneer U-shaped residence with a gable-on-hip and hip-on-hip roof of metal panels on a brick foundation. There is a partial width undercut entry porch supported by wood posts with a wood rail between. The façade is five-bays (W-tripled, W-paired, D, Garage Door, Garage Door). The tripled window unit is made up of four-light metal frame single-hung sash awning windows with applied louvered shutters. The paired window unit is made up of three-part metal frame awning windows. The entry door is metal clad wood with nine-lights over two vertical recessed panels. The garage doors are metal with sixteen projecting panels. The eaves are boxed.

80. NC 902 Camellia Court c 1965 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Partial width undercut entry porch which becomes a carport and is supported by slender metal poles on a tiled porch deck. The façade is six-bays (W, W, D, W-tripled, W, Carport). The windows are four light metal frame awning windows with applied louvered shutters. The tripled window has a central metal frame picture window flanked by five light metal frame awning windows. The entry door is a wood slab door with three upper horizontal lights. The eaves are boxed.

81. NC 903 Camellia Court c 1965 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. There is no entry porch; however, there is a concrete entry stoop with a metal rail around it. The façade is five-bays (Carport, W-tripled, D, W-paired, W). The single windows are three light metal frame awning windows with applied louvered shutters. The tripled window unit is made up of a central metal frame picture window flanked by three-light metal frame single-hung sash awning windows. The entry door is wood with four lights over four recessed panels. The carport is supported by metal poles on half-height brick columns with cast stone caps and lattice brick infill between the columns. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 28 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

82. NC 905 Camellia Court c 1965 Modern
One-story, wood frame Modern with a low-pitch cross gable roof of metal panels on a brick foundation. The façade is three-bays (W, W, Carport) with a combination of brick veneer and board-and-batten siding above. The front brick veneer extends to brick walls beyond the corners of the house and have decorative metal panels. The windows are two-part metal frame single-hung sash sliding windows. The carport is supported by metal poles. The entry door faces the side and is a wood slab with three stepped horizontal lights. There is a triangular louvered vent in the gable. The eaves are boxed.

83. NC 906 Camellia Court c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch with no supports over a concrete deck with metal rails and concrete steps. The façade is six-bays (Garage Door, Garage Door, W-tripled, D, W, W). The windows are 2/2 metal frame single-hung sash with applied louvered shutters. The tripled window has a central metal frame picture window flanked by 2/2 metal frame single-hung sash with applied louvered shutters. The entry door is a wood slab with an upper diamond light with an outer metal and glass storm door. The garage doors are metal with nine horizontal panels. The eaves are boxed.

84. NC 908 Camellia Court c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation with metal vents. Partial width hip roof projecting entry porch supported by decorative metal posts on a concrete deck with brick steps. The façade is four-bays (W, D, W-tripled, Carport). The single window is a 2/2 metal frame single-hung sash window horizontally divided with applied louvered shutters and the tripled window has a central metal frame picture window flanked by 2/2 metal frame single-hung sash windows with applied louvered shutters. The entry door is a wood slab with three upper horizontal lights and an outer wood screen door. The carport is supported by metal poles. The eaves are boxed.

Central Avenue

85. C 803 Central Avenue c 1955 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation. Front projecting hip roof entry porch supported by decorative metal posts on a concrete porch deck with brick steps. The façade is four-bays (Carport, W-tripled, D, W-paired). The tripled window unit has a picture window flanked by three light metal frame awning windows. The paired window unit is two, three light metal frame awning windows. Both the tripled and paired windows have angled brick sills and applied louvered shutters. The entry door is wood with six recessed panels. The eaves are boxed. The carport is supported by metal poles.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 29 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

86. C 805-807 Central Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow duplex with a side facing gable roof of asphalt shingles on a brick pier foundation with brick infill. There are two front facing gable roof entry porches with gable returns supported by wood posts on concrete stoops with concrete steps. The façade is six-bays (W, D, W, W, D, W) with asbestos shingle siding. The windows are 6/6 metal frame single-hung sash and the entry doors are wood with two recessed panels and wood screen doors. The eaves are boxed.

87. NC 806 Central Avenue c 1960 Ranch
One-story, brick veneer Ranch with a front facing gable roof of asphalt shingles on a brick foundation. The façade is two-bays (W, W). The windows are 2/2 metal frame single-hung sash divided horizontally. There is wood paneling and a triangular louvered vent in the gable. The entry door faces the side and is a metal clad wood door with a modern oval leaded glass insert. There is a carport to the rear right side of the house supported by full height brick columns with brick lattice infill. The eaves are boxed.

88. NC 808 Central Avenue c 1910 Queen Anne
One-story, wood frame Queen Anne, which has been heavily modified, with a cross-gable roof of diamond pattern asbestos shingles on a brick foundation. Front projecting partial width shed roof entry porch is supported by tapered wood columns on half-height brick piers with cast stone caps on wood porch deck with tiled steps and metal rail. The façade is four-bays (W, W, D, W) and has been brick veneered. The windows are replacement 2/2 metal frame single-hung sash horizontally divided and the new entry door is metal clad wood with six projecting panels. The front facing gable has a pent roof and retains the original wood lap siding along with a triangular louvered vent. The eaves are boxed. The alterations to the siding, doors, and windows have diminished the historic integrity of the house. [Photo #3]

89. C 810 Central Avenue c. 1910
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a painted brick pier foundation with concrete block infill. Shed roof full width front projecting entry porch supported by Ionic columns on a wood porch deck with concrete steps flanked by brick wing walls with cast stone caps. The façade is three-bays (W-paired, D, W-paired) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash with applied louvered shutters. The entry door is wood with fifteen lights and is flanked by ten-light sidelights. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 30 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

90. NC 811 Central Avenue c 1960 Ranch
One-story, Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is a slight projection of the roof over the entry area supported by decorative metal posts on a concrete stoop with concrete steps. The façade is five-bays (W-paired, D, W-paired, W, Carport) with a brick veneer wainscot capped with angled brick and wood lap board siding above. The paired window to the left of the door uses three light metal frame awning windows and the paired window to the right of the door uses two light metal frame awning windows. The other window is a single light metal frame awning unit. All of the windows have applied louvered shutters. The entry door is a wood slab with three horizontal stepped lights. The carport is supported by a fluted metal column and there is a wood door to the rear of the carport with nine lights over four triangular recessed panels. The large overhanging eaves are boxed.

91. C 812 Central Avenue c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with lattice infill. There is a pent metal awning over the concrete entry stoop and stairs with metal railings. The façade is three-bays (W-paired, D, W-paired) with horizontal Dutch lap wood siding and corner boards. The windows are 6/6 wood double-hung sash and the right window has a pent metal awning and is smaller than the one on the left. There is a shed roof carport to the right supported by wood posts. A rectangular wood louvered vent is located in the gable. Exposed rafter tips are visible.

Dale Street

92a. C 408 Dale Street c. 1940 Minimal Traditional
One-story, wood frame Minimal Traditional with a cross-gable roof of asphalt shingles on a brick pier foundation with brick infill. Façade is four-bays (W, W-tripled, D, W) with horizontal wood lap siding with no corner boards. Front projecting entry porch with arched opening and recessed wood door with six recessed panels and a metal and glass storm door. The floor of the recessed entry is wood leading to brick steps with a decorative metal rail. Windows are 6/6 wood double-hung sash with applied louvered shutters. The gable front projecting bay with the tripled window has a blind sunburst transom over the center window. In the gable of the front projection is a nine light arched wood window. There are two small gable front dormers with nine light fixed wood windows with boxed eaves. The eaves are boxed with gable returns. [Photo #4]

92b. C Garage c. 1940
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. The horizontal siding is wood lap with no corner boards. There are double hinged wood garage doors each divided into two panels with vertical paneling. The eaves are boxed with gable returns. The architectural detailing of the garage and the materials match the main house. [Photo #5]

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 31 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

93. C 409 Dale Street 1959 Neoclassical Revival
First Baptist Church

Multiple-story, Neoclassical Colonial Revival style religious building complex of brick with a front facing gable roof sanctuary and two wings to either side on a brick foundation. The sanctuary roof is composite shingles. The sanctuary has a projecting gable front portico on a raised base covered in tile with concrete steps and supported by four cast stone columns. The columns have bases and Temple of the Winds capitals. In the tympanum of the portico is a nine light wood oval shaped window with colored glass and bas-relief swags extending from the top of the window that drape down the sides and extend across the tympanum. Under the portico the façade is three bays (D, D, D on the first story and W, W, W on the second story) with a slightly projecting center bay with the main front double-leaf door with a broken pediment cast stone surround. The doors across the front façade are wood with three square lights and a three light transom above the single doors and a five light transom above the central double-leaf door. There are two cast stone panels with bas-relief swag detailing above the single front doors. Above that is a cast stone belt course that terminates into cast stone pilasters with capitals that match the portico columns. Three 6/6 wood double-hung sash windows with colored glass sit on top of the belt course and are framed in cast stone. There is brick quoining at the corners of the building that terminate at the top on an architrave of the front facing gable. A steeple projects above the portico and has a brick base with quoining and a circular nine light wood frame window. Above the brick base is a wood frame octagonal drum with a twenty-two light wood frame window surrounded by pilasters on the four compass directions with louver infill between the pilasters on the other directions. There is a cross pattern balustrade with urns over the box balusters at the corners. Above the first drum there is a second smaller octagonal drum with a circular wood frame nine light window. A spire clad in shingles tops the second drum. Two-story brick veneer wings extend from either side and are set to the rear of the main sanctuary. The left wing has a hipped roof of composite shingles with front facing gable dormers with louvered vents and the windows on the first floor are 6/6 metal frame with 6/6 metal frame windows with fanlights on the second floor. The right wing has a flat roof behind a parapet and has 6/6 metal frame windows on both floors. A small projecting porch supported by Tuscan Columns extends from the right wing. The church was designed by Mattingly & Biggers Architects and Polk Construction Company was the contractor. [Photo #6]

94a. C 419 Dale Street c 1910 Neoclassical Revival

One-story, wood frame Neoclassical Revival residence with a hipped roof of asphalt shingles on a brick foundation. Projecting flat roof full width porch supported by low porch walls with large box columns with bases and simplified capitals all on a wood porch deck with concrete steps with low brick wing walls. The fourth bay on the right is screened. The façade is three-bays (W-paired, D, W-paired) with horizontal aluminum siding. The windows are 1/1 wood double-hung sash with applied louvered shutters and the door is wood with an oval glass light. There is a hipped roof dormer with a circular wood louvered vent. Wide overhanging boxed eaves.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 32 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

94b. NC Shed c 2000
Modern metal shed structure to the rear of the house with a front facing gable metal roof and vertical metal panel siding with two 1/1 metal frame windows.

95a. C 420 Dale Street c 1950
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a concrete foundation. The façade is four-bays (W, D, W, W) with vinyl Dutch lap style siding. The undercut partial width front porch is supported by decorative metal posts on a concrete porch deck the level of the sidewalk. There is a concrete stoop and steps to the front door. The windows are 8/8 wood double-hung sash with wood panels below the windows and applied louvered shutters. The front door is wood with six recessed panels and an arched fanlight and single light sidelights over a wood panel. There are two front facing gable roof dormers with wood louvered vents. The eaves are boxed.

95b. NC Garage c 1970
Former garage with front facing gable roof of asphalt shingles on a concrete foundation. The garage door area has been infilled with four light fixed windows with applied louvered shutters. The garage is sided in vinyl to match the house.

96a. C 421 Dale Street c 1910 Neoclassical Revival
One-story, wood frame Neoclassical Revival with a hip roof of asphalt shingles on a brick pier foundation with brick infill. Undercut full width screened porch supported by wood box columns with dentiled capitals on a wood porch deck with concrete steps and metal railings. The façade is three-bays (W-paired, D, W-paired) with horizontal wood Dutch lap siding. The windows are 1/1 wood double-hung sash and the door is wood with a glass panel and single light transom above. There is a hipped roof dormer with three wood louvered vents. The eaves are boxed.

96b. C Garage c 1930
One-story, wood frame garage with a hip roof of asphalt shingles. The façade has wood lap siding with wood barn doors.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 33 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

97. C 423 Dale Street c 1910 Neoclassical Revival
One-story, wood frame Neoclassical Revival with a gable-on-hip roof of asphalt shingles on a brick pier foundation with concrete block and brick infill. Full width undercut front screened porch supported by wood box columns with dentiled capitals on brick pedestals with cast stone caps. There is a wood porch deck with concrete steps, metal railings, and low brick wing walls. The façade is three-bays (W, D, W-paired) with horizontal wood Dutch lap siding. Windows are 1/1 wood double-hung sash and the door is a fifteen light wood frame door with a single light transom. There is a single light window in the front gable with a dentiled window cornice. The eaves are boxed with supporting brackets.
98. C 424 Dale Street c 1900 Queen Anne
One-story, wood frame Queen Anne with side facing clipped gable roof of asbestos diamond pattern shingles on a brick pier foundation with brick infill. Front projecting shed roof porch supported by wood box columns with turned balusters between the columns and on a brick porch deck with brick steps. Front facing pent gable roof projection with a corner chamfers and a rectangular covered vent or window. The façade is six-bays (W, W, W, D, W, W) and sided in vinyl. The windows are 1/1 wood double-hung sash and the door is wood with a large glass light and single light sidelights and a single light transom. There is a front facing gable dormer over the entry door with a paired 1/1 windows. On the left side is a side facing gable roof carport supported by metal columns. To the right is a garage addition with a sixteen panel metal garage door. The eaves are boxed.
99. C 425 Dale Street c 1900 Neoclassical Revival
One-story, wood frame Neoclassical Revival with a hipped roof of asphalt shingles on a brick pier foundation with brick infill in a lattice pattern. Front projecting shed roof porch supported by wood Ionic columns on a wood porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) with horizontal wood Dutch lap siding. The windows are 1/1 wood double-hung sash and the entry door is wood with a glass light over two recessed horizontal panels and a two light transom above. Large front facing gable dormer with 1/1 wood double-hung sash paired windows and a small rectangular wood louvered vent. The eaves are boxed. [Photo #7]
100. C 426 Dale Street c 1950 Ranch
One-story, wood frame Ranch with a side facing gable roof of composite shingles on a brick pier foundation with brick infill. The facade is three-bays (D, W, W-paired) with a combination of wood shakes and vertical paneling in the recessed entry area with a brick porch stoop. The single window is a 6/6 wood double-hung sash with applied louvered shutters and the paired window has 9/9 wood double-hung sash. The entry door is wood with six recessed panels, a three light sidelight, and a four light transom. The projecting eaves have exposed rafter tips. Carport is to the left with a side facing gable roof of composite shingles supported by metal poles.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 34 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

101. NC 431 Dale Street c 1980 Ranch
One-story, brick veneer Ranch with a hip on hip roof of modern metal panels and on a brick foundation. There is a recessed entry area supported by a decorative metal post on a concrete porch deck with concrete steps and a metal rail. The façade is four-bays (W, W-paired, D, W). The windows are 2/2 metal frame with horizontal divisions and angled brick sills. The entry door is wood with three recessed square panels and a wood screen door. There is a brick chimney with an arched brick cap. The eaves are boxed.

102. C 433 Dale Street c 1900 Free Classic Queen Anne
One-and-a-half story, wood frame Free Classic Queen Anne with a hipped roof of asphalt shingles on brick pier foundation covered with lattice. Wrap around hipped roof projecting porch supported by wood Tuscan columns on a wood porch deck with concrete steps. The façade is five-bays (W-paired, W-paired, D, D, W-paired) with horizontal wood lap siding with corner boards. The paired windows to the far left are 9/1 wood double-hung sash in a Craftsman pattern and the other windows are 4/4 wood double-hung sash. The front doors are both wood with a single light over three recessed panels and two light transoms above. Both have wood screen doors. The eaves are boxed.

103. C 501 Dale Street 1951 Contemporary
Columbia Primary School
One-story, Contemporary L-shaped brick school building is on a concrete foundation with low-pitched gable roofs of metal panels. There is a flat roof porte-cochere supported by metal poles for the entry which is made up of double-leaf aluminum frame glass doors with glass sidelights. To the right of the entrance is the cafeteria mass of the building which has a higher roofline than the classroom wing that extends behind the entrance. The windows used on the building are metal frame awing type windows ganged together to form ribbon windows especially on the classroom wing where the only division between the windows is a small area for the wall division. The roof forms a large overhang over the windows to block some of the sun on the building. There is a large gymnasium addition to the rear of the classroom wing. The building was designed by N.W. Overstreet.

104. NC 504 Dale Street c 1960 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a concrete foundation. Slightly projecting entry porch and carport supported by wood posts on a concrete deck. Façade is five-bays (Carport, W-paired, D, W, W). The paired window is made up of 3/2 horizontally divided metal frame single-hung sash windows with applied louvered shutters. The other windows are 2/2 horizontally divided metal frame single-hung sash windows with applied louvered shutters. The entry door is a wood slab door with a metal frame storm door. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 35 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

105. C 508 Dale Street c 1940
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick foundation. Projecting entry bay with a front facing gable roof. The façade is four-bays (W, D, W, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash divided vertically in the upper sash. The entry door is recessed and wood with eight upper lights over three vertical recessed panels with an outer metal and glass storm door. The eaves are boxed. There is a shed roof carport addition to the rear supported by a wall.

106. C 512 Dale Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with concrete block infill. Full width projecting entry porch with a partial front facing gable and shed roof supported by wood box columns on a wood porch deck with concrete steps with low brick wing walls with cast stone caps. The façade is three-bays (W-paired, D, W-paired) with wood lap siding and no corner boards. The windows are 3/1 wood double-hung sash divided vertically in the upper sash. The entry door is wood with eight upper lights over three recessed horizontal panels. The door has sidelights with three lights over a panel and a three light transom. Both gables have a rectangular wood louvered vent. The projecting eaves have exposed rafter tips.

107a. C 516 Dale Street c 1900 Queen Anne
Two-story, wood frame Queen Anne with hip and cross-gable roof of diamond pattern asbestos shingles on a brick pier foundation with concrete block infill. Projecting hipped roof wrap around screened porch on the first floor supported by turned columns on a wood porch deck with concrete steps. The projecting cross-gable bay has chamfered corners and a wood rectangular louvered vent in the gable. The façade on the first floor is four-bays (W-paired, D, W, W) with horizontal wood lap siding with corner boards. The windows are 1/1 wood double-hung sash and the entry door is wood Queen Anne style with a single glass light over a panel sided with pilasters. The second floor façade is four-bays (W-tripled, W, W, W). The paired window unit is made up of 4/4 wood double-hung sash windows and the other windows are 3/1, 1/1, and 1/1 wood double-hung sash. The projecting eaves are boxed.

107b. C Garage c 1940
One-story, wood frame garage with a front facing gable roof of diamond pattern asbestos shingles on a concrete foundation. The opening for the garage is cased with chamfered corners. The siding is vertical panels.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 36 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

108. C 601 Dale Street c 1900 Queen Anne
One-story, wood frame Queen Anne with hip and cross-gable roof of diamond pattern asbestos shingles with tile ridge caps on a brick pier foundation with concrete block infill. Projecting hipped roof wrap around porch supported by turned columns with brackets on a wood porch deck with concrete steps. The façade is five-bays (D, W, W, W, W) with horizontal wood lap siding with corner boards. The windows are 2/2 wood double-hung sash and the entry door is wood with two upper arched glass lights and two lower projecting vertical panels and a two light transom. There are verge boards in the gables. The eaves are boxed. Two interior brick chimneys are visible and have corbelling at the top. There is a flat roofed carport to the rear right supported by round metal columns.

109a. C 606 Dale Street c 1945
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Small projecting front facing gable entry porch supported by decorative metal posts on a concrete stoop covered in broken tiles. The façade is four-bays (W-paired, D, W-paired, W-paired) with cedar shake siding. The windows are 3/1 wood double-hung sash with applied louvered shutters. The entry door is wood with six recessed panels and an outer glass storm door. The eaves are boxed.

109b. C Garage c 1950
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. The garage is sided in horizontal wood lap siding with no corner boards and has a metal sixteen panel garage door in a chamfered cased opening and a wood three recessed panel pedestrian door.

110. C 607 Dale Street c 1940
One-story, wood frame residence with side facing gable roof of asphalt shingles on a brick foundation with iron vents. Front facing gable entry porch supported by double decorative metal posts on a concrete porch deck with concrete steps. The gable of the porch is arched and has gable returns. The façade is four-bays (Enclosed Porch, W-tripled, D, W-paired) with asbestos shingle siding. The porch has been enclosed with a single light glass between the outer columns and a central paired 2/2 metal frame single-hung sash. The columns for the porch are still visible as well as the concrete porch deck. Below the windows the porch has been enclosed with horizontal wood lap siding. The tripled window unit has 2/2 wood double-hung sash outer windows with a single light picture window between. The other paired window unit is made up of 2/2 wood double-hung sash windows. All of the windows have a pent metal awning. The entry door is wood with six recessed panels and outer screen door with the lower half wood louvers. There are two front facing gable dormers with 1/1 fixed light windows. The eaves are boxed. There is a flat roof carport to the left supported by metal poles. The eaves are boxed.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 37 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

111. C 609 Dale Street c 1945
One-story, brick veneer residence with a side facing gable roof of asphalt shingles on a brick foundation. Projecting cantilevered entry porch supported by knee braces and over a concrete stoop with concrete steps. The facade is five-bays (W, W, D, W, W). The windows are 3/1 wood double-hung sash with applied louvered shutters. The entry door is wood with three horizontal panels and a diamond light in the upper panel and with a metal and glass storm door. The projecting eaves have exposed rafter tips.

112a. C 611 Dale Street c 1910 Free Classic Queen Anne
One-story, wood frame Free Classic Queen Anne with gable-on-hip roof of asphalt shingles on a brick pier foundation with wood lattice infill. Projecting hip roof wrap around porch supported by wood Tuscan columns on a wood porch deck with brick steps. The facade is six-bays (W, D, D, W, W, D) with horizontal wood lap siding with corner boards. The first window on the left is wood with a small upper light of sixteen divisions over a single light. The other windows are 2/2 wood double-hung sash. The entry door is Queen Anne in style with one light over a single recessed panel, sidelights of three lights over a single recessed panel flank the door and there is a single light transom over the door. There is an angled arched wood louvered vent in the gable. The eaves are boxed. Two interior brick chimneys are visible and have corbelling at the top. [Photo #10]

112b. C Garage c 1950
Two-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. The garage is sided in horizontal wood lap siding with no corner boards. There is a two car chamfered corner garage opening on the first floor with a metal column support in the middle of the opening. The second floor has paired 6/6 wood double-hung sash windows and a rectangular wood louvered vent in the gable. Wood stairs to the left of the opening go to the second floor and are covered by a roof extension. The eaves are boxed.

113. C 612 Dale Street c 1940
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick foundation. Projecting cantilevered entry porch supported by knee braces and over a concrete stoop with concrete steps. The facade is five-bays (W, W, D, W, W). The windows are 6/6 wood double-hung sash. The entry door is wood with two recessed panels. The projecting eaves have exposed rafter tips.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 38 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

114. C 614 Dale Street c 1910 Queen Anne
Two-story, wood frame Queen Anne with cross-gable roof of diamond pattern asbestos shingles with ridge caps on a brick pier foundation brick infill. Front projecting wrap around porch supported by wood box columns with simplified capitals on a wood porch deck and wood steps. The façade on the first floor is five-bays (W-paired, W, D, W, W-paired) and on the second floor is three-bays (W, W-paired, W). The house is sided in vinyl. The paired windows to the left on the first floor are 3/1 wood double-hung sash, the next two windows are 2/2 wood double-hung sash and the remaining paired windows are 4/4 wood double-hung sash. The windows on the second floor are all 2/2 wood double-hung sash. The eaves are boxed. There is one internal brick chimney visible. A carport supported by slender metal columns with a metal panel roof is attached to the rear of the house.

115. C 704 Dale Street c 1925 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a double gable-on-hip roof of asphalt shingles on a brick pier foundation with brick lattice infill. Partial width, undercut entry porch supported by box columns on a wood porch deck with concrete steps and a metal rail between the columns. The façade is four-bays (W, W, D, W-paired) with horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash with the paired windows having applied louvered shutters. The entry door is wood with three vertical lights over three horizontal recessed panels and an outer wood screen door with the lower half louvers. There is a rectangular louvered vent in the upper gable. Exposed rafter tips are visible. A shed roof carport supported by slender metal columns is attached to the left of the house.

116. NC 708 Dale Street c 1980 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a concrete foundation. Gable front projecting partial width entry porch supported by wood box columns on a concrete deck. The façade is four-bays (W, W, D, Carport) with horizontal HardiBoard siding with corner boards. The windows are 6/6 metal frame single-hung sash with applied paneled shutters. The entry door is metal clad wood with two vertical lights over two projecting vertical panels. The carport is under the main roof and supported by a wood Tuscan column. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 39 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

- 117a. C 710 Dale Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a concrete block foundation. Front facing gable roof partial width projecting screened entry porch is supported by wood box columns on a concrete deck with concrete steps. There is a triangular wood louvered vent in the gable of the porch. The façade is five-bays (W-paired, W, D, W, W-paired) with asbestos shingle siding with corner boards. The windows are 6/6 wood double-hung sash and the entry door is wood with six lights over three horizontal recessed panels. There are exposed rafter tips.
- 117b. C Garage c 1940
One-story, wood frame garage with front facing gable roof of asphalt shingles on a concrete foundation. The two car garage opening is cased. Siding is asbestos shingles.
118. C 714 Dale Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a brick pier foundation. Full width hip roof front projecting entry porch is supported by wood box columns on a wood porch deck with concrete steps. The façade is four-bays (W, D, W, W) with thin strip horizontal wood lap siding with corner boards. The windows are 4/4 wood double-hung sash with applied louvered shutters. One internal brick chimney is visible. Exposed rafter tips are visible.
119. C 716 Dale Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a brick pier foundation with lattice infill. Partial width undercut entry porch supported by a wood box column on a wood porch deck with concrete steps. The façade is four-bays (W, W, W, W) and sided in vinyl. The windows are 9/1 wood double-hung sash in a Craftsman pattern. The entry door is on the side of the porch and is a slab wood door. The eaves are boxed.
120. C 721 Dale Street c 1950 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is a slight projecting overhang of the roof over the entry and covering a slate covered stoop and steps. The façade is four-bays (W, W-tripled, D, W) with HardiBoard horizontal siding with corner boards. The windows are 2/2 wood double-hung sash with applied paneled shutters and the entry door is wood with two lights over four recessed panels with a glass storm door. There is a shed roof carport attached to the right of the house supported by wood posts. The eaves are boxed. The house is very similar in detailing and plan to 723 Dale Street.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 40 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

121. C 723 Dale Street c. 1950 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation with brick lattice infill. There is a slight projecting flat roof porch over the entry door and concrete entry stoop which becomes the carport and is supported by slender metal columns. The façade is three-bays (W, W-tripled, D) with HardiBoard horizontal siding with corner boards. The windows are 2/2 wood double-hung sash with applied paneled shutters and the entry door is wood with three horizontal lights over three recessed horizontal panels. There is a five horizontal recessed panel wood door under the carport. The eaves are boxed. The house is very similar in detailing and plan to 721 Dale Street.

122. C 725 Dale Street c. 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of composite shingles on a brick pier foundation with brick infill. Gable front projecting entry porch supported by knee braces over a concrete steps with wood railings. The façade is three-bays (W, D, W) with thin strip horizontal wood lap siding with corner boards. Shed roof addition to the left with wider board horizontal wood lap siding with corner boards. The first window on the left is a small 6/6 wood double-hung sash window and the other window is 3/1 wood double-hung sash. The entry door is a wood slab with one upper diamond light and a metal and glass storm door. There are exposed rafter tips.

Dewey Street

123. C 204 Dewey Street c. 1910
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick pier foundation with corrugated metal panel infill. There is an undercut L-shaped partial width entry porch supported by tapered wood columns on half height brick piers with cast stone caps on a wood porch deck with concrete steps flanked by brick wing walls with cast stone caps. The façade is five-bays (D, W, D, W, W) with horizontal wood Dutch lap siding and corner boards. The windows are 1/1 wood double-hung sash and the doors are Queen Anne in style with a single light with decorative molding over six recessed panels and a single light transom above. Exposed rafter tips are visible.

124. NC 207 Dewey Street c. 1940
One-story, wood frame altered Craftsman Bungalow with a hip roof of asphalt shingles on a concrete block foundation. There is a slight projection of the roof over the concrete entry stoop. The façade is three-bays (W, D, W) with paneled siding. The windows are 2/2 metal frame single-hung sash horizontally divided and the entry door is wood with six lights over three recessed panels. The eaves are boxed. The house has been heavily modified with enclosure of the front porch, new siding and replacement windows so that it no longer resembles its original Craftsman character.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 41 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

125a. C 208 Dewey Street c 1900

One-story, wood frame residence with a side facing gable roof of asphalt shingles on a concrete block foundation. Partial width projecting shed roof front entry porch is supported by wood box columns on a wood porch deck with concrete steps. The façade is three-bays (W, D, W) with horizontal flush board siding under the porch and horizontal wood lap siding and corner boards on the rest of the façade. The windows are covered with corrugated metal panels and the entry door is wood with a single light over three recessed panels and a two light transom above. The eaves are boxed.

125b. C Outbuilding c 1900

One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick pier foundation. Partial width projecting entry porch is supported by wood columns on a concrete porch deck that has been partially enclosed. The façade is two-bays (W,W) with paneled siding. The windows are 1/1 wood double-hung sash and the entry door is on the side. Exposed rafter tips are visible.

126. C 209 Dewey Street c 1930 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a brick pier foundation with concrete block infill. The full width entry porch is undercut and supported by full height brick columns on the ends and wood posts on half height brick columns with cast stone caps in the center. There is a concrete porch deck and steps. The façade is four-bays (W, D, D, W) with horizontal wood lap siding and corner boards. The windows are 2/2 metal frame single-hung sash horizontally divided and the doors are wood with three horizontal upper lights over three horizontal recessed panels. Exposed rafter tips are visible.

127. NC 212 Dewey Street c 1910

One-story, brick veneer, heavily altered, residence with a side facing broken slope gable roof of asphalt shingles on a brick foundation with vents. Full width undercut entry porch supported by wood posts on a concrete deck with concrete steps. The façade is three-bays (W, D, W). The windows are 3/2 metal frame single-hung sash and the entry door is wood with seven panels and an outer metal security door. The eaves are boxed. It appears that the original siding has been covered with brick and that the front façade has been altered with the openings and the replacement windows and door.

128. C 216 Dewey Street c 1930 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of asphalt shingles on a brick pier foundation. Full width undercut entry porch supported by turned wood columns on a concrete porch deck with brick steps flanked by low brick wing walls with cast stone caps. The façade is four-bays (W-paired, D, D, W-paired) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash and the entry doors are metal clad wood with six projecting panels. Exposed rafter tips are visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 42 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

129. C 220 Dewey Street c 1930 Craftsman Bungalow
One-story, Craftsman Bungalow with a hip roof of asphalt shingles on a foundation that is covered with metal panels. A front facing gable roof partial width projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps and has a wood triangular louvered vent in the gable. The façade is four-bays (W, W, D, W) with thin strip horizontal wood Dutch lap siding and corner boards. The windows are 3/1 wood double-hung sash with applied louvered shutters and the entry door is a wood slab with two horizontal upper lights. Exposed rafter tips are visible.

130. C 222 Dewey Street c 1935 Craftsman Bungalow
One-story, Craftsman Bungalow with a side facing clipped gable roof of asphalt shingles on a brick pier foundation with brick lattice infill. Cantilevered front facing gable roof projecting entry porch supported by knee braces with a scalloped valance over a concrete stoop with brick steps. The façade is four-bays (Porch, W-tripled, D, W-tripled) with thin strip horizontal wood lap siding and corner boards. The side porch is supported by wood posts on a wood porch deck. The windows are 3/1 wood double-hung sash and the entry door is wood with three vertical upper lights over a single recessed panel. Exposed rafter tips are visible.

131. C 223 Dewey Street c 1945
Two-story, brick veneer apartment building with a side facing gable roof of composition shingles on a brick foundation with metal vents. Partial width, front facing gable roof projecting entry porch supported by turned columns on a wood porch deck with wood steps and wood rails. There is a wood handicap ramp that extends from the left side of the porch. The façade is five-bays (W-paired, W-paired, D, W-paired, W-paired) on the first floor with a similar configuration on the second floor with the only difference an eight light circular window in the center bay where the door is on the first floor. The windows are 6/6 metal frame single-hung sash with angled brick sills. The entry door is wood with six lights over three recessed panels. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 43 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

East Avenue

132a. C 808 East Avenue c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asbestos shingles with ridge caps on a brick pier foundation with brick infill. There is an undercut and wrap around entry porch supported by wood box columns on half-height brick piers with cast stone caps on a wood porch deck with concrete steps and low brick wing walls with cast stone caps. The façade is three-bays (W, D, W-tripled) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash with applied louvered shutters and the Craftsman style entry door is wood with three vertical lights over one recessed panel. There is a front facing gable roof dormer with a rectangular wood louvered vent. Exposed rafter tips are visible. There is one interior brick chimney visible.

132b. C Garage c 1945
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. There is a single, metal panel garage door and the garage is sided in Dutch lap wood siding.

133. C 810 East Avenue c 1950 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is flat roof projecting entry porch supported by Corinthian columns on a brick porch deck with brick steps. Above the columns the fascia board of the porch has a bas-relief swag. The façade is five-bays (W, W, W, D, W) and has quoining on the corners. The windows are 6/6 wood double-hung sash with angled brick sills and the entry door is metal clad wood with six projecting panels and an outer glass storm door. The eaves are boxed and have applied brackets with bas relief swags in between.

134. C 813 East Avenue c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with brick lattice infill. There is small front facing gable roof projecting entry porch supported by metal poles with a metal rail on a concrete stoop with concrete steps. The façade is four-bays (Carport, W-tripled, D, W-paired) with asbestos shingle siding. The tripled window is wood double-hung sash with a picture window between 1/1 windows. The paired window is 3/1 wood double-hung sash. Both window units have applied louvered shutters. The entry door is a wood slab with three stepped lights and an outer wood screen door with lower wood louvers. The carport is supported by small metal poles. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 44 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

135. C 816 East Avenue c. 1955
Church of the Nazarene

One-story, brick veneer church with a cross-gable roof of asphalt shingles on a brick foundation. There is front facing gable roof projecting and undercut entry porch supported by brick columns on a concrete porch deck. The façade is seven-bays (W, D, W, W, W, W-paired, W-paired). The single window to the left is an 8/12/8 metal frame window with a wood panel below. The other windows are 6/6 metal frame single-hung sash with angled brick sills. The entry door is a double aluminum and glass commercial door. The eaves are boxed.

136. C 929 East Avenue c 1950 Ranch

One-story, wood frame Ranch with a cross-gable roof of asphalt shingles on a brick foundation. Partial width projecting shed roof screened entry porch supported by wood posts on a concrete deck with concrete steps. The façade is four-bays (W, D, W-paired, D) with Masonite siding. The windows are 6/6 wood double-hung sash with applied louvered shutters. The entry door is wood with nine recessed panels and the other door is wood with six recessed panels. A triangular louvered vent is located in the gable. The eaves are boxed. There is a shed roof carport addition to the front of the house supported by decorative metal posts.

137. NC 931 East Avenue c 1970 Ranch

One-story, wood frame Ranch with a side facing gable roof of metal panels on a brick foundation with metal vents. There is a partial width undercut entry porch and carport supported by wood posts. The façade is four-bays (W-paired, W-tripled, W-paired, W-paired) with Masonite siding. The windows are 2/2 metal frame single-hung sash horizontally divided. The entry door faces the side and is wood with six recessed panels. The eaves are boxed.

138. NC 933 East Avenue c 1960 Ranch

One-story, wood frame Ranch with a side facing gable roof of metal panels on a brick foundation. There is a partial width projecting gable front entry porch supported by knee braces over a concrete stoop with concrete steps. The façade is five-bays (Carport, W, W-paired, D, W-paired) with horizontal wood lap siding and corner boards. The window to the far left is a two part metal frame slider window and the others are 2/2 metal frame single-hung sash windows. The entry door is wood with an arched panel and three stepped lights. The carport is under the main roof and supported by tapered wood columns on half-height brick piers with cast stone caps.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 45 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

139a. NC 935 East Avenue c 1960 Ranch

One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is a slight partial width roof projection over the entry porch supported by decorative metal posts on a concrete slab with concrete steps to the entry door. The façade is three-bays (W-paired, D, W-paired) with a combination of brick veneer wainscoting with an angled brick cap and horizontal wood lap siding and corner boards above. The windows are 2/2 metal frame single-hung sash horizontally divided. The door is a wood slab with a glass storm door. The eaves are boxed.

139b. NC Outbuilding c 1970

One-story, wood frame outbuilding with a front facing gable roof of asphalt shingles on a concrete foundation. The façade has a wood slab door with an outer metal and glass storm door. The siding is wood panels with batten strips. The eaves are boxed.

First Street

140a. C 103 First Street c 1950 Minimal Traditional

One-story, wood frame Minimal Traditional with a side facing gable roof of composition shingles on a brick foundation with metal vents. There is a partial width front facing gable roof projecting entry porch supported by fluted metal columns on a brick stoop and steps. The façade is five-bays (D, W, D, W, W) with vinyl siding. The windows are 8/8 wood double-hung sash and the door on the left is metal clad wood with nine lights over two projecting panels. The door on the right is the main entry door and is wood with three vertical upper lights in a stepped pattern. There is one pressed metal chimney visible. The eaves are boxed.

140b. C Carport c 1955

One-story, carport with a front facing gable roof of asphalt shingles supported by wood posts on a concrete slab. There is horizontal wood lap siding in the gable and partially on the sides.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7

Page: 46

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Ford Street

141a. C 413 Ford Street c 1940 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a front facing gable roof of asbestos shingles on a painted brick pier foundation with brick infill. Partial width front facing gable roof porch projection supported by decorative metal posts with brackets on brick piers with a brick wall between. Wood porch deck with concrete steps and metal rails. The façade is three-bays (W-paired, D, W-paired) with asbestos shingle siding. The windows are 9/1 wood double-hung sash in a Craftsman pattern. The entry door is wood with six recessed panels. Both gables have rectangular louvered wood vents. The projecting eaves have exposed rafter tips and are supported by knee braces.

141b. C Storage Building c 1950

One-story, wood frame storage building with a front facing gable roof of asphalt shingles on a concrete foundation. Façade is three-bays (W, D, W) with horizontal wood Dutch lap siding with corner boards. The windows are 2/2 metal frame single-hung sash with horizontal divisions and the door is wood with five recessed panels. The projecting eaves have exposed rafter tips.

142a. C 415 Ford Street c. 1940 Craftsman Bungalow

One-story, brick veneer Craftsman Bungalow with double front facing gable roof of asphalt shingles on a brick foundation. Small front facing gable entry porch supported by knee braces and decorative metal posts on a concrete porch stop with concrete steps and metal rails. Façade is four-bays (W, D, W, Porch). Windows are 1/1 wood double-hung sash on brick sills and have pent metal awnings. The entry door is wood with six small upper lights over a single recessed panel. The porch is supported by brick columns and is screened. There are arched wood louvered vents in each gable. The eaves are boxed.

142b. C Garage c. 1950

Two-story, wood frame garage with front facing gable roof of asphalt shingles on a concrete foundation. The garage is sided in horizontal wood lap siding. The first story has two sets of wood barn doors with a single recessed panel with a diamond light over four recessed panels in a cross pattern. There is a shed metal roof over the doors. The second story has a paired 2/2 wood double-hung sash window unit divided horizontally. The projecting eaves have exposed rafter tips.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 47 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

143a. NC 417 Ford Street c. 1970 Ranch

One-story, brick veneer Ranch with a hip roof of composite shingles on a brick foundation. Undercut entry porch supported by a decorative metal post on a concrete stoop with concrete steps. The façade is five-bays (W, W, D, W, Carport) and has two different brick colors with a lighter brick on the bottom divided from the upper darker bricks by an angled brick belt course. The windows are three light metal frame awning units with applied louvered shutters. The carport is supported by metal columns on a low brick wall. The eaves are boxed.

143b. NC Garage c. 1980

Former, one-story, two-car garage with a hip roof of asphalt shingles on a concrete foundation. The two garage openings have been filled with double-leaf fifteen light French doors. The eaves are boxed.

144. C 419 Ford Street c. 1920

One-story, wood frame residence with a front facing gable roof of asphalt shingles on a brick foundation. Partial width projecting entry porch with a front facing gable roof with an arched opening supported by wood box columns on a low wall. Wood porch deck with concrete steps. The façade is six-bays (W, W, W-tripled, W, W, D) with vinyl siding. The two far left windows are 4/1 wood double-hung sash with applied louvered shutters. The tripled window is 12/1, 16/1, 12/1 with applied louvered shutters. The next window is a 9/9 wood double-hung sash and the last is a 16/1 wood double-hung sash, both with applied louvered shutters. The entry door is wood with sixteen lights over three horizontal panels. There is a paired window in the gable with a 6/1 wood double-hung sash. There is a flat roof carport to the far left supported by metal columns.

145 C 420 Ford Street c 1925 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a painted brick pier foundation with painted brick and concrete block infill. Projecting front facing gable porch supported by wood box columns on brick piers. Wood paneling in the gable and the porch deck is wood with concrete steps. Façade is three-bay (W, D, W) with horizontal wood lap siding with corner boards. The windows are 12/1 wood double-hung sash and the entry door is wood with nine upper lights over three horizontal panels and a three light transom. The eaves are boxed. There is an interior brick chimney visible.

146. NC 422 Ford Street c. 1960 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Brick and concrete porch stoop with decorative metal rail. The façade is five-bays (W, D, W-paired, W, Carport). The left window is a four light metal frame awning window and the others are three light metal frame awning windows. All are on brick sills. The carport is under the main roof and supported by decorative metal posts.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 48 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

147. NC 425 Ford Street c. 1970 Ranch

One-story, brick veneer Ranch with a hipped roof of asphalt shingles on a brick foundation. Projecting front facing gable porch supported by paired wood Tuscan columns on a concrete porch deck with brick steps. The gable is sided in vinyl. Façade is six-bays (W, W, D, W, W, W). Windows are 8/8 wood double-hung sash with panels below and applied louvered shutters. The entry door is wood with three upper lights over four recessed panels. The eaves are boxed.

148. NC 426 Ford Street c. 1960 Ranch

One-story, wood frame Ranch with a hip roof of asphalt shingles on a brick foundation. Concrete porch stoop with brick steps and a brick planter next to the stoop. The façade is three-bays (W-paired, D, W-paired) with a brick veneer wainscot and wood panels above. The windows are 1/1 metal frame single-hung sash and the entry door is a wood slab. A hip roof carport projects from the house and is supported by brick piers. The eaves are boxed.

149a. C 427 Ford Street c. 1930 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with double front facing gable roof of asphalt shingles on a brick foundation. Undercut and partially projecting entry porch under the lower gable and supported by wood box columns with capitals on a wood porch deck with concrete steps. The façade is four-bays (W, D, W, W-paired) with thin strip horizontal wood lap siding with corner boards. The windows are 2/2 metal frame single-hung sash horizontally divided with the paired window having applied louvered shutters. The entry door is a wood slab door with a single square light. There are wide overhanging eaves supported by knee braces. An interior brick chimney is visible.

149b. C Garage c 1950

One-story, wood frame garage with a front facing gable roof of metal panels on a concrete foundation. The garage is sided in corrugated panels and there is an off-center opening on the front for a car.

150. C 429 Ford Street c 1930 Craftsman Bungalow

One-story, brick veneer Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. Partial width projecting front facing gable roof entry porch is screened and supported by brick piers on low brick walls with cast stone caps. There is a wood porch deck with concrete steps and small low brick wing walls with cast stone caps. The gable is sided in stucco. The façade is four-bays (W-tripled, W, D, W). The windows are 4/1 wood double-hung sash in a vertical Craftsman pattern. The entry door is Craftsman in style with four vertical lights over three horizontal recessed panels. The wide projecting eaves have exposed rafter tips. A brick interior chimney is visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 49 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

151. C 431 Ford Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of composite shingles on a brick foundation. The façade is three-bays (W, D, W) with vinyl siding. Windows are 3/1 wood double-hung sash with applied louvered shutters and the entry door is metal clad wood with six projecting panels and an outer wood storm door. One interior brick chimney is visible. The eaves are boxed.

152. C 433 Ford Street c 1930 Craftsman Bungalow
Two-story, wood frame Craftsman Bungalow with a hip roof of diamond pattern asbestos shingles with a tile ridge cap on a brick foundation. Front projecting partial width entry porch with a flat roof supported by wood box columns on a concrete porch deck with concrete steps. There is a rectangular balustrade on the porch roof with the center of each bay having a cross pattern. The façade on both floors is (W-tripled, D, W-tripled) with horizontal wood lap siding with corner boards. The windows are 6/1 wood double-hung sash. The entry door on the first floor is slightly recessed with a blind arched panel above and is wood with six upper lights over two vertical recessed panels. The door on the second floor has six lights over three horizontal recessed panels. Two-story addition to the rear right with matching tripled windows of 6/1 wood double-hung sash. One exterior brick chimney is visible. The projecting eaves have exposed rafter tips. [Photo #11]

Garden Street

153. C 906 Garden Street c 1940
Two-story, former garage, which is faced in stucco and has been converted into a residence, with a side facing gable roof of asphalt shingles on a concrete foundation. The façade on the first story is three-bays (W, D, D) and the former garage door openings have been infilled with vinyl siding. The window is a 6/6 metal frame single-hung sash. The door on the left is a modern metal clad wood door with six projecting panels. The door on the right is wood with nine lights over two vertical recessed panels with an outer metal storm door and a pent metal awning. The second story façade is one-bay (W-tripled). The windows are 6/6 wood double-hung sash with a pent metal awning. The eaves are boxed.

154. C 909 Garden Street c 1925 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of asphalt shingles on a brick pier foundation with concrete block infill. Undercut full width front porch supported by wood posts on a wood porch deck with concrete steps. The façade is three-bays (W, D, W) with horizontal wood Dutch lap siding. The windows are 1/1 wood double-hung sash. The entry door is a modern metal clad wood door with six projecting panels. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 50 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

155. NC 912 Garden Street c 1950
One-story, brick veneer residence with a hip roof of asphalt shingles on a brick foundation. The façade is four-bays (D, W, W, W). The windows are 8/8 wood double-hung sash with applied louvered shutters. The entry door is wood with six recessed panels and a wood screen door with the lower half of wood louvers. There is a concrete entry stoop. A large brick wall is located in front of the house with an iron gate. There is a front hip roof addition that is part of the wall with horizontal wood lap siding with corner boards above the brick wall. The eaves are boxed.

156. C 913 Garden Street c 1925 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of asphalt shingles on a brick pier foundation with glass block and concrete block infill. Undercut full width front porch supported by wood box columns, with capitals, on a wood porch deck with concrete steps. The façade is three-bays (W, D, W) with horizontal wood Dutch lap siding. The windows are 1/1 wood double-hung sash. The entry door is wood with three vertical lights over three recessed horizontal wood panels. There is a rectangular wood louvered vent in the gable. The eaves are boxed. [Photo #12]

157. C 917 Garden Street c 1925 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of asphalt shingles on a brick pier foundation with partial brick infill. Undercut full width front porch supported by wood box columns on a wood porch deck with concrete steps. The façade is three-bays (W, D, W) with horizontal wood Dutch lap siding. The windows are 1/1 wood double-hung sash. The entry door is wood with single light over three recessed horizontal wood panels. The eaves are boxed. A shed roof carport is attached to the right side of the house and is supported by a wall. Behind the carport is an attached addition with a façade of three-bays (W, D, W). The window on the left is 3/1 wood double-hung sash and the one on the right is a 6/6 metal frame single-hung sash. The door is wood with three vertical lights over three horizontal panels.

158. C 921 Garden Street c. 1925 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of asphalt shingles on a brick pier foundation with brick infill. Undercut full width screened front porch supported by wood box columns, with capitals, on a wood porch deck with concrete steps. The façade is four-bays (W, D, D, W) with horizontal wood Dutch lap siding. The windows are 3/1 wood double-hung sash. The left door is wood with four vertical lights over three recessed horizontal wood panels. The right door is a modern metal clad wood door with six projecting panels. There is a rectangular wood louvered vent in the gable. The eaves are boxed. A shed roof carport is attached to the left side of the house and is supported by decorative metal posts.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 51 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

159. C 921 ½ Garden Street c. 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick foundation. Projecting gabled entry porch roof is supported by knee braces. The façade is four-bays (W-tripled, W-paired, W, D) with horizontal wood lap siding with corner boards. The windows are 3/1 wood double-hung sash. The entry door is wood with three vertical lights over three horizontal recessed panels and has an outer wood screen door. There is a rectangular wood louvered vent in the gable. The projecting eaves have exposed rafter tips.

Gill Street

160. NC 900 Gill Street c 1990
Victory Tabernacle Baptist Church
One-story, brick veneer Church with a side facing gable roof of composition shingles on a brick foundation. Front facing gable roof partial width projecting entry portico/porte-cochere supported by paired wood box columns with a segmental arched opening in the gable. There is a spire on top of the entry porch/porte-cochere. The façade is twelve-bays (Carport, W, W, W, W, W, D, W, W, W, W, D). The windows are all 6/6 metal frame single-hung sash. The main entry door under the entry porch is a double-leaf wood door with an arched leaded light over four recessed panels with leaded glass sidelights and a segmental arched transom. The other door is a metal clad wood door with nine lights over two vertical projecting panels. The carport is on the far left end of the building and separate from the entry portico/porte-cochere is supported by wood box columns. The eaves are boxed.

161. C 905 Gill Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a brick foundation. Full width projecting entry porch with a shed roof is supported by decorative metal posts on a concrete deck with concrete steps. The façade is five-bays (W, W, D, D, W) with thin strip horizontal wood lap siding and corner boards. The window on the far left is 3/1 wood double-hung sash with the other windows 1/1 wood double-hung sash units. The entry doors are both metal clad wood with six projecting panels and outer wood screen doors. Exposed rafter tips are visible. There is a brick veneer addition with a side facing gable metal panel roof to the right of the house with three-bays (W, D, W). The windows are 6/6 metal frame single-hung sash and the door is metal clad wood with six projecting panels with an outer metal and glass storm door.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 52 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

162. C 909 Gill Street c 1930
One-story, wood frame duplex with a side facing gable roof of asphalt shingles on a brick foundation. Full width undercut entry porch supported by decorative metal posts on a concrete porch deck. The façade is five-bays (W-paired, D, W-tripled, D, W-paired) and has a brick wainscot with angled sills and horizontal Masonite siding above. The windows are 3/1 wood double-hung sash and the tripled window unit has a picture window in between the 3/1 windows. The entry doors are both wood with six recessed panels. There is a shed roof carport attached to the right side of the house supported by metal poles.

163. C 913 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a cross-gable roof of asphalt shingles on a brick foundation. Concrete entry stoop with concrete steps and metal rail. The façade is three-bays (W-paired, D, W-tripled) with horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash with the tripled window having a picture window in the center of the 3/1 windows. The entry door is metal clad wood with nine lights over two vertical projecting panels. There is a triangular louvered vent in the gable. Exposed rafter tips are visible.

164. NC 914 Gill Street c 1975
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation. The façade is six-bays (W, W, D, W-paired, W, W). The windows are 6/6 metal frame single-hung sash with angled brick sills. The entry door is wood with six recessed panels and an outer metal and glass storm door. The eaves are boxed.

165. C 915 Gill Street c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick foundation with brick vents. Partial width front facing gable roof projecting entry porch supported by wood posts on half height brick piers with cast stone caps. There is a concrete porch deck with concrete steps. The façade is three-bays (W-paired, D, W) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the entry door is wood with six upper lights over a single recessed panel. There is a triangular louvered vent in the gable. Exposed rafter tips are visible.

166. C 917 Gill Street c 1955 Minimal Traditional
One-story, wood frame L-shaped Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation. Partial width undercut entry porch with a concrete deck and concrete steps with metal railings. The façade is three-bays (W-paired, D, W-paired) with horizontal Masonite siding. The windows are 2/2 wood double-hung sash horizontally divided with applied louvered shutters. The entry door is wood with eight projecting panels. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 53 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

167. C 1001 Gill Street 1900 Queen Anne
One-story, wood frame Queen Anne with a gable-on-hip roof of asphalt shingles on brick pier foundation with brick infill. Shed roof projecting wrap around entry porch supported by fluted columns on a concrete deck with cast iron decorative railing. The façade is four-bays (W, W, W, Porch) with horizontal wood lap siding and corner boards and brick wainscoting under the entry porch. Windows are 1/1 wood double-hung sash. The side porch to the right has been enclosed with wood siding and five - four light awning windows. The entry door faces the side and is wood with two lights over two projecting panels. The front facing gable has a pent roof and an arched wood louvered vent. The eaves are boxed.

168. C 1004 Gill Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of asphalt shingles on a brick pier foundation. Full width undercut entry porch supported by decorative metal posts on a concrete porch deck. The façade is five-bays (W-paired, D, D, W-paired, W) with horizontal Masonite siding. The windows are 3/1 wood double-hung sash and the doors are metal clad wood with six projecting panels and outer metal and glass storm doors. There is a triangular louvered vent in the gable. Exposed rafter tips are visible.

169. C 1005 Gill Street c 1945
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick pier foundation with lattice panels over the piers. There is a front facing gable roof cantilevered projection supported by knee braces over a wood porch deck with concrete steps and metal railings. The façade is five-bays (W, W-paired, W, D, W-paired) with horizontal wood Dutch lap siding and corner boards. The windows are 6/6 wood double-hung sash. The entry door is a wood slab with a metal screen door. The side facing gable roof carport is attached to the left of the house and is supported by wood posts. Exposed rafter tips are visible.

170. C 1010 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete deck with a concrete step. The façade is five-bays (W-paired, D, W, W, W) with vinyl siding. The windows are 3/1 wood double-hung sash except for the two far right ones of which one is a 6/6 metal frame single-hung sash and the other is an opening waiting to be filled with a window. The entry door is wood with three lights over three horizontal recessed panels. There is a triangular louvered vent in the upper gable and a rectangular vent covered with vinyl siding in the porch gable. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 54 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

171. C 1011 Gill Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation. Full width undercut entry porch is supported by wood box columns on a wood porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash and the entry door is a modern wood door with an oval leaded light. There is a rectangular wood louvered vent in the gable. Exposed rafter tips are visible along with knee braces. A shed roof carport is attached to the rear left of the house and is supported by metal poles.

172. NC 1012 Gill Street c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of composition shingles on a brick foundation. There is a slight roof projection over the entry and carport. The façade is four-bays (W-paired, D, W-paired, Carport). The windows are single light smoked glass with applied louvered shutters and the entry door is not visible behind the smoked glass storm door. The carport is supported by decorative metal posts. The eaves are boxed.

173. NC 1015 Gill Street c 1980
One-story, brick veneer residence with a hip roof of asphalt shingles on a brick foundation. There is a brick entry stoop with brick steps coming down from each side and a decorative metal railing. The façade is four-bays (W, W-paired, D, W). The windows are 8/8 metal frame single-hung sash with the paired windows having two 6/6 metal frame single-hung sash windows. All of the windows have applied paneled shutters. The entry door is wood with and oval leaded glass light and has a pilastered surround with a flat cornice. The eaves are boxed.

174a. NC 1018 Gill Street c 1940
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick foundation. There is a partial width flat roof projecting entry porch supported by wood posts on a wood porch deck with wood steps. The porch roof is metal panels. The façade is three-bays (W, D, W) with brick veneer wainscoting, with an angled sill, and horizontal wood lap siding and corner boards above. The window are 8/8 metal frame single-hung sash with applied louvered shutters and the entry door is wood with a leaded glass oval light over two projecting panels. Exposed rafter tips are visible. This house has been heavily modified with the addition of the porch, replacement of the windows and door along with the changes in the siding and brick veneer wainscoting.

174b. NC Garage c 1980
One-story, wood frame garage with a side facing gable roof of asphalt shingles on a concrete foundation. The single two-car garage cased opening faces the side. The garage is sided in horizontal wood lap siding and corner boards.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 55 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

175. NC 1019 Gill Street c 1970 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is a slight roof projection over the entry stoop, with metal rail, and the carport. The façade is four-bays (W-paired, D, W-tripled, Carport). The paired window unit is made up of 2/2 metal frame single-hung sash horizontally divided windows and the tripled window has a central picture window flanked by 2/2 metal frame single-hung sash horizontally divided windows. The entry door is wood with three diagonal upper lights and an outer metal and glass storm door. The carport is supported by decorative metal posts. There is a low brick planter under the tripled window. The eaves are boxed.

176. C 1020 Gill Street c 1945 Craftsman Bungalow

One-story, brick veneer Craftsman Bungalow with a side facing clipped gable roof of asphalt shingles on a brick foundation. There is a small partial width front facing gable roof projecting entry porch supported by brick columns with a segmental arched opening between. There is a brick stoop and steps. The façade is six-bays (W, W-paired, W, D, W, W-paired). The windows are all 3/1 wood double-hung sash except for the far left one which is a twenty light steel casement unit which is possibly filling the hole of what used to be an open porch. The entry door is a wood slab with a metal screen door. The eaves are boxed.

177. C 1021 Gill Street c 1940 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation. Partial width, front facing gable roof projecting entry porch supported by wood box columns on a wood porch deck with concrete steps. The porch has been partially enclosed with wood paneling and lattice. A pent metal awning surrounds the porch. A triangular louvered vent is located in the gable of the porch. The façade is two-bays (D, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the door is not visible enough to tell its configuration. Exposed rafter tips are visible.

178. NC 1022 Gill Street c 1940

One-story, wood frame altered Craftsman Bungalow with front facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch supported by decorative metal posts on half height brick piers with cast stone caps. There is a wood porch deck with concrete steps. The façade is two-bays (W-paired, W-paired) with a combination of brick veneer siding and horizontal Masonite siding. The windows are 1/1 metal frame single-hung sash. The entry door faces the side and is wood with fifteen lights. There is a triangular louvered vent in the gable. The original character of the Craftsman Bungalow house has been altered with the replacement windows and change in the siding of the house.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 56 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

179. C 1023 Gill Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of asphalt shingles on a brick pier foundation with brick infill. Full width undercut entry porch supported by decorative metal posts on a concrete porch deck and steps. The façade is three-bays (W, D, W) with thin strip horizontal wood Dutch lap siding and corner boards. The windows are 4/1 wood double-hung sash and the entry door is a wood slab with an upper square light. There is a rectangular wood louvered vent in the gable. Exposed rafter tips are visible.

180. C 1024 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation. A partial width front facing gable roof projecting screened entry porch is supported by wood posts on a wood porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the entry door is wood with three vertical lights over three horizontal recessed panels with an outer metal and glass storm door. There is a triangular louvered vent in the gable. Exposed rafter tips are visible.

181a. NC 1025 Gill Street c 1980
One-story, brick veneer residence with a side facing gable roof of composition shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete deck with concrete steps and metal railings. The façade is four-bays (W, W-paired, D, W). The windows are 6/6 metal frame single-hung sash with angled brick sills. The entry door is wood with six recessed panels. The eaves are boxed. There is a shed roof carport to the right and rear supported by metal poles.

181b. NC Outbuilding c 1990
One-story, wood frame outbuilding with a side facing gable roof of asphalt shingles. The façade is two-bays (D, W) with panel siding. The window is 2/2 metal frame single-hung sash and the door is wood with six lights over three recessed wood panels.

182. C 1026 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a concrete block foundation. There is a concrete entry stoop with concrete steps. The façade is three-bays (W-paired, D, W-paired) with horizontal wood Dutch lap siding and corner boards. The windows are 3/1 wood double-hung sash with applied paneled shutters. The entry door is wood with two vertical lights over two vertical panels with an outer metal and glass storm door. Exposed rafter tips are visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 57 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

183. NC 1100 Gill Street c 1960
One-story, brick veneer residence with a cross-gable roof of asphalt shingles on a brick foundation with metal vents. There is no entry porch and only concrete steps to the door. The façade is four-bays (W-paired, D, W-paired, W). The windows are 2/2 metal frame single-hung sash horizontally divided with applied louvered shutters. The entry door is wood with a single light over a single panel with an outer metal and glass storm door. There is a triangular louvered vent in the front facing gable projection. The eaves are boxed.

184. NC 1101 Gill Street c 1965
One-story, brick veneer residence with a side facing gable roof of asphalt shingles on a brick foundation with vents. There is a partial width front facing gable roof projecting entry porch supported by wood box columns on a brick deck with brick steps and a metal rail. The façade is four-bays (W, W, D, W). The window on the far left is 8/8 metal frame single-hung sash with a wood panel below to make the opening the same size as the other window openings. The other windows are 16/8 metal frame single-hung sash. All of the windows have applied louvered shutters. The entry door is wood with six recessed panels and an outer metal and glass storm door. The eaves are boxed.

185. C 1102 Gill Street c 1945 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by fluted columns on a tiled stoop with tiled steps. The façade is five-bays (W-paired, W-paired, D, W-paired, Carport) with brick wainscoting with and angled sill and asbestos shingle siding above. The windows are 6/6 wood double-hung sash with applied louvered shutters. The entry door is wood with six recessed panels and an outer metal and glass storm door. The carport is supported by wood posts with brackets. The eaves are boxed.

186. NC 1103 Gill Street c 1940
One-story, wood frame altered Craftsman Bungalow with a side facing gable roof of asphalt shingles on a concrete block foundation with metal vents. Partial width front facing gable roof projecting entry porch is supported by wood box columns with a turned balustrade between them on a wood porch deck with concrete steps to the side. The façade is five-bays (W, W, D, W-tripled, W) with horizontal wood Dutch lap siding and corner boards. The windows are all 9/6 metal frame single-hung sash except for the one on the far right which is a 6/6 metal frame single-hung sash window. All of the windows have applied paneled shutters. The entry door is wood with six recessed panels and an outer metal and glass storm door. There is a shed roof carport attached to the right side of the house supported by wood box columns. There is a rectangular wood louvered vent in the gable of the porch. Exposed rafter tips are visible. The replacement of the windows and addition of the shutters has marred the historic integrity of the Craftsman style.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 58 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

187a. C 1104 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation. A partial width front facing gable roof projecting screened entry porch is supported by decorative metal posts on a wood porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the entry door is wood with three stepped vertical upper lights with an outer metal and glass storm door. There is a triangular louvered vent in both gables. Exposed rafter tips are visible. There is a carport to the rear right supported by wood posts with a corrugated fiberglass roof.

187b. C Garage c 1945
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. There is a chamfered cased opening for one car and the garage is sided in horizontal wood Dutch lap siding and corner boards.

188. C 1105 Gill Street c 1950 Minimal Traditional
One-story, brick veneer Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation with vents. There is a broken slope to the main roof over the undercut entry porch supported by wood box columns. The columns rest on a concrete deck with concrete steps flanked by brick wing walls with cast stone caps. The façade is three-bays (W, D, W-tripled). The windows are 6/6 wood double-hung sash and the tripled window has a central picture window flanked by 6/6 wood double-hung sash windows. There is a pent metal awning over the single window. The entry door is a modern wood door with a leaded glass light over two projecting panels. The eaves are boxed.

189a. C 1106 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a brick pier foundation with lattice infill. A partial width front facing gable roof projecting entry porch is supported by wood posts on a wood porch deck with concrete steps. The façade is two-bays (D, W) with asbestos shingle siding. The window is a 3/1 wood double-hung sash and the entry door is metal clad wood with six projecting panels.

189b. C Garage c 1950
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. The one-car opening is cased and chamfered. The garage is sided in asbestos shingles.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 59 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

190. C 1107 Gill Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Front facing gable roof projecting entry porch is supported by wood Tuscan columns on a concrete deck with concrete steps. The façade is four-bays (Porch, W-tripled, D, W) with asbestos shingle siding. The tripled window is made up of two outer 4/4 wood double-hung sash windows with a center 10/10 wood double-hung sash window. Above the tripled window and the entry porch is a gable with a triangular louvered vent. The other window is an 8/8 wood double-hung sash. The entry door is wood with an oval leaded light. The porch on the left end of the house is supported by wood Tuscan columns and has a pent metal awning wrapping around the porch. The eaves are boxed.

191a. C 1108 Gill Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete deck with concrete steps. The façade is four-bays (W-paired, W-paired, D, W) with asbestos shingle siding. The windows are 6/6 wood double-hung sash with applied louvered shutters and security bars over the lower sashes. The entry door is wood with six recessed panels and an outer metal and glass storm door. There is a triangular louvered vent in the gable of the entry porch. The eaves are boxed.

191b. C Garage c 1950
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. The one-car cased chamfered opening has been filled with wood siding and a wood slab pedestrian door. The garage is sided in horizontal wood Dutch lap siding and corner boards.

192. NC 1117 Gill Street c 1960
One-story, wood frame residence with a front facing gable roof of asphalt shingles on a brick foundation. A partial width front facing gable roof projecting entry porch is supported by paired wood box columns on a concrete porch deck with brick steps to the side and a square balustrade between the columns. There is a triangular louvered vent in the gable of the porch. The façade is three-bays (W-paired, D, W-paired) with vinyl siding. The windows are 6/6 metal frame single-hung sash and the entry door is wood with four arched lights over four recessed panels and an outer metal and glass storm door. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7

Page: 60

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

193a. C 1121 Gill Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Full width undercut entry porch is supported by wood box columns on half height brick piers with cast stone caps. There is a wood porch deck with brick steps. The façade is five-bays (W, D, W, W, W-paired) with horizontal wood Dutch lap siding and corner boards. The window are 3/1 wood double-hung sash and the ones under the porch have applied louvered shutters. The entry door is a metal clad wood door with an arched leaded light over four projecting lower panels and has a pilaster door surround with an architrave. There is a wing to the right side of the house which has the two right windows not under the porch. There is also a wood deck with wood rails attached to the wing. There are two leaded glass lights in the gable of the entry porch. Exposed rafter tips are visible.

193b. C Garage c 1950
One-story, wood frame garage with a side facing gable roof of asphalt shingles on a concrete foundation. The garage is sided in wood planks. There are two openings, one with a two-car metal garage door of thirty-two panels and the other a single car wood paneled door.

194. NC 1200 Gill Street c 1965 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Partial width undercut entry porch is supported by metal fluted columns on a concrete deck with a brick step. The façade is six-bays (W-paired, W-paired, D, W, W, W-paired). All of the paired windows are 6/6 metal frame single-hung sash and the non-paired windows are 9/6 metal frame single-hung sash windows. All of the windows have angled brick sills and applied louvered shutters. The entry door is wood with eight recessed decorative panels. The eaves are boxed. [Photo #15]

195. C 1204 Gill Street c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of asphalt shingles on a brick pier foundation. Full width undercut entry porch is supported by wood box columns with capitals on half height brick piers with cast stone caps. The porch deck is wood with concrete steps. The façade is four-bays (W, D, D, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash. The door on the left is wood with three vertical lights over a single recessed panel in the Craftsman style and the door on the right is a metal clad wood door with a five division fan light over four projecting panels. There is a triangular louvered vent in the gable. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 61 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

196. C 1205 Gill Street c 1945 Craftsman Bungalow
One-story, rusticated concrete block Craftsman Bungalow with a double gable roof of asphalt shingles on a concrete block foundation. There is a small partial width front facing gable roof projecting entry porch supported by concrete blocks on a concrete deck. The facade is two-bays (W-paired, W). The windows are 1/1 wood double-hung sash. The entry door faces the side and is wood with six recessed panels. The gables have vinyl siding. The eaves are boxed. There is a carport attached to the rear left of the house supported by wood posts.

197 NC 1206 Gill Street c 1960
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Cantilevered partial width front facing gable roof projecting entry porch is supported by knee braces over a concrete stoop and steps. The facade is three-bays (W, D, W) with vinyl siding. The windows are 6/6 metal frame single-hung sash and the entry door is metal clad wood with an oval leaded light over two projecting panels. There is a side facing gable roof carport attached to the right side of the house supported by wood posts. The eaves are boxed.

198. NC 1207 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame altered Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. Cantilevered partial width front facing gable roof projecting entry porch is supported by knee braces over a concrete stoop and steps. Façade is five-bays (W, D, W, W, W) with a combination of Hardiboard siding and board-and-batten siding. The two left windows flanking the entry door are 8/8 metal frame single-hung sash with applied lattice shutters and the other two windows are 4/4 metal frame single-hung sash windows. The entry door is wood with twelve diagonal lights over four projecting panels. There is an internal brick chimney visible. A metal roof carport is attached to the front of the house and supported by metal poles. Exposed rafter tips are visible. With the changes to the windows, door, siding, and addition of the carport to the front of the house the house has lost its historic Craftsman character.

199. C 1208 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with lattice infill. Shed roof projecting entry porch is supported by turned columns on a wood porch deck with wood steps. The facade is seven-bays (W, W, D, W-paired, W-paired, W, W) with horizontal wood Dutch lap siding and corner boards. The windows are 3/1 wood double-hung sash. The entry door is wood with a single light over a row of three recessed panels over two horizontal recessed panels with an outer metal screen door. Exposed rafter tips are visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 62

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

200. NC 1209 Gill Street c 1955 Minimal Traditional
One-story, wood frame altered Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation with vents. There is a concrete entry stoop and steps with a pent metal awning above the entry door. The façade is three-bays (W, D, W) and is sided in vinyl. The windows are 6/1 metal frame single-hung sash with applied louvered shutters. The entry door is wood with two upper lights over four recessed panels. There is a side facing gable roof carport attached to the left side of the house supported by metal poles. With the changes to the windows and siding the house has lost its original historic character.

201a. C 1211 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Flat roof partial width projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps and square wood balustrade between the columns. The façade is three-bays (W, D, W-paired) with horizontal wood lap siding and corner boards. The single window is a wood frame picture window and the paired window is made up of 3/1 wood double-hung sash windows. The entry door is metal clad wood with nine lights over two vertical projecting panels and an outer metal and glass storm door. Exposed rafter tips are visible.

201b. C Garage c 1950
One-story, wood frame garage with a front facing gable roof of metal panels. Two openings are separated by a wood post. The garage is sided in horizontal wood Dutch lap siding and corner boards

202. C 1213 Gill Street c 1940
One-story, wood frame residence with a side facing gable roof of asbestos shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. There is a triangular louvered vent in the gable of the porch. The façade is three-bays (W-tripled, D, W-tripled) with asbestos shingle siding. The windows are 1/4 metal frame single-hung sash with a four light picture window between. The entry door is wood with six lights over two recessed panels. There is a carport attached to the rear left side of the house supported by metal poles. The eaves are boxed.

203. C 1219 Gill Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a double front facing clipped gable roof of asphalt shingles on a brick foundation with brick infill. The entry porch has been filled with windows and a door. The façade is three-bays (W, D, W-paired) with horizontal wood Dutch lap siding and corner boards. The two windows on the left are jalousie windows and on the right are 3/1 wood double-hung sash windows. The door is also jalousie. There is a rectangular wood louvered vent in each gable. Exposed rafter tips are visible. A shed roof carport is attached to the rear right side of the house and is supported by decorative metal posts.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 63

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Greymont Drive

204. NC 800 Greymont Drive c 1965 Ranch

One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation with metal vents. Hip roof projection contains the undercut entry porch supported by a decorative metal post on a concrete stoop. The façade is five-bays (Carport, W-tripled, D, W, W). The windows are 2/2 metal frame single-hung sash horizontally divided with applied louvered shutters. The tripled window has a central picture window flanked by 2/2 metal frame single-hung sash windows with a vinyl sided panel below and applied louvered shutters. The entry door is a wood slab door with three stepped lights. The eaves are boxed.

205. NC 802 Greymont Drive c 1965 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. There is no entry porch; however, there is a concrete entry stoop. The façade is five-bays (W, W, D, W, Carport). The window to the right of the door is a metal frame single-hung sash picture window. The other windows are two-part metal frame single-hung sash sliding windows with applied louvered shutters. The entry door is metal clad wood with six projecting panels with an outer metal and glass storm door. The carport is supported by metal posts. The eaves are boxed.

206. NC 803 Greymont Drive c 1965 Ranch

One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation with metal vents. Partial width hip roof projecting entry porch is supported by brick columns on a concrete deck. The façade is five-bays (Carport, W-paired, D, W, W). The window to the left of the door is a metal frame picture window and the other windows are two-part metal frame single-hung sash sliding windows. The entry door is wood with six recessed panels. The carport is supported by brick columns. The eaves are boxed.

207. NC 804 Greymont Drive c 1970 Contemporary

One-story, wood frame Contemporary with a front facing gable roof of asphalt shingles on a brick foundation. There is an entry stoop but no entry porch. The façade is five-bays (W, W, W, D, Carport) with a combination of brick veneer and horizontal wood lap siding with no corner boards. The windows are single light wood frame windows. The entry door is a wood slab. Over the windows and the door are additional single light wood windows with angled tops to match the slope of the roof. The carport is supported by wood posts and brick veneer siding. There are wide overhanging eaves with the ends of the roof beams visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 64 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

208. NC 805 Greymont Drive c 1970 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch which becomes a carport is supported by fluted metal columns. The façade is four-bays (W, D, W, Carport). The windows are 6/6 metal frame single-hung sash and the tripled window has a central picture window flanked by 6/6 metal frame single-hung sash. The entry door is wood with six recessed panels flanked by five light sidelights. There is an internal brick chimney visible. The eaves are boxed.

209. NC 806 Greymont Drive c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation with metal vents. Hip roof projection contains the undercut entry porch supported by a decorative metal post on a concrete stoop. The façade is six-bays (W-paired, W, W, D, W-paired, Carport). The windows are four light metal frame awning windows. The entry door is wood with six recessed panels. The carport is supported by decorative metal posts. The eaves are boxed.

210. NC 807 Greymont Drive c 1970 Ranch
One-story, brick veneer Ranch with a cross gable roof of metal panels on a brick foundation. Partial width undercut entry porch which extends in front of the garage doors is supported by metal columns. The façade is five-bays (Garage Door, Garage Door, W, W, W). The windows are 2/2 metal frame single-hung sash horizontally divided with applied paneled shutters. The garage doors are metal with sixteen projecting panels. The entry door faces the side and is a wood slab door. There is vinyl siding in the gable. The eaves are boxed.

211. NC 808 Greymont Drive c 1965 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch which becomes a carport is supported by metal poles with decorative metal brackets. There is a concrete entry stoop with concrete steps and a low brick planter wall that runs from the entry to the carport. The façade is six-bays (Carport, W, W-tripled, D, W, W). The windows are 1/1 metal frame single-hung sash and the tripled window has a picture window flanked by 1/1 metal frame single-hung sash windows. The entry door is a wood slab with three upper stepped horizontal lights with an outer metal and glass storm door. The carport faces the side and is supported by metal poles with decorative brackets on a brick wall. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 65 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

212. NC 809 Greymont Drive c 1965
One-story, brick veneer residence with a hip roof of asphalt shingles on a brick foundation. There is no entry porch just concrete steps to the door flanked by brick wing walls that are planters. The façade is three-bays (W, D, Carport). The window is a metal frame picture window with applied louvered shutters. The entry is wood with six recessed panels. The carport is supported by metal poles and there is a low brick planter to the side of the carport poles. The eaves are boxed.

213. NC 811 Greymont Drive c 1965 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch with no supports over a concrete deck. The façade is four-bays (W, D, W-paired, W-paired). The windows are 2/2 metal frame single-hung sash horizontally divided except for the one to the left of the door which is a three-part sliding metal frame window with a central picture window. The entry door is metal clad wood with six projecting panels. Underneath the porch the siding is horizontal wood lap siding. It appears as if the original garage or carport has been enclosed with brick and a large exterior chimney on the front. The eaves are boxed.

214. NC 812 Greymont Drive c 1975 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch which becomes a carport and is supported by a fluted metal column. The carport faces the side and has a decorative concrete screen. The façade is five-bays (W, W, D, W-tripled, Carport). The windows are two-part metal frame sliding windows and the window to the right of the door is a three-part sliding window with a central picture window. The entry door is a wood slab with a diagonal upper light and an outer metal and glass storm door. The eaves are boxed.

215a. NC 813 Greymont Drive c 1975 Contemporary
One-story, wood frame Contemporary house with a front facing gable roof of metal panels on a brick foundation with metal vents. There is a slight projection of the roof for the entry porch which becomes the carpet. There is a concrete entry stoop with brick steps. The façade is three-bays (Carport, W-paired, D) with a combination of brick veneer siding and horizontal wood lap siding with no corner boards. The windows are 4/4 metal frame single-hung sash with applied shutters with diamond shaped cutouts. The entry door is metal clad wood with an oval leaded light. The carport is supported by metal poles.

215b. NC Outbuilding c 1980
One-story, wood frame outbuilding with a front facing gable roof of metal panels on a concrete foundation. The façade is two-bays (D, W) with horizontal Masonite siding. The window is a three-part metal frame awning window. The door is a wood panel. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 66

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

216. NC 815 Greymont Drive c 1965 Ranch

One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation. There is a shed roof screened entry porch supported by wood posts on a wood porch deck. The façade is four-bays (Carport, W, D, W-tripled). The single window is a 6/6 metal frame single-hung sash with applied louvered shutters and the tripled windows is a central picture window flanked by three-light awning windows. The entry door is a wood with six recessed panels and outer metal and glass storm door. The carport is supported by metal poles. The eaves are boxed.

217. NC 817 Greymont Drive c 1965 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch which becomes a carport and is supported by vinyl sided columns. There are brick steps to the entry door. The façade is five-bays (W, W, D, W-paired, Carport). The windows are three light metal frame awning windows. The entry door is a wood slab with an outer metal and glass storm door. The eaves are boxed.

218. NC 818 Greymont Drive c 1965 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch which becomes a carport. There is a concrete entry stoop with a decorative metal post. The façade is six-bays (Carport, W, W, W, D, W). The windows are two-part metal frame sliding windows and the window to the left of the door is a three-part sliding window with a central picture window. The entry door is a wood slab with three upper horizontal step lights and an outer metal and glass storm door. The carport is supported by metal posts. The eaves are boxed.

Hawkins Street

219a. NC 308 Hawkins Street c 1960

One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick foundation. Slight projecting front facing gable roof entry porch supported by knee braces over a wood porch deck with square balustrade. The façade is five-bays (W-paired, W-paired, D, W-paired, Porch) with horizontal wood lap siding and corner boards. The windows are 9/6 metal frame single-hung sash. The entry door is metal clad wood with and leaded glass oval light over two projecting panels. The porch is screened and has a low wall in place of a balustrade. The eaves are boxed.

219b. NC Carport c 1970

There is a freestanding carport to the right of the house with a flat roof and supported by decorative metal posts.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 67 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

220. C 310 Hawkins Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with lattice over the piers. The undercut full width screened entry porch is supported by wood box columns on a wood porch deck. The façade is four-bays (W, D, D, W) with thin strip horizontal wood Dutch lap siding and corner boards. The windows are 3/1 wood double-hung sash. The door on the right is wood with a single light over one horizontal recessed panel and two vertical recessed panels. The door on the left is wood French door with a single light. There is a 3/1 wood double-hung sash window in the gable. Exposed rafter tips are visible.

221a. NC 311 Hawkins Street c 1940 Craftsman Bungalow
One-and-a-half story, wood frame, heavily modified Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with brick and concrete block infill. There is no entry porch and only a small wood porch deck which sits on top of concrete steps with brick wing walls with cast stone caps. Most likely the original porch has been enclosed. The façade is three-bays (W-tripled, D, W-tripled) with asbestos shingle siding. The windows are 2/2 metal frame single-hung sash horizontally divided and the entry door is metal clad wood with an upper four light fanlight over four projecting panels. There is a front facing gable roof dormer with two fixed windows with three lights each. On interior brick chimney is visible. The projecting eaves are supported by knee braces. The change in the siding, porch, doors, and windows has marred the historic Craftsman character of the house.

221b. C Garage c 1945
One-story, wood frame two-car garage with a front facing gable roof of asphalt shingles. There is one large cased opening with chamfered corners and the siding is board-and-batten.

222. C 312 Hawkins Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a foundation that is covered with panels. Full width undercut entry porch supported by wood box columns on wood porch deck with concrete steps. The façade is three-bays (W, D, W) with vinyl siding. Windows are 4/4 wood double-hung sash with applied louvered shutters. The entry door is wood with two recessed panels and an outer metal storm door. The eaves are boxed. There is a shed roof carport attached to the left of the house supported by wood posts with lattice between.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 68 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

223a. C 313 Hawkins Street c 1945 Ranch

One-story, wood frame Ranch with a side facing gable roof of asbestos shingles. Partial width front facing gable roof projecting entry porch is supported by chamfered wood columns on a concrete porch deck with concrete steps. Façade is three-bays (W-tripled, D, W-tripled) with horizontal wood Dutch lap siding and corner boards. The windows are 4/4 wood double-hung sash with a picture window between. The entry door is a wood slab with an outer wood screen door. Exposed rafter tips are visible.

223b. C Garage c 1945

One-story, wood frame one-car garage with a front facing gable roof of corrugated metal panels. The opening is cased and the siding is horizontal wood lap siding with corner boards. Exposed rafter tips are visible.

224a. C 321 Hawkins Street c 1935 Craftsman Bungalow

One-and-a-half-story Craftsman Bungalow with a hip roof of asbestos shingles with ridge caps on a brick pier foundation with brick infill. Full width and wrap around undercut porch is supported by wood box columns with segmental arched panels between. The porch deck is wood and the left side of the porch is screened. There are concrete steps with concrete wing walls. The façade is eight-bays (D, D, D, D, D, D, D, W) with thin strip horizontal wood lap siding and corner boards. The door on the far left and the one on the far right are both wood with three vertical lights over three horizontal recessed panels. The center entry door is wood with twelve lights over one large recessed panel. The other doors are double-leaf French doors with ten lights each. The window is 3/1 wood double-hung sash. There is a large hip roof dormer with two fixed windows with three lights each flanked by rectangular wood louvered vents. There is one internal brick chimney visible. The eaves are boxed.

224b. C Garage c 1940

One-story, wood frame garage with a shed roof of metal panels on a concrete slab. There are six openings with all of them having chamfered corners and the two end openings are filled with barn doors in a chevron pattern. The garage is sided in horizontal wood lap siding and corner boards. Exposed rafter tips are visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 69

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

High School Street

225. C 809 High School Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Projecting and recessed front facing gable roof porch supported by wood tapered columns on brick pedestals with cast stone caps. Off-center brick pedestal with stone cap and no column. There is a wood porch deck with concrete steps and low brick wing walls and cast stone caps. The façade is three-bays (W-paired, D, W-paired) with vinyl siding. The windows are 9/1 wood double-hung sash in a Craftsman pattern and have applied louvered shutters. Front facing gable roof over the left windows. The entry door is a modern metal clad wood door with an oval light. The eaves are boxed and supported by knee braces. Painted brick interior chimney is visible

226a. C 811 High School Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a painted brick pier foundation with painted brick infill. Projecting and recessed front facing gable porch supported by triple wood columns on brick pedestals with cast stone caps. Off-center brick pedestal with stone cap and no column. There is a wood porch deck with concrete steps and low brick wing walls and cast stone caps. Façade is three-bays (W-paired, D, W-paired) with thin strip horizontal wood lap siding with corner boards. The windows are 9/1 wood double-hung sash in a Craftsman pattern and the entry door is wood with nine lights in a Craftsman pattern. Projecting eaves with exposed rafter tips. Painted brick interior chimney is visible. The projecting eaves are supported by knee braces.

226b. C Garage c 1940
One-story, wood frame garage with front facing gable roof of asphalt shingles and thin strip horizontal wood lap siding with corner boards. There are two wood garage doors with twenty-four panels each.

227. C 901 High School Street c 1900 Queen Anne
One-story, wood frame Queen Anne with a hipped roof of asphalt shingles on a brick pier foundation with brick infill. Small entry porch with a shed roof supported by a metal fluted column on a brick deck with brick steps. Façade is six-bays (W, D, W, W, W, W) with vinyl siding. Front facing pent gable roof projection with chamfered corners and a single light in the gable. Windows are all 2/2 wood double-hung sash with applied louvered shutters except for the two on the far right which are 1/1 metal frame single-hung sash. The front door is wood with a single light over three recessed panels. The eaves are boxed. Interior brick chimney is visible with brick corbelling at the top.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 70 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

228. NC 903 High School Street c 1965 Ranch
One-story, modern brick veneer Ranch with side facing gable roofs of asphalt shingles on a brick foundation with metal vents. Concrete stoop with low brick wing walls. Façade is seven-bays (W, D, W, W, W, D-paired, W). The windows are all metal frame single-hung sash with a combination of 8/8, 6/6, 4/4 windows on angled brick sills. The entry door is wood with six recessed panels and a metal screen door. The paired doors are double-leaf French doors with fifteen lights each. The eaves are boxed. There is a projecting flat roof metal carport supported by metal columns.

229. NC 907 High School Street c. 1970 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Front brick stoop with low brick wing walls. Façade is three-bays (W-paired, D, W-paired). Windows are 2/2 metal frame single-hung sash horizontal divided on brick angled sills and with applied louvered shutters. The entry door is wood with an oval light over two recessed vertical panels and with an outer metal and glass storm door. The eaves are boxed.

230a. C 909 High School Street c 1910
One-story, wood frame residence with a hip roof of composite shingles on a brick pier foundation with brick infill. Undercut partial width screened front porch supported by wood box columns with simplified capitals. Wood porch deck with concrete steps. Façade is four-bays (W, D, D, W-paired) horizontal wood lap siding with corner boards. The windows are 1/1 wood double-hung sash with applied louvered shutters on the right windows. The door on the left is wood with three lights over three recessed panels and a single light transom. The right door is the main entry door which is wood with an oval light with oval sidelights and a six light transom. The eaves are boxed.

230b. C Garage c 1950
One-story, front facing gable roof garage with asphalt shingles. Horizontal wood lap siding. Cased opening for the garage with no door.

231. C 911 High School Street c 1925 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood box columns on brick pedestals with cast stone caps and a low rectangular balustrade between the pedestals. The left bay of the three-bay porch has been enclosed with siding and a twenty-one light steel casement window. There is a wood porch deck with concrete steps and low brick wing walls with cast stone caps. The façade is three bays (W-tripled, D, W-tripled) with thin strip horizontal wood lap siding with corner boards. Each set of tripled windows has 9/1, 12/1, 9/1 wood double-hung sash windows. The entry door is Craftsman in style with eight small rectangular lights over three vertical recessed panels. The projecting eaves have exposed rafter tips.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 71 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

232. C 915 High School Street c 1910
One-story, wood frame residence with a hip roof of diamond pattern asbestos shingles with ridge tiles. Full width undercut porch supported by wood box columns with dentiled capitals on a wood porch deck with brick steps. Façade is four-bays (W, W, D, W) with horizontal wood lap siding with corner boards. The windows are 1/1 wood double-hung sash with applied louvered shutters. The entry door is wood with a single light over three horizontal recessed panels. Large hip roof dormer with two lights and one of covered with plywood. The eaves are boxed.

233 C 919 High School Street c 1910 Queen Anne
One-story, wood frame Queen Anne with gable on hip roof of diamond pattern asbestos shingles on a painted brick pier foundation with painted brick infill in a lattice pattern. Front projecting wrap around hip roofed porch supported by paneled wood box columns on a wood porch deck with brick steps. The façade is four-bays (D, W-paired, D, W-paired) with horizontal wood lap siding with corner boards. The windows are 1/1 wood double-hung sash. The door on the left is wood with six recessed panels and a single light transom above. The entry door is wood with an oval light and oval sidelights with a single transom above. There is a 3/1 wood double-hung sash window in the front facing pent gable. A shed roof dormer has three 3/1 wood double-hung sash windows. There is an interior brick chimney visible. The eaves are boxed.

234. C 923 High School Street c 1905 Queen Anne
One-story, wood frame L-shaped Queen Anne with gable on hip roof of diamond pattern asbestos shingles on a brick pier foundation with brick infill. L-shaped projecting hip roof porch supported by turned columns with brackets on a wood porch deck with concrete steps and metal rails. The façade is seven-bays (W, D, W, W, W, D, W) with horizontal wood lap siding with corner boards. The windows are all 1/1 wood double-hung sash except for the far right window which has fifteen lights over four lights in a Queen Anne style window. The pent gable front projection has chamfered corners. Two interior brick chimneys are visible. A front facing gable dormer has two 1/1 wood double-hung sash windows. Projecting eaves are boxed. A front facing gable roof garage is attached to the rear of the house and has a metal panel two-car garage door.

235. C 925 High School Street c 1955 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Façade is five-bays (Carport, W, W, D, W). The carport is under the main roof and supported by metal columns. The two windows surrounding the large frontal exterior chimney are steel frame casements with twenty lights and have applied louvered shutters. The other window is also a steel frame casement with sixteen lights and has applied louvered shutters. The window is located under a front facing gable with asbestos shingle siding and a triangular louvered vent. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 72 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

236a. C 926 High School Street c. 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a hip roof with asphalt shingles on a painted brick pier foundation with brick infill in a lattice pattern. The front porch is undercut and is supported by large paneled wood box columns with a rectangular balustrade on a wood porch deck with concrete steps and a low stucco wing walls with metal railings. The façade is four-bays (W-paired, D, W-paired, W-paired) with thin strip horizontal wood lap siding with corner boards. The windows are 1/1 wood double-hung sash with applied louvered shutters. The paired windows on the far left of the façade have pent metal awnings. The entry door is a replacement wood slab door flanked by four light over two vertical panel sidelights with a two light transom over each sidelight and a four light transom over the door. Two wings project from either side of the hip roof with clipped gable roofs. The wing to the right is an original carport supported by columns matching the front porch on low stucco covered bases with cast stone caps. The projecting eaves have exposed rafter tips.

236b. C Outbuilding c. 1940
Small one-story, wood frame outbuilding to the rear of the house with side facing gable roof of asphalt shingles on a concrete foundation. The façade is three-bays (W, D, W) with thin strip horizontal wood lap siding with corner boards. The windows are 1/1 metal frame single-hung sash and the door is wood with five recessed panels. The projecting eaves have exposed rafter tips.

237. NC 927 High School Street c 1960 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Small projecting shed roof entry porch supported by a decorative metal post and extends over one of the front windows. Concrete stoop with concrete steps and a wood handicap ramp to the side. The façade is five-bays (W, W-tripled, D, W, Carport) with vinyl siding. The windows are 6/6 wood double-hung sash with the applied louvered shutters and the tripled window has a twenty light picture window in the center. The carport is supported by thin metal posts. The eaves are boxed.

238. C 930 High School Street c 1895
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch supported by wood box columns with a turned balustrade on a brick porch deck with brick steps up to the entry door. The façade is five-bays (W, W, D, W, W) with horizontal wood lap siding with corner boards. The windows are 2/1 wood double-hung sash with applied louvered shutters. The entry door is wood with a single light over two horizontal recessed panels and a two light transom. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 73 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

239. NC 939 High School Street c. 1980 Ranch
One-story, brick veneer Ranch with a side facing gable roof of metal panels on a brick foundation. Recessed entry porch supported by wood Tuscan columns on a brick and concrete porch deck with a brick step. The area under the recess is sided in wood vertical panels. The façade is seven-bays (W, W, D, W, W, W, W). All windows are 8/8 metal frame single-hung sash with applied louvered shutters except for the windows under the porch recess as one is 8/8 metal frame single-hung sash with no shutters and the other is 6/6 metal frame single-hung sash with no shutter. The entry door is a modern wood door with four recessed panels and the upper two leaded glass. There is a single three light over a single panel sidelight to the right side of the entry door. The eaves are boxed. There is an interior brick chimney visible with a plate metal cap.

240. NC 940 High School Street c 1980
One-story, masonry commercial gas station with a flat roof on a concrete foundation. There is a mansard roof of metal panels covering the entrance and windows. The facade is five-bays (W, W, D, W, W). The windows are all plate glass and the door is double-leaf aluminum frame with glass. There is a flat roof canopy over the pumps supported by large metal box columns.

241. C 943 High School Street c 1925 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a brick foundation with lattice panel infill. Partial width front facing gable roof projecting entry porch is supported by tapered wood columns on brick half-height piers with cast stone caps. The central brick pier has no support above it. The wood porch deck has concrete steps. The façade is three-bays (W-paired, D, W-paired) with horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash with the window not under the entry porch having applied louvered shutters. The entry door is wood with an outer wood screen door. Two internal brick chimneys are visible. There are projecting eaves with exposed rafter tips and supported by knee braces.

Jackson Street

242. C 800 Jackson Street c 1955
One-story, brick veneer residence with a side facing gable roof of asbestos shingles with ridge caps on a brick foundation. There are two front bays with hip roofs and an undercut porch between supported by decorative metal posts on a concrete porch deck and decorative metal rail between the posts. The façade is four-bays (W, W-tripled, D, W). The single windows are 8/8 wood double-hung sash and the tripled window is made up of 1/1 wood double-hung sash windows. All windows have angled brick sills. The door is a wood slab. There is a wide eave board around the house and the eaves are boxed.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 74 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

243a. C 906 Jackson Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with double gable roof of asphalt shingles on a brick foundation. Partial width front facing gable projecting roof entry porch supported by wood box columns, with capitals, on wood porch deck with concrete steps. The gable of the porch is sided in asbestos shingles and has two rectangular wood louvered vents. The façade is four-bays (W-paired, D, W-paired, W-paired) with horizontal wood lap siding with corner boards. The windows are 4/1 wood double-hung sash with vertical lights in the upper half. The entry door is wood with a four light fanlight and four recessed panels. The projecting eaves have exposed rafter tips.

243b. C Garage c 1945
Two-story, wood frame garage with a side facing gable roof of asphalt shingles on a concrete foundation. The first story has two barn type doors and the second story has a frontal screened porch with a walled balustrade.

244. C 910 Jackson Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Projecting partial width front facing gable roof entry porch supported by wood box columns on a wood porch deck with concrete steps. The façade is three-bays (W, D, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash with applied louvered shutters. The entry door is a wood slab with a metal and glass storm door. The projecting eaves have exposed rafter tips.

245. C 912 Jackson Street c. 1938 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with brick infill. The façade is three-bays (W-paired, D, W-tripled) with thin strip horizontal wood lap siding with corner boards. The windows are 3/1 wood double-hung sash with applied louvered shutters. The entry door is in an arched recess and is wood with six recessed panels and a four division fanlight transom above. There is a brick stoop with a concrete deck and brick steps. A shed roof carport is attached to the right side of the house and has a walled in storage area. In the gable is rectangular wood louvered vent. The projecting eaves have exposed rafter tips.

246a. C 914 Jackson Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a double front facing gable roof of asphalt shingles on a brick foundation. There is a pent metal awning over the concrete stoop with concrete steps and a metal rail. The façade is three-bays (W, D, W) with asbestos shingle siding and corner boards. The windows are 1/1 wood double-hung sash with curved awnings with scalloped skirts. The upper gable has a wood rectangular louvered vent. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 75

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

246b. C Garage c 1950

Two-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. The first floor façade has two open bays. The second floor has asbestos shingle siding and two 1/1 wood double-hung sash windows with pent metal awnings. The eaves are boxed.

Lafayette Street

247. C 312 Lafayette Street c 1925 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a side facing gable roof of diamond pattern asbestos shingles on a brick pier foundation with brick infill. Full width undercut entry porch is supported by wood box columns on half height brick piers with cast stone caps. There is a metal railing between the brick piers. The façade is four-bays (D, W, D, W-paired) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash. The door on the left is wood with three lights over three recessed horizontal panels. The main entry door on the right is wood with a single light over one large recessed panel and is Craftsman in style. There is front facing gable roof dormer with two rectangular wood louvered vents. Two interior brick chimneys are visible. Exposed rafter tips and knee braces are visible.

248. C 314 Lafayette Street c 1925

One-story, wood frame residence with a hip roof of asphalt shingles on a brick pier foundation. Partial width shed roof projecting entry porch supported by wood box columns on a wood porch deck with wood steps. The façade is three-bays (W, D, W) with horizontal wood lap siding and corner boards. The windows are 2/2 metal frame single-hung sash horizontally divided. The door is a wood slab. The eaves are boxed.

249. C 316 Lafayette Street c 1925

One-story, wood frame residence with a side facing gable roof of diamond pattern asbestos shingles on a brick foundation. The entry porch is partial width and undercut supported by turned columns with brackets and a frieze on a wood porch deck with concrete steps and a square wood balustrade. The windows from left to right are 6/6 wood double-hung sash, 1/1 wood double-hung sash, and 2/2 metal frame single-hung sash horizontally divided. Both doors are wood and Queen Anne in style with a single light over three horizontal recessed panels and with outer metal and glass storm doors. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 76 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

250. C 318 Lafayette Street c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with brick infill. The partial width projecting entry porch has a front facing gable roof and is supported by wood posts, with a square wood balustrade between the posts, and a wood porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash and the door is a wood slab. There is a rectangular wood louvered vent in the gable. The eaves are boxed.

251. C 321-323 Lafayette Street c 1945
One-story, wood frame duplex with a side facing gable roof of metal panels on a brick foundation. There are two partial width projecting entry porches on either end of the front façade supported by decorative metal posts on concrete decks with concrete steps. In each porch gable is a triangular louvered vent. The façade is six-bays (D, W, W, W, W, D) with asbestos shingle siding. The windows are 6/6 wood double-hung sash and the entry doors are wood with two upper lights over four recessed panels and outer metal and glass storm doors. One side of each entry door has a single applied louvered shutter and the window closest to the doors also has a single applied louvered shutter. The eaves are boxed.

252. C 325 Lafayette Street c 1945
One-story, wood frame duplex with a front facing gable roof of metal panels. There is a front facing gable roof partial width projecting entry porch supported by decorative metal posts on a concrete deck with concrete steps. The façade is four-bays (W-tripled, D, D, W-tripled) with asbestos shingle siding. The tripled window units have a central picture window flanked with 1/1 wood double-hung sash windows covered with board and batten shutters. The entry doors are wood with two upper lights over four recessed panels and outer metal and glass storm doors. The upper gable has a triangular louvered vent. The eaves are boxed.

253a. C 404 Lafayette Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. Undercut entry porch supported by wood box columns on a wood porch deck with concrete steps. The façade is three-bays (W, D, W-paired) with horizontal wood Dutch lap siding and corner boards. The windows are 3/1 wood double-hung sash and the entry door is wood with three vertical lights over three horizontal recessed panels. The porch and paired window both have a pent metal awning. Above the paired window is a front facing gable with a square wood louvered vent. Exposed rafter tips are visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 77 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

253b. C Garage c 1940
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. There is a single-car opening with a paneled door. Siding on the garage is horizontal wood lap with corner boards. Exposed rafter tips are visible.

254. C 418 Lafayette Street c 1910 Queen Anne
One-story, wood frame L-shaped Queen Anne with a cross-gable roof of asphalt shingles on a foundation covered with corrugated panels. Partial width, shed roof projecting screened entry porch supported by wood posts on a wood porch deck with concrete steps. The façade is six-bays (W, D, D, W, W-paired) with thin strip horizontal wood lap siding and corner boards. The single windows are 4/4 wood double-hung sash and the paired window is 1/1 wood double-hung sash. The doors are wood with four recessed panels each and the left one having an outer metal screen door. Underneath the projecting gable bay the walls are chamfered. The eaves are boxed. There is one interior brick chimney visible.

255. C 420 Lafayette Street c 1910 Queen Anne
One-story, wood frame L-shape Queen Anne with a cross-hip roof of asphalt shingles on a brick pier foundation with brick infill. Partial width projecting hip roof entry porch which appears to have been a wrap around porch with is now partially enclosed. The porch is supported by wood posts with a low sided wall and screen above between the columns. The façade is four-bays (W, W-tripled, D, W-paired) with horizontal wood Dutch lap siding and corner boards. The window on the far left is a 2/2 metal frame single-hung sash horizontally divided and the other windows are 2/2 wood double-hung sash. The entry door is a modern metal clad wood door with fifteen lights. The eaves are boxed.

256. C 422 Lafayette Street c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a cross-gable roof of asphalt shingles on a brick foundation. There is a small cantilevered front facing gable roof porch supported by knee braces over brick steps. The façade is seven-bays (W, D, W, W-paired, W, W-paired, W-paired) with thin strip horizontal wood lap siding and corner boards. The windows are 9/1 wood double-hung sash in a Craftsman pattern except for the last two paired windows on the right which are 3/1 wood double-hung sash. The entry door is modern with two vertical leaded lights over two projecting panels. There is a square wood louvered vent in the gable. There are projecting eaves with exposed rafter tips and knee braces.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 78 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

257. C 424 Lafayette Street c 1955 Ranch
One-story, wood frame Ranch with a cross-gable roof of metal panels on a foundation which is not visible. There is a slight roof projection for the undercut entry porch supported by decorative metal posts on a concrete slab. The façade is six-bays (W, W, D, W, D, W) with horizontal wood Dutch lap siding and corner boards. The windows from left to right are 2/2 metal frame single-hung sash horizontally divided, a picture window, 2/2 metal frame single-hung sash horizontally divided, and 1/1 metal frame single-hung sash. All of the windows have applied louvered shutters. It is difficult to tell the configuration of the doors. There is a triangular louvered vent in the gable. The eaves are boxed.

258a. C 425 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. There is an undercut screened entry porch supported by wood posts on a concrete deck with a shed roof addition to the front of the porch, also supported by wood posts. The façade is three-bays (W, W-bay, W) with horizontal Masonite siding. The windows are 6/6 metal frame single-hung sash. The bay is located in a front facing gable roof projection and has four windows with a hip roof above the windows in the bay. The entry door faces the side under the screened porch and is wood with six recessed panels. The eaves are boxed. This house is a mirror image in plan to 427 Lafayette Street.

258b. C Garage c 1950
One-story, wood frame garage with a front facing gable roof of metal panels. The opening is off-set and cased. The siding is horizontal wood lap siding with corner boards. This garage is a mirror image of the garage at 427 Lafayette Street.

259a. C 427 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. There is an undercut screened entry porch supported by wood posts on a concrete deck. The façade is three-bays (W, W-tripled, W) with horizontal Masonite siding. The tripled window unit is made up of a central 6/6 wood double-hung sash flanked by 4/4 wood double-hung sash windows and is located in a projection with a shed roof and brackets under the projection. The other windows are 8/8 wood double-hung sash. The entry door is under the screened porch. It faces the side and is wood with six recessed panels. The bay is located in a front facing gable roof projection and has four windows with a hipped roof above the windows in the bay. The eaves are boxed. This house is a mirror image in plan to 425 Lafayette Street.

259b. C Garage c 1950
One-story, wood frame garage with a front facing gable roof of metal panels. The opening is off-set and cased. The siding is horizontal wood lap siding with corner boards. This garage is a mirror image of the garage at 425 Lafayette Street.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 79 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

260. NC 429 Lafayette Street c 1965
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick foundation. There is a small partial width front facing gable roof projecting entry porch supported by fluted metal columns on a concrete stoop with a concrete step. The facade is four-bays (W-paired, D, W-paired, D) with a brick veneer wainscot and asbestos shingle siding above. The windows are 6/6 metal frame single-hung sash. The doors are both metal clad wood with six projecting panels and metal storm doors. It appears as though the original carport to the right of the house has been enclosed with siding and a door. The eaves are boxed.

261. C 430 Lafayette Street c 1935 Tudor Revival
One-story, brick veneer Tudor Revival with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. A front facing gable roof projection has a separate front facing gable roof undercut entry with an arched opening. There is a square wood louvered vent in the gable. The facade is five-bays (W, D, W, W, W). The window to the far left is a metal frame two light slider and to the right of the door the windows are wood frame picture windows with the last two arched. All windows have soldier course headers and angled brick sills. The two windows on the right were part of an open porch as the concrete deck is still visible. It appears as the arched windows just filled the porch openings. The entry door is a wood slab with an upper diamond light. The eaves are boxed. There is a side facing gable roof carport addition to the left of the house supported by metal poles.

262. C 432 Lafayette Street c 1955 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a painted brick foundation. There is a front facing gable roof partial width projecting entry porch supported by wood posts on a concrete deck with concrete steps. The facade is four-bays (W-paired, W-tripled, D, W-paired) with asbestos shingle siding. The windows are 1/1 wood double-hung sash with the tripled window having a central picture window. The door is wood with fifteen lights. The windows and the porch both have pent metal awnings. The windows not under the porch have applied lattice shutters. There is a shed roof carport addition to the right of the house supported by wood posts.

263. C 433 Lafayette Street c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation. Partial width front facing gable roof projecting entry porch supported by paired wood posts on half height stuccoed piers with cast stone caps. The porch deck is wood with concrete steps and brick wing walls with cast stone caps. The facade is three-bays (W-paired, D, W-paired). The windows are 9/1 wood double-hung sash in a Craftsman pattern with applied louvered shutters. The entry door is wood with nine lights also in the Craftsman pattern. Exposed rafter tips and knee braces are visible. There is a carport addition attached to the left of the house supported by metal poles and to the right is a screened in porch addition.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 80 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

264. C 434 Lafayette Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing clipped gable roof of metal panels on a brick foundation with vents. There is a small partial width front facing gable roof cantilevered entry porch supported by knee braces over brick steps. The façade is four-bays (Porch, W, D, W-paired) with horizontal wood lap siding and corner boards. The porch has been partially enclosed with panels. The window to the left of the door has a four light upper sash with a 3/1 division and the lower sash is paneled. The paired windows are 3/1 wood double-hung sash. The door is modern and wood with an upper leaded glass light over a recessed panel. Exposed rafter tips are visible.
265. C 435 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a painted brick foundation with vents. Partial width front facing gable roof projecting entry porch is supported by metal fluted columns on a concrete porch deck with concrete steps. There is a triangular louvered vent in the gable of the porch. The façade is five-bays (W, W, W-paired, D, W) with horizontal wood lap siding and corner boards. The non-paired windows are 2/2 metal frame single-hung sash horizontally divided and the paired windows are 6/6 wood double-hung sash. The entry door is metal clad wood with leaded light over four projecting panels. The eaves are boxed. There is a side facing gable roof carport addition to the left of the house supported by decorative metal posts.
266. C 502 Lafayette Street c 1910 Queen Anne
One-story, wood frame Queen Anne with a gable-on-hip roof of asphalt shingles on a brick pier foundation. Partial width shed roof screened entry porch supported by turned columns on a wood porch deck with concrete steps. There is a hip roof projection that wraps around the porch. The façade is three-bays (W, D, W-paired) with horizontal wood Dutch lap siding and corner boards. The non-paired window is a 2/2 wood double-hung sash and the paired window has 9/6 metal frame single-hung sash windows. The entry door is wood and Queen Anne in style with one light over a panel. The front facing gable roof projection has gable returns.
- 267a. C 503 Lafayette Street c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with lattice infill. There is a partial width hip roof projecting entry porch supported by tapered wood box columns on half height brick piers with cast stone caps. The porch deck is wood with concrete steps and a pent metal awing wraps around the porch. The façade is three-bays (W-paired, D, W-paired) with horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash and the entry door is a wood slab with a diamond upper light. There is one external brick chimney visible. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 81 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

267b. C Garage/Apartment c 1945

Two-story, concrete block garage and apartment with a side facing gable roof of asphalt shingles on a concrete foundation. There is a two-story partial width front facing gable roof entry porch supported by concrete block columns with concrete steps to the second floor. The façade on the first floor is one-bay (W) and the second floor is three-bays (W, D, W). The windows are 6/6 wood double-hung sash and the entry door is wood with six panels. The wood garage door is on the side. Exposed rafter tips are visible.

268. C 504 Lafayette Street c 1940 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. Undercut partial width screened entry porch supported by wood box columns on a wood porch deck with concrete steps. The façade is three-bays (W, D, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the paired window has applied louvered shutters. The entry door is wood with three vertical upper lights over three horizontal recessed panels. Over the paired windows is a front facing gable roof with a triangular louvered vent in the gable. The eaves are boxed.

269a. C 509 Lafayette Street c 1935 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. Partial width shed roof projecting entry porch supported by paired wood box columns on a concrete deck. The façade is five-bays (W-paired, D, W-paired, W, W) with thin strip horizontal wood lap siding and corner boards. The windows are 2/2 metal frame single-hung sash horizontally divided with applied louvered shutters. The entry door is wood with four arched lights over four recessed panels. There is a combination of boxed eaves and exposed rafter tips.

269b. C Outbuilding c 1940

One-story, wood frame side facing gable roof outbuilding which looks to be a former garage enclosed with wood panels and a W, D, W in the two-car chamfered opening. There is also a door to the right of the former garage opening. The windows are 6/6 wood double-hung sash and the door between the windows is a wood slab, the other door is wood with three vertical lights over three horizontal recessed panels. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 82 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

270. C 510 Lafayette Street c 1940
One-story, brick veneer residence with a side facing gable roof of asphalt shingles on a brick foundation. Undercut partial width entry porch is located under a front facing gable roof projection and is supported by a full height brick column on a concrete deck with concrete steps. The façade is five-bays (Porch, W, W-tripled, D, W). The window on the far left is 2/2 metal frame single-hung sash horizontally divided, the tripled window is made up of a 6/6 wood double-hung sash central window flanked by 2/2 wood double-hung sash windows, and the last window is a 6/6 wood double-hung sash. All of the windows have security bars. The entry door is wood with six recessed panels and a metal and glass storm door. The eaves are boxed and there are gable returns.

271. C 511 Lafayette Street c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of diamond pattern asbestos shingles on a brick pier foundation with brick infill. Full width undercut entry porch supported by wood box columns on a wood porch deck. Façade is four-bays (W-paired, D, D, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the entry doors are wood with three vertical lights over three recessed horizontal panels and have outer security doors. There is a front facing gable roof dormer with a square wood louvered vent. Exposed rafter tips are visible. There is a shed roof carport to the rear and left of the house supported by decorative metal posts.

272. C 513 Lafayette Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with metal panel infill. Partial width undercut entry porch supported by wood box columns on a wood porch deck with wood steps. There is wood siding between the columns to form a low wall. The porch has a wood pent awning with scallop trim. The façade is four-bays (W, D, W, W-paired) sided in vinyl. The windows are 9/1 wood double-hung sash with applied louvered shutters. The entry door is metal clad wood with nine lights over two vertical panels. There are two front facing gable roof dormers, one with a six light window and the other missing a window.

273. NC 601 Lafayette Street c 1980 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Small undercut entry porch with a concrete stoop and metal rail. The façade is five-bays (Carport, W, W-bay, D, W). The windows are 6/6 metal frame single-hung sash with applied louvered shutters and the bay window is made up of four 4/4 metal frame single-hung sash windows. The entry door is wood with eight recessed panels. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 83 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

274. NC 602 Lafayette Street c 1980 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. The façade is four-bays (Carport, W-paired, D, W). The carport is supported by a full height brick column. The windows are 6/6 metal frame single-hung sash with applied louvered shutters and the entry door is metal clad wood with six projecting panels and an outer metal storm door. There is slight projection of the roof over the carport and the entry door. The eaves are boxed.

275. NC 603 Lafayette Street c 1980 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. The façade is five-bays (W, W, D, W-tripled, Carport). The windows are two-part sliders with applied paneled shutters and the tripled window has a picture window between the sliders. The entry door is a wood slab with an outer metal storm door. The carport is supported by decorative metal posts. There is slight projection of the roof over the carport and the entry door. The eaves are boxed.

276. NC 604 Lafayette Street c 1945
One-story, brick veneer residence with a hip roof of asphalt shingles on a brick foundation. There is a concrete entry stoop with concrete steps. The façade is four-bays (W, D, W, W). The windows are 6/6 metal frame single-hung sash and the entry door is metal clad wood with six projecting panels and an outer metal and glass storm door. All of the windows and the door have pent metal awnings. The eaves are boxed. There have been changes to this house which detract from the original character including removing the original windows and filling the opening with a new window and vinyl siding. The original porch has also been enclosed with vinyl siding and a new window.

277a. NC 607 Lafayette Street c 1980 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation. The façade is four-bays (W, W-paired, D, W-paired). The windows are 6/6 metal frame single-hung sash with applied louvered shutters and the entry door is a wood slab with an outer metal and glass storm door. There is slight projection of the roof over the concrete entry stoop. The eaves are boxed.

277b. NC Shed c 1990
There is a large side facing gable roof metal shed to the front of the house. The façade is two-bays (D, W-paired). The door is metal clad wood with nine lights over two vertical projecting panels and the windows are 2/2 metal frame single-hung sash horizontally divided.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 84 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

278. NC 800 Lafayette Street c 1965 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is a small undercut entry porch supported by a decorative metal posts on a concrete slab. The façade is four-bays (W, W, D, W-paired). The windows are 6/6 metal frame single-hung sash with applied louvered shutters except for the one to the left of the door which is an 8/8 metal frame single-hung sash. The entry door is wood with eight panels and an outer metal storm door. The eaves are boxed.

279. NC 801 Lafayette Street c 1990 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles and two wings with front facing gable roof projections on a concrete foundation. There is a front facing gable roof projection with an undercut entry porch supported by a metal fluted column on a wood porch deck which has a large wood frame handicap ramp extending from it. The façade is eight-bays (Garage, W, W, W, D, W, W-paired, W) and is sided in vinyl. The windows are a combination of 4/4 and 8/8 metal frame single-hung sash with applied paneled shutters. The opening for the garage is cased. The entry door is metal clad wood with six projecting panels. The eaves are boxed.

280a. C 802 Lafayette Street c 1955 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch supported by decorative metal posts with metal railings on a concrete porch deck with brick steps, which also have metal railings. The façade is four-bays (W-paired, D, W-paired, W). The windows are 6/6 wood double-hung sash with applied louvered shutters and the entry door is wood with an oval leaded light. The eaves are boxed.

280b. NC Garage c 1970
One-story, wood frame two-car garage with a side facing gable roof of asphalt shingles on a concrete foundation. There is one large opening with a single pole support in the middle. The garage is sided in vinyl.

281. C 803 Lafayette Street c 1955 Ranch
One-story, brick veneer L-shaped Ranch with a cross-gable roof of asphalt shingles on a brick foundation. Flat roof partial width projecting entry porch is supported by decorative metal posts on a concrete stoop and concrete steps. The façade is four-bays (W, D, W, W). The windows are 16 light steel casement windows with angled brick sills and applied paneled shutters. The entry door is wood with a four division fan light over four recessed panels and an outer metal security door. There is a round wood louvered vent in the front facing gable. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 85 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

282. C 804 Lafayette Street c 1955 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation with vents. Partial width shed roof projecting entry porch is supported by metal fluted columns on a brick deck with brick steps. The façade is six-bays (W, W, D, W-tripled, W, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash except for the tripled window with has a central 8/8 wood double-hung sash window flanked by 6/6 wood double-hung sash windows. All but the tripled windows have applied louvered shutters. The entry door is wood with two upper lights over four recessed panels with and outer wood screen door with the bottom half having louvers. The eaves are boxed. There is a front facing gable roof carport attached to the right end of the house and is supported by fluted columns on a low brick wall. There is a triangular louvered vent in the gable of the carport.

283. C 805 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation with vents. Partial width flat roof projecting entry porch is supported by a tapered wood column on a half height brick pier with a cast stone cap on a concrete porch deck with concrete steps. The façade is four-bays (Garage Door, W-tripled, D, W) with vinyl siding. The garage door is wood with 12 panels and four of those are lights. The tripled window has a central 8/8 wood double-hung sash window flanked by 6/6 wood double-hung sash windows. The entry door is wood with four division fan light over four recessed panels and an outer metal screen door. There is a triangular louvered vent in the front facing gable.

284. C 806 Lafayette Street c 1955 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a painted brick foundation. There is a slight roof projection for the partial width entry porch supported by decorative metal posts on a concrete deck and steps. The façade is four-bays (D, W-tripled, W, W-paired) with horizontal Masonite siding. The windows are 2/2 wood double-hung sash horizontally divided and the tripled window has a picture window between the two 2/2 windows. The entry door is wood with two upper lights over four receded panels. There are pent metal awnings over the windows not under the entry porch. There is a side facing gable roof carport attached to the left side of the house supported by decorative metal posts. The eaves are boxed.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 86 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

285a. NC 807 Lafayette Street c 1970 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch supported by wood Tuscan columns on a concrete porch deck with brick steps. The gable of the porch has a triangular louvered vent and horizontal wood lap siding. The façade is five-bays (W, W, D, W-tripled, W). The windows are 2/2 metal frame single-hung sash horizontally divided with applied louvered shutters and angled brick sills. The tripled window has a center picture window between the 2/2 windows. The entry door is wood with a four division fan light over four recessed panels. The eaves are boxed.

285b. NC Garage c 1970
One-story, garage with a front facing gable roof of asphalt shingles on a concrete foundation. There is a single car opening with a horizontal panel metal door with two lights. Next to the garage door is an metal clad wood door with six projecting panels. The front of the garage is sided in brick veneer that matches the house and has a triangular louvered vent in the gable. The sides of the garage have Masonite siding.

286. NC 808 Lafayette Street c 1965 Ranch
One-story, brick veneer ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. There is a slight roof projection over the entry and carport supported by decorative metal posts. There are brick steps to the entry door. The façade is five-bays (W-paired, W-paired, D, W-tripled, Carport). The paired windows are made up of four light awning units and the tripled window has a picture window between four light awnings. The entry door is a wood slab with three upper lights and an outer metal and glass storm door. The eaves are boxed.

287. NC 809 Lafayette Street c 1990 Ranch
One-story, brick veneer ranch with a hip roof of asphalt shingles on a brick foundation. There is an undercut entry porch supported by wood Tuscan columns on a brick porch deck. The façade is eight-bays (W, W, W, W, W, D, W-paired, W-paired). The windows from left to right are 6/6, 6/6, 9/6, 9/6, 9/6, 6/6, 6/6 and all are metal frame single-hung sash with the windows not under the porch having board-and-batten applied shutters. The entry door is wood with eight decorative projecting panels. The eaves are boxed.

288. NC 810 Lafayette Street c 1965 Ranch
One-story, brick veneer ranch with a hip roof of asphalt shingles on a brick foundation. There is a brick step to the entry door and no porch. The façade is five-bays (W, W, D, W-tripled, Garage Door). The window on the far left has been infilled with a wood panel and an air conditioning unit. The next window to the left of the door is a two light metal frame awning unit. The tripled metal frame window unit has a central picture window flanked by a window that has been infilled with a wood panel and an air conditioning unit on one side and a four light awning unit on the other side. The entry door is a wood slab and the garage door is metal with sixteen projecting panels. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 87 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

289. NC 812 Lafayette Street c 1975 Ranch
One-story, brick veneer ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is a slight roof projection over the entry and carport supported by full height brick walls on a concrete deck. The façade is five-bays (W, W, D, W-tripled, Carport). The windows are two part sliders and the tripled window has a central picture window flanked by 2/2 metal frame single-hung sash windows. The entry door is a wood slab with an upper diamond light and an outer metal and glass storm door. The carport is supported by a brick wall. The eaves are boxed.
290. C 902 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of metal panels on a brick foundation with metal vents. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters. The door is wood with two lights over four recessed panels and an outer metal and glass storm door. The eaves are boxed.
- 291a. NC 903 Lafayette Street c 1965
One-story, wood frame residence with a cross-gable roof of asphalt shingles on a concrete block foundation. The façade is three-bays (W, W, D) with asbestos shingle siding. The left window is a 1/1 metal frame single-hung sash and the other window is a three-part sliding window with a central picture window. Both windows have applied louvered shutters. The entry door is a wood slab with three diagonal lights and an outer metal and glass storm door. There is a triangular louvered vent in the front facing gable. Exposed rafter tips are visible.
- 291b. NC Garage c 1965
One-story, wood frame garage with a front facing gable roof of metal panels on a concrete foundation. There is one off-center one-car opening. The garage is sided in wood paneling.
292. C 904 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. The façade is four-bays (W-paired, D, W-paired, W) with asbestos shingle siding. The windows are 6/6 wood double-hung sash. The door is wood with fifteen lights with an outer wood screen door. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 88 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

293. C 905 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Concrete entry stoop with concrete steps and with a pent metal awning above supported by slender metal poles. The façade is three-bays (W-paired, D, W-paired) with asbestos shingle siding. The windows are 4/4 metal frame single-hung sash with applied louvered shutters. The door is wood with six recessed panels. The eaves are boxed.

294a. C 906 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Undercut entry porch supported by wood box columns on a concrete porch deck with concrete steps. The porch has a pent metal awning that wraps around the side. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 6/6 wood double-hung sash with applied louvered shutters. The door is a wood slab with an outer metal and glass storm door. The eaves are boxed. [Photo #18]

294b. C Garage c 1955
One-story, wood frame garage with a front facing gable roof of metal panels on a concrete foundation. One cased opening for a two-car wood garage door with thirty-two recessed panels.

295. C 907 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Undercut entry porch supported by decorative metal posts on a concrete porch deck with concrete steps. The façade is four-bays (W-paired, D, W-paired, W) with horizontal Masonite siding. The paired windows are 9/6 wood double-hung sash and the other window is a 6/6 metal frame single-hung window. The door is metal clad wood with six projecting panels. The eaves are boxed.

296. C 908 Lafayette Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width front facing gable roof projecting entry porch is supported by wood boxed columns on a concrete porch deck with concrete steps. The façade is four-bays (W, W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash. The door is metal clad wood with six projecting panels with an outer metal and glass storm door. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 89

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Main Street

297. C 934 Main Street c 1900 Queen Anne

One-story, wood frame L-shaped Queen Anne with cross-gable roof of asphalt shingles on a painted brick pier foundation with brick infill and metal vents. Front projecting hip roof porch supported by chamfered posts with a square wood post balustrade on a wood porch deck with a concrete steps. The façade is six-bays (W, W-paired, W, D, W, W) with wood Dutch lap siding with corner boards. The windows are 1/1 wood double-hung sash. The entry door is wood with three vertical lights over three recessed wood panels. Sidelights of two lights over a recessed panel surround the door as well as a two light transom. There is alternating diamond pattern and fish scales in the gable. Underneath the gable the corners are chamfered. The eaves are boxed.

298. C 935 Main Street c 1940

One-story, wood frame residence with a cross-gable roof of asbestos shingles on a brick foundation with vents. Projecting flat roof entry porch supported by wood box columns with square wood balustrade between the columns and all on a wood porch deck with concrete steps flanked by decorative metal rails and low brick wing walls with cast stone caps. Façade is five-bays (W-paired, W-tripled, W, D, W-paired) with thin strip horizontal wood lap siding and corner boards. The windows are all 6/6 wood double-hung sash except for the tripled window which is made up of a central 8/8 wood double-hung sash window flanked by 4/4 wood double-hung sash. All of the windows and the porch have pent metal awnings. The entry door is paneled wood with three upper stepped rectangular lights. There are wood triangular louvered vents in the gables with decorative trim. The eaves are boxed.

299. C 936 Main Street c 1935 Tudor Revival

One-story, brick veneer Tudor Revival with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Undercut entry porch in slight gabled projection with an arched opening. The facade is four-bays (W-tripled, W-paired, D, W-paired). The windows are 6/6 wood double-hung sash except for the far right paired window which is two sixteen light casement windows. The entry door is wood with a four light fan light over four recessed wood panels. The entry door is set in a pilaster surround with a blind arch fan light transom panel. There is an outer wood screen door. A massive stepped chimney with a stucco arched panel is to the left of the entry door. There are two front facing gables with the far right one having an arched wood louvered vent. The eaves are boxed. [Photo #19]

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7

Page: 90

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

300. NC 939 Main Street c 1980

One-story, brick veneer commercial building designed to look like a house with a hip roof of asphalt shingles on a brick foundation. Partial width hip roofed front projecting entry porch supported by fluted metal columns. The façade is five-bays (W, W, D, W, W) with 6/6 metal frame single-hung sash with applied paneled shutters. The entry door is metal clad wood with nine lights over two vertical projecting panels. There are sidelights with three lights over a single projecting panel flanking the door. The eaves are boxed.

301. C 940 Main Street c 1900 Queen Anne

One-and-a-half-story, wood frame Queen Anne with a front facing gable roof of diamond pattern asbestos shingles on a brick pier foundation with brick lattice infill. Partial width front projecting hip roof entry porch supported by turned columns on a wood porch deck with concrete steps flanked by low brick wing walls with cast stone caps. The façade is six-bays (W, W, D, W, W-paired, W) with vinyl siding. The windows are 4/4 wood double-hung sash and the entry door is wood with a single light over two recessed wood panels and a single transom above flanked by sidelights with three lights over a single recessed panel. Front projecting gable roof bay with chamfered corners with wood brackets. In the upper gable is a 4/4 wood double-hung sash window and a wood door with a single light over two recessed wood panels under a hip roof porch with wood posts on wood piers on top of a low wall. The eaves are boxed.

302a. C 943 Main Street c 1925 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a cross-gable roof of asphalt shingles on a brick foundation with metal vents. The original front facing gable roof partial width entry porch has been enclosed with siding, windows and a door unit with sidelights. The paneled wood columns on either end are still visible. There are concrete steps flanked by stepped brick wing walls with cast stone caps. In the gable of the porch is paneling. The façade is four-bays (W-tripled, W-tripled, D, W-tripled) with horizontal wood lap siding and corner boards. The windows are all 3/1 wood double-hung sash with the middle window unit having applied louvered shutters. The entry door is metal clad wood with leaded glass light over a two vertical panels with matching sidelights. Exposed rafter tips and knee braces are visible. There is one internal brick chimney visible.

303b. C Outbuilding c 1940

One-story, wood frame outbuilding with a side facing gable roof of diamond pattern asbestos shingles. The outbuilding appears to have been a carport and has since been partially enclosed with wood panels. There is double-leaf wood door with five recessed panels between the panel siding. Exposed rafter tips are visible. At the right end of the structure there are two wood Tuscan columns visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 91

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Main Street, North

303. C 1003 Main Street, North c 1935 Spanish Revival
One-story, wood frame Spanish Revival with a side facing gable roof of asphalt shingles on a stucco foundation. Projecting arched roof cantilevered entry porch over a concrete stoop. The façade is four-bays (W-tripled, W-paired, D, W-tripled) and is stuccoed. The windows are 9/1 wood double-hung sash and the entry door is wood with fifteen lights and has an outer wood screen door. Over the windows is flat roof awning projection with iron vents above. It appears that this house may have had a flat roof behind a parapet wall and the gable roof is a later addition. Exposed rafter tips are visible. [Photo #20]

304. C 1007 Main Street, North c 1945
One-story, brick veneer residence with a side facing gable roof of composition shingles on a brick foundation. Undercut entry porch with a tiled stoop and pent metal awning. Façade is four-bays (W-paired, W-tripled, D, W-paired). The windows are 6/6 wood double-hung sash and the entry door is wood with six recessed panels. There are two front facing gable roof dormers each with a 6/6 wood double-hung sash window and vinyl siding. The eaves are boxed. There is a shed roof carport attached to the right side of the house supported by metal poles.

305a. C 1021 Main Street, North c 1900 Colonial Revival
Former one-story, wood frame Colonial Revival, now two-story, with a hip on hip roof of composition shingles on a brick pier foundation with brick lattice infill. Front projecting partial width hip roof porch is supported by fluted wood Tuscan columns on a wood porch deck with brick steps. The architrave over the porch columns has recessed panels. There is a decorative cast iron rail between the columns. The façade is six-bays (W, W, D, W, W, W) with horizontal wood lap siding and corner boards. The windows are 1/1 wood double-hung sash and the entry door is wood with nine lights over a panel flanked by sidelights with six lights sidelights and a matching transom. The door, sidelights, and transom all have the same light division pattern of small upper and lower lights with elongated middle lights. A second floor has been added raising the original roof line; however, it is set back from the front of the house. Two single light windows are visible on the second story addition. The eaves are boxed.

305b. C Garage/Apartment c 1940
Two-story, wood frame garage with apartment above and a front facing gable roof of metal panels on a concrete foundation. The garage level has a single large cased opening and the second floor has two 4/4 wood double-hung sash windows. There is a wood stair on the left side which leads to the second floor. There is a wood louvered vent in the gable. Siding on the garage/apartment is thin strip horizontal wood lap siding with corner boards. Exposed rafter tips are visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 92 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

306a. NC 1025 Main Street, North c 1935

One-story, brick veneer former Craftsman Bungalow which has been heavily modified. The hip roof has asphalt shingles and the foundation is brick. The front facing gable roof projecting entry porch is partial width and supported by slender brick columns on stuccoed half height brick piers with cast stone caps which rest on a concrete porch deck with concrete steps. The gable of the porch is sided in horizontal wood lap siding and has gable returns. The façade is thee-bays (W-paired, D, W). The windows are 2/2 metal frame single-hung sash horizontally divided and the entry door is a wood slab flanked by single light sidelights with a single light transom above. There is an outer metal and glass storm door. The eaves are boxed. The original Craftsman Bungalow character of the house has been marred by the brick veneering of the house, the brick columns and the replacement of the windows and door.

306b. NC Carport c 1980

A free standing carport is located to the left of the house. It is supported by wood posts and has a metal panel roof.

307. NC 1107 Main Street, North c 1980

One-story, manufactured home with a side facing gable roof of asphalt shingles on a foundation covered by metal panels. There is a partial width front projecting shed roof porch supported by wood posts on a concrete porch deck sitting on a brick foundation. The façade is five-bays (W, W, W, W, D) with metal panel siding. The windows are 1/1 metal frame single-hung sash with applied louvered shutters and the entry door is a slab with an outer metal and glass storm door.

308. C 1201 Main Street, North c 1935 Craftsman Bungalow

One-story, Craftsman Bungalow with a side facing gable roof of asphalt shingles on a foundation covered by Masonite siding. The front facing gable roof partial width projecting entry porch is supported by wood box columns on half height brick piers with cast stone caps. There is a wood porch deck with concrete steps with brick wing walls with cast stone caps. The façade is four-bays (W, D, D, W) with horizontal wood Dutch lap siding and corner boards. The windows are 3/1 wood double-hung sash and the doors are metal clad wood with six projecting panels. There is a rectangular wood louvered vent in the gable of the porch. Exposed rafter tips are visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 93

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

309. C 1206 Main Street, North c 1935 Craftsman Bungalow
One-story, Craftsman Bungalow with a hip roof of asphalt shingles on a rusticated concrete block pier foundation. The full width undercut entry porch is supported by wood box columns with a slender arched band between the columns on a wood porch deck with concrete steps. The façade is four-bays (W, D, D, W) with thin strip horizontal wood lap siding and corner boards. From left to right the first window is 4/4 wood double-hung sash and the door is metal clad wood with nine lights over two vertical projecting panels, followed by a six projecting panel metal clad wood door, and then a 1/4 wood double-hung sash window. The windows have applied louvered shutters. Exposed rafter tips are visible.

310. C 1208 Main Street, North c 1955 Ranch
One-story, wood frame Ranch with a hip roof of asphalt shingles on a brick foundation with vents. Undercut entry porch with a concrete stoop and step. The façade is four-bays (W, W, W, W) with vinyl siding and vertical paneled siding on the walls of the undercut entry. The windows are all steel casements and the ones not under the porch have applied louvered shutters. The windows from left to right are twelve light, twelve light, sixteen light, twelve light, and six light. There is a hip roof garage attached to the rear right side of the house and has two garage doors, both metal with sixteen projecting panels each. The entry door faces the side and is wood with an oval leaded glass light over a panel. The eaves are boxed.

311a. C 1209 Main Street, North c 1910 Queen Anne
One-and-a-half-story, wood frame Queen Anne with a gable-on-hip roof of composition shingles on a brick pier foundation with stucco panel infill. There is a hip roof projecting wrap around entry porch supported by wood box columns with a cut balustrade between on a wood porch deck with concrete steps and a metal rail. The façade is six-bays (D, W, W, D, W, W) with horizontal wood lap siding and corner boards. The windows are 1/1 wood double-hung sash and the door on the left is wood with a single light over a projecting panel flanked by sidelights with three lights over a single panel and a single light transom above. The main entry door on the right is wood with an oval light with bas relief scroll work surrounding the light. The door is flanked by single light sidelights with a single light transom above. The projecting front facing gable roof bay has verge board in the upper portion of the gable, gable returns on the lower portion and a Palladian style window with a central arched window of nine lights over a single light flanked by six light windows. Below the gable the corners are chamfered and have decorative brackets. The eaves are boxed. [Photo #22]

311b. C Garage c 1940
One-story, wood frame garage with a side facing gable roof of corrugated metal panels on a brick foundation. Siding is wood panels and there is a double-leaf barn door at the end sided in the same panels as the rest of the barn. There is a shed roof open area attached to the rear of the barn supported by wood posts.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 94 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

311c. NC Garage c 1990
One-and-a-half-story, wood frame garage with a side facing gable roof of metal panels on a concrete foundation. There is a two-car garage metal panel door and a one-car metal panel door. The garage is sided in horizontal wood lap siding and corner boards.

312a. C 1210 Main Street, North c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Partial width front facing gable roof projecting entry porch is supported by wood box columns on a wood porch deck with concrete steps flanked by brick wing walls with cast stone caps. The gable of the porch has an arched opening. The façade is two-bays (D, W-tripled) with vinyl siding. The windows are 9/1 wood double-hung sash with a Craftsman window division pattern to them. The entry door is wood with nine lights, also in the Craftsman division pattern, with an outer metal and glass storm door. The eaves are boxed.

312b. C Garage c 1945
One-story, wood frame garage with a front facing gable roof of corrugated metal panels on a concrete foundation. The garage is sided in horizontal wood lap siding and corner boards. The single car garage door is metal with horizontal panels and two lights in one of the panels.

313. C 1211 Main Street, North c 1915
One-story, wood frame residence with a hip roof of composition shingles on a painted brick pier foundation with lattice infill. Full width hip roof projecting entry porch and carport supported by wood box columns on brick piers with cast stone caps. The porch is screened and the deck is concrete with concrete steps. The carport opening is filled with lattice panels. The façade is four-bays (W, D, D, W) with horizontal wood lap siding and corner boards. The windows are 4/4 wood double-hung sash and the doors are both wood slabs with diamond upper lights. Exposed rafter tips are visible.

314. C 1213 Main Street, North c 1940
One-story, wood frame residence with a side facing gable-on-hip roof of asphalt shingles on a stucco foundation. There is a concrete stoop for the entry which has a pilaster surround with no pediment. The façade is six-bays (D, W-paired, D, W, D, W-tripled) and is stuccoed. The windows are 6/1 wood double-hung sash. The doors are all different with the left one being metal clad wood with six projecting panels, the middle is wood with six projecting panels, and the right one is wood and Queen Anne in style with colored glass light over a single projecting panel. There is an exterior side chimney also covered in stucco. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 95 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

315a. C 1214 Main Street, North c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation. Full width wrap around porch supported by full height brick columns on a wood porch deck with concrete steps flanked by brick wing walls with cast stone caps. The façade is four-bays (W, D, W, W) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash with applied louvered shutters and the entry door is wood with nine lights over a panel flanked by sidelights with six lights sidelights and a matching transom. The door, sidelights, and transom all have the same light division pattern of small upper and lower lights with elongated middle lights. In the gable is a paired 3/1 wood double-hung sash window with applied louvered shutters and a wood triangular louvered vent above the windows. Exposed rafter tips are visible.

315b. NC Carport c 1970
One-story, carport with front facing gable roof of corrugated metal panels supported by wood posts on a concrete slab. The sides are covered in corrugated metal panels. The gable is open except for two wood cross braces.

316a. C 1218 Main Street, North c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch supported by wood posts on a wood porch deck with concrete steps flanked by brick wing walls with cast stone caps. The façade is three-bays (W-paired, D, W-paired) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash and the front door is wood and Craftsman in style with three vertical upper lights over a single recessed panel. Exposed rafter tips are visible.

316b. C Garage c 1945
One-story, wood frame garage with a front facing gable roof of meal panels on a concrete foundation. There is one off-center cased opening for a car and the garage is sided in horizontal wood lap siding and corner boards. There is shed roof carport addition on the right side supported by wood posts.

317a. C 1224 Main Street, North c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with wood panels. Partial width hip roof projecting screened entry porch supported by wood box columns on half height brick piers with cast stone caps. A pent metal awning surrounds the porch. The façade is three-bays (W-paired, D, W-paired) with thin strip horizontal wood lap siding and corner boards. The windows are 9/1 wood double-hung sash with a Craftsman style division to the lights in the upper sash and applied louvered shutters. The entry door is wood with eight upper lights over a panel. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 96 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

317b. NC Garage c 1970
One-story, wood frame garage with a shed roof of metal panels with chamfered openings and sided in horizontal wood lap siding and corner boards.

317c. NC Outbuilding c 1970
One-story, wood frame outbuilding with a front facing gable roof of metal panels. The outbuilding is sided in wood panels and there is a wood door with five recessed panels.

Martin Luther King Street

318. C 104 Martin Luther King Street c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation with metal vents. Partial width projecting front facing gable roof entry porch supported by a decorative metal post on a concrete stoop with brick steps. The façade is four-bays (W, D, W-tripled, W) and sided in vinyl. The windows are 6/6 wood double-hung sash with applied louvered shutters and the tripled window has a picture window flanked by 6/6 wood double-hung sash windows. The door is wood with six lights over four recessed panels and has an outer metal and glass storm door. There is a rectangular vent in the gable covered with vinyl. The eaves are boxed.

Meadowood Street

319. NC 900 Meadowood Street c 1965 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with vents. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with brick steps. The façade is six-bays (W, W, W, D, W, Carport). The windows are two part sliders except for the one to the left of the door which is a picture window. The entry door is wood with two upper lights over four recessed panels and an outer metal and glass storm door. The carport is supported by a brick wall. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 97

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Oak Street

320. C 804 Oak Street c. 1950

Two-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick foundation. The façade on the first floor is three-bays (Garage Door, D, W-tripled) and is sided in horizontal wood lap siding with no corner boards. There is a small projection which contains the garage door and entry door and has a flat roof with a horizontal roof balustrade. There is a small concrete entry stoop. The garage door is wood with eight recessed panels and eight lights. The entry door is wood slab with a nine light sidelight to the right with the door and the sidelight flanked by applied louvered shutters. The tripled window has 4/4 wood double-hung sash windows with a twenty light picture window between. The second story façade consists of two-bays (W-paired, W-tripled) and is sided in vertical panels above the horizontal wood lap siding which stops at the window sills. The paired window unit is made up of two 8/8 wood double-hung sash windows with applied louvered shutters and the tripled window matches the one below it on the first story façade. The projecting eaves have exposed rafter tips.

321. C 810 Oak Street c 1940

One-story, wood frame residence with a side facing gable roof of composite shingles on a brick pier foundation with brick infill and brick infill in a lattice pattern. The façade is three-bays (W-paired, D, W-tripled) with thin strip horizontal wood lap siding with corner boards. The paired window is 1/1 wood double-hung sash and the tripled window is covered with fixed Bermuda style louvered shutters. The entry door is in a slight projection with a front facing gable roof with a small arched vent in the gable. The door is wood with six recessed panels. Above the door is a copper metal awning supported by poles over a concrete entry stoop with concrete steps and metal railings. The eaves are boxed.

322. C 814 Oak Street c 1920

One-story, wood frame residence with a hip roof of asphalt shingles on a brick pier foundation with brick infill. Undercut full-width front porch supported by wood box columns with simplified capitals and a square balustrade all on a wood porch deck with concrete steps. The façade is four-bays (W, D, W, W) with horizontal wood lap siding with corner boards. Windows are 1/1 wood double-hung sash and the entry door is Queen Anne in style with a single light over an embellished panel and a triangular blind transom. There is a large front facing gable dormer with a round metal louvered vent. The eaves are boxed. One interior brick chimney is visible.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 98 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

323. NC 816 Oak Street c 1930

One-story, wood frame former Craftsman Bungalow which has been substantially altered with a brick veneer addition on a brick foundation. Undercut partial-width entry porch with a front facing gable roof supported by a single wood box column on one-side and the brick addition wall other. The siding under the porch is horizontal wood lap siding. There is a wood porch deck and concrete steps. The façade is five-bays (W, W, W, W, D). The first window on the left is a 2/2 metal frame single-hung sash horizontally divided, the next window is a metal frame sliding window with three divisions, the next window is a 2/2 metal frame single-hung sash horizontally divided, and the last window on the right is a 9/1 wood double-hung sash window. The entry door is wood with twelve lights. There is a pent metal awning that encompasses the brick addition. The eaves are boxed.

324. C 907 Oak Street c 1925 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a cross-gable roof of asbestos shingles with tile ridge caps all on a brick pier foundation with brick infill. Partial-width front projecting entry porch supported by double tapered wood columns on a wood paneled base all on a wood porch deck with concrete steps flanked by painted brick low wing walls with cast stone caps. The façade is three-bays (W-tripled, D, W-tripled) with horizontal wood lap siding with corner boards. The windows are 6/6 wood double-hung sash and the entry door is wood with six recessed panels and surrounded by pilasters and an entablature. The two front facing gables each have rectangular wood louvered vents with the upper gable having two. The projecting eaves are supported by knee braces. There is a large wood board privacy fence that surrounds the front of the property.

325. C 911 Oak Street c 1935 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a cross-gable roof of asphalt shingles on a brick foundation. Front projecting and recessed partial width entry porch with a front facing gable roof supported by paired wood columns on high brick piers with cast stone caps. The porch deck is wood with concrete steps and a wood rail. The façade is four-bays (W-paired, D, W, W) with thin strip horizontal wood lap siding with corner boards. The windows are 3/1 wood double-hung sash. The front door is wood with three vertical lights over three horizontal recessed panels with an outer wood screen door with lower louvers. The two front facing gables both have vertical stucco panels. The projecting eaves have exposed rafter tips. There is a large brick privacy wall that surrounds the front of the property with an iron gate.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 99 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

326. C 919 Oak Street c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation. Partial width front facing gable roof porch supported by paired wood columns, with simplified capitals, on a wood porch deck with brick steps off of the side. The façade is four-bays (W-tripled, W, D, W) with thin strip horizontal wood lap siding with corner boards. The tripled window unit is made up of 8 light paired wood casement windows. The other windows are 9/1 wood double-hung sash in a Craftsman pattern with applied louvered shutters. The entry door is wood with nine lights in Craftsman division with all lights colored glass except for the large middle light. The door surround is tapered with a pediment. There is a carport with a side facing gable roof of asphalt shingles attached to the left side of the house supported by wood box columns. The projecting eaves are supported by knee braces. There is one internal brick chimney visible.

327. C 921 Oak Street c 1925 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. Partial width projecting entry porch with a front facing gable roof supported by full height brick columns on a wood porch deck with concrete steps. The façade is three-bays (W-paired, D, W-quintupled) with horizontal wood lap siding with corner boards. The windows are 6/1 wood double-hung sash with wood screens. The entry door is wood with nine lights over three horizontal recessed panels. The projecting eaves have exposed rafter tips. One external brick chimney visible.

Park Avenue

328. C 807 Park Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with lattice infill. Partial width front facing gable roof projecting entry porch is supported by wood posts on a wood porch deck with concrete steps. The façade is four-bays (W-paired, D, W-paired, W-tripled) with asbestos shingle siding. The windows are 3/1 wood double-hung sash. The entry door is a wood slab with a single upper light. Exposed rafter tips are visible. There is a pent metal roof carport attached to the left side of the house supported by metal poles.

329a. C 808 Park Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with metal panels. Partial width front facing gable roof projecting screened entry porch is supported by wood posts on a wood porch deck with concrete steps. There is a rectangular wood louvered vent in the gable and a pent awning surrounding the porch. The façade is three-bays (W-paired, D, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash with applied louvered shutters. The entry door is a wood slab. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 100

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

329b. C Garage c 1950

One-story, wood frame garage with a front facing gable roof of metal panels. There is a one-car cased opening with a horizontal metal panel garage door. The garage is sided in horizontal wood Dutch lap siding and corner boards

330. C 809 Park Avenue c 1940 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Partial width front facing gable roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) with vinyl siding. The windows are 1/1 wood double-hung sash with applied louvered shutters and the entry door is a wood slab. There is a side facing gable roof carport attached to the left side of the house and supported by metal poles. The eaves are boxed.

331. C 811 Park Avenue c 1955

One-story, wood frame residence with a double front facing gable roof of asphalt shingles on a concrete foundation. Undercut entry porch is supported by decorative metal posts on a concrete slab. The façade is three-bays (W-tripled, W, Carport) with brick wainscoting on the front with asbestos shingle siding above and on the rest of the house. The windows are three light metal frame awning windows. The carport is also supported by decorative metal posts. The entry door faces the side and is a wood slab door with three stepped lights. There are triangular louvered vents in the gables. The eaves are boxed.

332. NC 813 Park Avenue c 1945

One-story, wood frame altered Craftsman Bungalow with a front facing clipped gable roof of metal panels on a foundation covered with vinyl panels. Undercut entry porch is supported by turned columns on a wood porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) and is sided in vinyl. The windows are 6/6 metal frame single-hung sash with applied louvered shutters. The entry door is metal clad wood with an arched center leaded light surrounded by raised panels. There is a rectangular louvered vent in the gable. The eaves are boxed. The original Craftsman character of the house has been diminished by the replacement of the doors, windows, siding, roof, and porch supports with new materials.

333. C 815 Park Avenue c 1950

One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick foundation. Slight roof projection over the concrete entry stoop and step. The façade is three-bays (W-paired, D, W-paired) with brick veneer wainscoting with angled sills and asbestos shingle siding above. The windows are 6/6 wood double-hung sash with pent metal awnings. The entry door is metal clad wood with six projecting panels. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 101 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

334. C 816 Park Avenue c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation. The façade is five-bays (W, W, W, D, Garage Door). The windows are two-part metal frame sliders. The entry door is metal clad wood with six projecting panels with an outer metal security door. The garage door is metal with sixteen projecting panels. The eaves are boxed.

335. C 817 Park Avenue c 1955
One-story, wood frame Ranch with a hip roof of asphalt shingles on a brick foundation. Undercut entry porch and carport supported by decorative metal posts. The façade is four-bays (W, W, W-tripled, D) with brick wainscoting with angled sills and asbestos shingle siding above. The windows are all metal frame and from left to right are a four light awning unit, two-light awning unit, and a picture window flanked by four-light awning windows. The entry door is wood with six recessed panels. The eaves are boxed.

336. C 900 Park Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with brick lattice infill. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps and sloped brick wing walls. The façade is three-bays (W-paired, D, W-paired) with horizontal wood Dutch lap siding and corner boards. The windows are 6/6 wood double-hung sash and the entry door is wood with nine lights over three horizontal recessed panels and an outer wood screen door. There is a triangular louvered vent in the upper gable. Exposed rafter tips are visible. A shed roof carport is attached to the left side of the house and supported by metal poles.

337. NC 904 Park Avenue c 1935
One-story, wood frame altered Craftsman Bungalow with a front facing clipped gable roof of asphalt shingles on a concrete foundation. Partial width front facing clipped gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps flanked by brick wing walls with cast stone caps. The façade is three-bays (W, D, W-paired) and sided in vinyl. The windows are 2/2 metal frame single-hung sash with applied louvered shutters. The entry door is metal clad wood with a fan light over four projecting panels. Exposed rafter tips are visible. The original Craftsman character of the house has been diminished by the replacement of the door, windows, and siding with new materials.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 102

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

338a. C 905 Park Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation. The partial width front facing gable roof projecting entry porch has been enclosed with wood siding and windows although the original wood post columns on half height brick piers with cast stone caps remain. There are rectangular louvered vents in the gables. The facade is four-bays (W, W, D, W) with asbestos shingle siding. The two windows to the left of the door are 4/4 metal frame single-hung sash and the other window is a 3/1 wood double-hung sash window. The entry door is wood with five recessed horizontal panels. Exposed rafter tips are visible.

338b. C Garage c 1950
One-story, wood frame garage with a front facing gable roof of metal panels with a carport addition to the front supported by wood posts. The garage is sided in wood panels.

339a. C 906 Park Avenue c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete deck. The roof of the flat roof carport addition extends to the entry porch and is also supported by decorative metal posts. The facade is three-bays (W, D, W-paired) with asbestos shingle siding. The windows are 4/1 wood double-hung sash and the entry door is wood with three vertical lights over three horizontal recessed panels. Exposed rafter tips are visible.

339b. C Garage c 1940
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. There are two doors, a two panel wood door for pedestrians, and the other a double-leaf wood barn door for a car. The garage is sided in asbestos shingles.

340a. NC 907 Park Avenue c 1980
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a brick foundation. The facade is five-bays (W, W, D, W, W) and sided in vinyl. The windows are 6/6 metal frame single-hung sash and the entry door is metal clad wood with an oval leaded light over two projecting panels. A shed roof carport supported by metal poles is attached to the left side of the house. The eaves are boxed.

340b. C Outbuilding c 1945
One-story, wood frame outbuilding with a front facing gable roof of asphalt shingles on a brick foundation. Undercut entry porch supported by wood posts on a concrete deck. The facade is two-bays (D, D) with asbestos shingles. The doors are double-leaf wood. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 103 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

341. C 908 Park Avenue c 1945 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 6/6 wood double-hung sash with applied louvered shutters and the entry door is wood with six recessed panels. The eaves are boxed.

342. C 909 Park Avenue c 1955 Ranch
One-story, wood frame Ranch with a hip roof of asphalt shingles on a brick foundation. Partial width hip roof projecting entry porch is supported by decorative metal posts on a concrete deck. Façade is five-bays (Carport, D, W, W, W). The windows are all steel casements and from left to right are sixteen lights, eight lights, and twelve lights. The entry door is wood with three stepped lights with an outer metal and glass storm door. The carport is supported by decorative metal posts on a low brick wall with cast stone cap. The eaves are boxed.

343. C 910 Park Avenue c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of metal panels on a brick pier foundation. Full width undercut entry porch is supported by wood box columns. A large wooden board fence surrounds the front of the house making it difficult to see the details. The façade is three-bays (W, D, W) with thin strip horizontal wood lap siding and corner boards. If the front windows match the side windows they are 9/6 wood double-hung sash. The entry door is not visible behind a wood screen door. There is a triangular louvered vent in the gable. Exposed rafter tips are visible.

344. NC 911 Park Avenue c 1965 Ranch
One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Slight roof projection for the entry is supported by decorative metal posts on a concrete deck. The façade is four-bays (W, W-tripled, D, W-paired). The windows are 1/1 metal frame single-hung sash with the tripled window having a center picture window flanked by 1/1 windows. All of the windows have applied paneled shutters. The entry door is wood with an oval leaded light and an outer metal and glass storm door. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 104

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

345. C 912 Park Avenue c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation. Partial width undercut entry porch is supported by wood posts on a wood porch deck with concrete steps. There is a rectangular wood louvered vent in the gable. The façade is two-bays (W-paired, W) with horizontal wood lap siding and corner boards. The windows are 2/2 wood double-hung sash horizontally divided. The entry door faces the side and is wood with three vertical lights over three recessed horizontal panels. Exposed rafter tips are visible. There is a shed roof carport attached to the rear right side supported by wood posts.
346. C 914 Park Avenue c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with metal panels. Full width undercut entry porch is supported by wood box columns on a wood porch deck with concrete steps flanked by brick wing walls with cast stone caps. A shed asbestos shingle roof surrounds the entry porch. The façade is two-bays (W, D) and sided in vinyl. The window is a 3/1 wood double-hung sash window and the entry door is metal clad wood with a leaded glass light. There is a flat roof carport attached to the right side of the house and supported by metal poles. The eaves are boxed.
347. NC 915 Park Avenue c 1960 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation. Concrete entry stoop with concrete steps and metal rail. The façade is five-bays (Carport, W-tripled, D, W, W). The windows are three light metal frame awning windows and the tripled window has a picture window between the metal frame awning windows. The entry door is wood with six recessed panels. The carport is supported by metal poles on low brick walls with cast stone caps. The eaves are boxed.
348. C 916 Park Avenue c 1955 Minimal Traditional
One-story, wood frame Minimal Traditional with a cross-gable roof of asphalt shingles on a painted brick foundation with vents. Undercut entry porch supported by a wood post on a concrete deck with concrete steps. The façade is four-bays (Garage, W-paired, D, W). The paired window is made up of 2/2 metal frame single-hung sash horizontally divided windows and the other window is a 2/2 wood double-hung sash horizontally divided. The garage is open with no door. The entry door is metal clad wood with six projecting panels. The windows have applied louvered shutters. There is a rectangular louvered vent in the front facing gable. The eaves are boxed.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 105 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

349. NC 917 Park Avenue c 1965

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Slight roof projection for the entry and carport both supported by decorative metal posts on a concrete porch deck. The façade is five-bays (W, W, D, W-paired, Carport). The windows are 1/1 metal frame single-hung sash with applied louvered shutters. The entry door is metal clad wood with nine lights over two projecting panels. The eaves are boxed.

350. C 918 Park Avenue c 1940 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width front facing gable roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. The façade is five-bays (W, W, D, W, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the entry door is a wood slab with a diamond upper light and an outer metal and glass storm door. The eaves are boxed.

351. NC 920 Park Avenue c 1965 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood Tuscan columns on a brick porch deck with brick steps. The façade is four-bays (W, W-paired, D, W). The windows are 2/2 metal frame single-hung sash with applied louvered shutters. The entry door is wood with two lights over four recessed panels with an outer metal and glass storm door. There is vinyl siding in the gable of the porch. The eaves are boxed.

352. C 1000 Park Avenue c 1955 Ranch

One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation. Partial width undercut entry porch with no supports over a over a concrete deck. The façade is three-bays (W, D W). The windows are 2/2 wood double-hung sash horizontally divided. The entry door is a wood slab with an outer metal screen door. There is a brick lattice screen visible from the front façade with the carport behind the screen. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 106 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

353. C 1001 Park Avenue 1957 Modern
First Assembly of God Church

One-story, brick veneer Modern style church with two front facing gable roof projections and a side facing gable roof connection between the two with a side facing gable roof wing on the side of the lower front facing gable roof projection. The roof is asphalt shingles. Both front facing gable roof projections have large angled overhanging eaves. The flat roof entry porch is closest to the higher front facing gable roof projection. The façade is nine-bays (W, D, W, W, W, W, W, W, D) The windows are all single light colored ripple glass in metal frames. The door on the left is a wood slab, and the other door is double-leaf aluminum frame commercial glass storefront door with glass sidelights, which is the main entry door. The eaves are boxed and the main sanctuary has exposed rafter tips visible. [Photo #23]

354. C 1002 Park Avenue c 1940 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a brick pier foundation with brick infill. Full width undercut entry porch is supported by wood box columns on a wood porch deck with concrete steps. The façade is six-bays (W, W, D, D, W, W) with thin strip horizontal wood lap siding and corner boards. The windows are 1/1 wood double-hung sash and the doors are wood with six recessed panels and outer metal and glass storm door. The eaves are boxed. There is one internal brick chimney visible.

355. NC 1004 Park Avenue c 1960 Ranch

One-story, wood frame Ranch with a side facing gable roof of composition shingles on a covered foundation. Partial width shed roof projecting entry porch is supported by fluted metal columns on a carpeted porch deck with carpeted steps. The façade is four-bays (W-paired, W-tripled, D, W-paired) and is sided in vinyl. The windows are 6/6 metal frame single-hung sash and the entry door is wood with an oval leaded light.

356a. C 1008 Park Avenue c 1950 Minimal Traditional

One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Concrete entry stoop with concrete steps. The façade is four-bays (W, W, D, W) with asbestos shingle siding. The windows are 6/6 wood double-hung sash. There is a gable over the two left windows and the door with a rectangular louvered vent.

356b. NC Outbuilding c 1970

One-story, concrete block outbuilding with a side facing gable roof of asphalt shingles on a concrete block foundation. The façade is two-bays (W, D). The window is a three light metal frame awning window and the door is wood with six recessed panels. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 107 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

357. NC 1100 Park Avenue c 1965

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Undercut entry porch with no supports over a concrete deck. The façade is five-bays (W, W, D, W-paired, W). The windows are 2/2 metal frame single-hung sash horizontally divided except for the paired unit which is made up of two 3/2 metal frame single-hung sash horizontally divided. The entry door is a wood slab. It appears that the carport has been enclosed with brick wainscoting with horizontal wood lap siding above. The eaves are boxed.

358. C 1101 Park Avenue c 1945

Two-story, wood frame Craftsman Bungalow garage/apartment with a front facing gable roof of asphalt shingles on a stucco foundation. The building is sided in stucco. The first floor is three-bays (Garage Door, Garage Door, D) and the second floor is two-bays (W, W). The garage doors are both single panel double-leaf barn doors and the other door is a metal clad wood door with six projecting panels and has a concrete entry stoop. The windows are 3/1 wood double-hung sash with applied louvered shutters. There is a triangular louvered vent in the gable.

359. C 1101 1/2 Park Avenue c 1940

One-story, wood frame residence with a side facing gable roof of asphalt shingles on a concrete foundation. Full width shed roof projecting screened entry porch supported by wood posts on a wood porch deck with concrete steps and wood paneling forming a low wall. The façade is three-bays (W-paired, D, W-paired) with asbestos shingle siding. The windows are 1/1 wood double-hung sash and the entry door is wood with nine lights. The eaves are boxed.

360. C 1102 Park Avenue c 1955

One-story, brick veneer residence with a hip on hip roof of asphalt shingles on a brick foundation with metal vents. Undercut entry porch is supported by a decorative metal post on a concrete deck with concrete steps. The façade is four-bays (W-paired, D, W, Garage door). The paired window is made up of two 2/2 wood double-hung sash windows horizontally divided. The other window is a twelve light picture window. Both windows have angled brick sills. The entry door is a wood slab with a diamond upper light and an outer wood screen door. The garage door is metal with sixteen projecting panels. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 108 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

361. C 1103 Park Avenue c 1945

One-story, wood frame, possibly former commercial building turned residence with a side facing gable roof of asphalt shingles on a concrete foundation. The façade is four-bays (W, D-paired, W, W) with a wainscot of cedar shakes and horizontal wood Dutch lap siding above. The two outer windows are three light metal frame awning windows and the other window is a four part jalousie window with applied louvered shutters. The entry doors are wood with three vertical lights over three recessed horizontal panels. The eaves are boxed. The proximity of the building to the street, the double doors and the windows suggest that this building might have been a neighborhood store.

362. C 1103 ½ Park Avenue c 1945

Two-story, wood frame garage/apartment with a front facing gable roof of asphalt shingles on a concrete foundation. The building is sided in asbestos shingles. The first floor is two-bays (Garage Door, Garage Door) and the second floor is two-bays (W, W). The garage doors are both single panel double-leaf barn doors. The windows are 1/1 wood double-hung sash with applied louvered shutters and pent metal awnings. The entry is on the side under a projecting entry porch supported by metal poles. There is a small triangular louvered vent in the gable and the eaves are boxed.

363. C 1104 Park Avenue c 1945 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Cantilevered front facing gable roof entry porch is supported by knee braces over a concrete stoop and steps. The façade is four-bays (W-paired, D, W-paired, W-paired) with vinyl siding. The windows are 3/1 wood double-hung sash and the entry door is wood with a center light surrounded by eight recessed panels. There is an outer metal and glass storm door. The eaves are boxed.

364. NC 1104 A Park Avenue c 1970 Ranch

One-story, brick veneer Ranch with side facing gable roof of asphalt shingles on a brick foundation. Partial width undercut entry porch is supported by brick columns on a concrete deck. The façade is five-bays (W, W, D, W-paired, Carport). The windows are 6/6 metal frame single-hung sash with applied louvered shutters and the entry door is metal clad wood with six projecting panels. The carport is supported by brick columns. The eaves are boxed.

365. C 1105 A&B Park Avenue c 1945 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow duplex with a front facing gable roof of asphalt shingles on a brick pier and concrete block foundation. Partial width front facing gable roof projecting screened entry porch is supported by wood box columns on a wood porch deck with concrete steps with metal railings. A pent metal awning wraps around the porch. There is a triangular louvered vent in the gable of the porch. The façade is four-bays (W, D, D, W) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the doors are both wood slabs. Exposed rafter tips are visible.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7

Page: 109

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

366a. C 1106 Park Avenue c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of metal panels on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood posts with brackets on a concrete porch deck with concrete steps and a square wood balustrade between the columns. A triangular louvered vent is located in the gable of the porch. The façade is four-bays (W, W-paired, D, W) with vinyl siding. The windows are 4/1 wood double-hung sash with applied paneled shutters. The entry door is wood with a leaded glass light and an outer metal and glass storm door. Exposed rafter tips are visible.

366b. C Outbuilding/Carport c 1950
One-story, concrete block outbuilding with a carport attached to the front under a front facing gable roof of metal panels. The gable is sided in horizontal wood lap siding and corner boards. Exposed rafter tips are visible. There is a wood door to the outbuilding.

367. C 1107 Park Avenue c 1955 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of metal panels on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by wood box columns on a concrete deck with concrete steps. There is a triangular louvered vent in the gable of the porch. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters and the entry door is wood with two lights over four recessed panels. The eaves are boxed. A shed roof carport attached to the left side of the house is supported by metal poles.

368. NC 1109 Park Avenue c 1960
One-story, wood frame residence with a side facing gable roof of asphalt shingles on a foundation covered with metal panels. Partial width front facing gable roof projecting entry porch is supported by wood porch deck on a concrete deck with concrete steps and wood railings. The façade is four-bays (W, W, D, W) and sided in vinyl. The windows are 6/6 metal frame single-hung sash with applied lattice shutters. The entry door is wood with two upper lights and four recessed panels. The eaves are boxed.

369. C 1110 Park Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width front facing gable roof projecting entry porch is supported by metal fluted columns on a concrete porch deck with concrete steps. The façade is four-bays (W-paired, D, W-paired, W) with asbestos shingle siding. The windows are 6/6 metal frame single-hung sash with applied paneled shutters. The entry door is wood with six lights over two recessed vertical panels. The eaves are boxed.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 110

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

370. C 1111 Park Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by decorative metal posts on a concrete porch deck with concrete steps. There is a triangular louvered vent in the gable of the porch. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash and the window not under the porch has a pent metal awning. The entry door is metal clad wood with six projecting panels with an outer metal and glass storm door. The eaves are boxed. A side facing gable roof carport is attached to the rear right side of the house and is supported by wood posts with lattice panels between.

371. C 1112 Park Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Partial width shed roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) with asbestos shingle siding. The windows are 6/6 metal frame single-hung sash with applied louvered shutters. The entry door is wood with six recessed panels with an outer metal and glass storm door. The eaves are boxed. A shed roof carport is attached to the right side of the house and is supported by metal poles.

372. C 1113 Park Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width front facing gable roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps and a square wood balustrade between the posts. There is a triangular louvered vent in the gable of the porch. The façade is four-bays (Carport, W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters and the entry door is wood with six recessed panels with an outer metal and glass storm door. The carport is supported by decorative metal posts. The eaves are boxed.

373. C 1115 Park Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a painted brick foundation. Small partial width front facing gable roof projecting entry porch is supported by wood posts on a concrete porch deck with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 1/1 metal frame single-hung sash with applied louvered shutters and the entry door is a wood slab door with an outer metal screen door. The eaves are boxed.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 111 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

- 374a. C 1117 Park Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. Partial width front facing gable roof projecting entry porch is supported by fluted metal columns on a concrete porch deck with concrete steps. The façade is four-bays (W, W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash with applied louvered shutters. The entry door is wood with six recessed panels and an outer metal and glass storm door. The eaves are boxed. A shed roof carport is attached to the right side of the house and is supported by metal poles.
- 374b. C Garage c 1950
One-story, wood frame garage with a front facing gable roof of asphalt shingles on a concrete foundation. There is a cased chamfered opening for one-car. The garage is sided in asbestos shingles.
375. NC 1200 Park Avenue c 1965 Ranch
One-story, wood frame L-shaped Ranch with a cross-gable roof of asphalt shingles on a brick foundation. Partial width shed roof projecting entry porch is supported by metal fluted columns on a brick deck with brick steps. The façade is four-bays (W-paired, D, W, W) with brick veneer siding under the entry porch and the rest of the house sided in asbestos shingles. The windows are 6/6 metal frame single-hung sash and the ones not under the entry porch have applied louvered shutters. There is a large exterior stepped brick chimney on the front of gabled portion of the house. The eaves are boxed. A side facing gable roof carport is attached to the right side of the house and is supported by wood posts with lattice panels between.
- 376a. C 1201 Park Avenue c 1935 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of metal panels on a brick pier foundation with concrete block infill. Partial width hip roof projecting entry porch is supported by wood box columns on a wood porch deck with concrete steps. The façade is four-bays (W-tripled, W-paired, D, W) with thin strip horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash and the entry door is metal clad wood with six projecting panels. There is a paired window unit in the gable with 3/1 wood double-hung sash windows. Above those windows is a triangular louvered vent. The eaves are boxed.
- 376b. C Storage Building c 1950
One-story, wood frame side facing gable roof storage building with an asphalt shingle roof. The building has board-and-batten siding. The entry door faces the side.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7

Page: 112

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

377. NC 1203 Park Avenue c 1965

Two-story, wood frame apartment building with a side facing gable roof of asphalt shingles on a brick foundation. Full width shed roof two-story projecting entry porch and gallery supported by metal poles on the first story and wood post on the second. Central wood stairs spilt at a mid-height landing with a set of stairs leading to each side of the second floor. The façade on both floors is (W, D, W, W, D, W) and has brick veneer on the first floor and horizontal wood lap siding and corner boards on the second. The windows are two-part metal frame sliders. The doors are metal clad wood with nine lights over two projecting panels. The eaves are boxed.

378. NC 1204 Park Avenue c 1935

One-story, wood frame altered Craftsman Bungalow with a side facing gable roof on one end and a hip on the other. Partial width front facing gable roof projecting entry porch is supported by wood box columns on a concrete deck. There is a rectangular louvered vent in the gable of the porch with has board-and-batten siding. The façade is three-bays (W-paired, D, W-tripled) and sided in stucco. The window are 3/1 wood double-hung sash with applied louvered shutters and the entry door is a wood slab. Both the front facing gable of the porch and the side facing gable have large overhanging eaves tapered from top to bottom. The eaves are boxed. A shed roof carport is attached to the left side of the house and is supported by metal poles. The alteration of the roof and porch has diminished the Craftsman character of the house.

379. NC 1205 Park Avenue c 1965

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Front brick entry stoop with brick steps. There is slight gable front projection to the left of the entry stoop. The façade is four-bays (W, D, W-paired, W). The windows are 2/2 metal frame single-hung sash horizontally divided with board shutters. The entry door is wood with an oval leaded glass light. A shed roof carport is attached to the right side of the house and is supported by brick columns. The eaves are boxed.

380. C 1206 Park Avenue c 1955 Minimal Traditional

One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a painted brick foundation with metal vents. There is a slight roof projection over the entry which terminates at the end of the house to an undercut porch supported by wood box columns on a concrete porch deck with concrete steps. The façade is four-bays (W, D, W, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash. The main entry door on the left is metal clad wood with six projecting panels and the door under the porch is metal clad wood with nine lights over two projecting panels. Both doors have outer metal screen doors.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 113 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

381. NC 1207 Park Avenue c 1965 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is a slight projection of the roof for the entry porch over a concrete deck and supported by brick columns. The façade is four-bays (W-paired, D, W, W). The windows are 6/6 metal frame single-hung sash. The entry door is wood with six recessed panels and an outer metal and glass storm door. The eaves are boxed. A front facing gable roof carport is attached to the front left side of the façade and is supported by wood posts.

382. NC 1211 Park Avenue c 1965 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Concrete entry stoop with concrete steps. The façade is three-bays (W-paired, D, W). The windows are 6/6 metal frame single-hung sash. The entry door is metal clad wood with six projecting panels and an outer metal security door. The eaves are boxed. A side facing gable roof carport is attached to the left side of the house and is supported by a paneled wall.

383. C 1213 Park Avenue c 1950 Minimal Traditional

One-story, wood frame Minimal Traditional with a cross-gable roof of asphalt shingles on a painted brick foundation. Undercut entry porch under the gable supported by a wood post on a concrete deck with concrete steps. The façade is three-bays (W, D, W) with asbestos shingle siding. The windows are 8/8 wood double-hung sash. The entry door is metal clad wood with a fanlight over four projecting panels and an outer metal and glass storm door. There is a triangular louvered vent in the gable and the eaves are boxed.

384. C 1215 Park Avenue c 1950 Minimal Traditional

One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. There is a gable over the entry door but no entry porch, just a concrete entry stoop with concrete steps. Façade is five-bays (Carport, W, D, W, D) with asbestos shingle siding. Windows are 8/8 wood double-hung sash. The middle entry door is wood with two lights over four recessed panels. The other door is located under the undercut porch to the right end of the house. That porch is supported by metal fluted columns. The two windows and the door not under the porch have pent metal awnings. The eaves are boxed. The carport is supported by metal fluted columns.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 114

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

385a. C 1217 Park Avenue c 1950 Minimal Traditional
One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation. The partial width front facing gable roof projecting entry porch has been enclosed with siding, windows and doors; however, the wood box columns remain. There is a triangular louvered vent in the gable of the enclosed porch and it has a surrounding pent metal awning. There are concrete entry steps to the door. The façade is four-bays (W, D, W, W) with horizontal wood Dutch lap siding and corner boards. The far left window is a 8/8 wood double-hung sash window and has a pent metal awning. The other two are 4/4 metal frame single-hung sash windows. The entry door is paneled. The eaves are boxed.

385b C Outbuilding/Carport c 1950
One-story, wood frame outbuilding and carport with a side facing gable roof of asphalt shingles on a concrete foundation. The façade is three-bays (W, D, Carport) with horizontal wood lap siding and corner boards. The window is wood with four lights. The door is wood with four recessed panels. The carport is supported by metal poles. Exposed rafter tips are visible.

386. C 1219 Park Avenue c 1950 Minimal Traditional
One-story, brick veneer Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation. Undercut entry porch under the gable supported by a wood box column on a concrete deck with concrete steps. The façade is four-bays (Porch, W-paired, D, W). The windows are 8/8 wood double-hung sash. The entry door is wood with a small center light surrounded by eight projecting panels with an outer metal and glass storm door. There is a triangular louvered vent in the gable which has asbestos shingle siding. The porch is supported by wood box columns on a concrete porch deck and is screened. The eaves are boxed. [Photo #24]

Peach Street

387. C 209 Peach Street c 1950
One-story, brick veneer residence with a hip on hip roof of asphalt shingles on a brick foundation. Small partial width hip roof cantilevered projecting entry porch supported by knee braces over a concrete stoop. The façade is five-bays (Carport, W, W, D, W). The outer windows on the façade are 8/8 wood double-hung sash with applied louvered shutters and the other window is 6/6 wood double-hung sash with applied louvered shutters. The entry door is a wood slab with a metal and glass storm door. The carport is supported by full height brick columns with cast stone caps. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 115 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Pope Street

388. NC 903 Pope Street c 1980
One-story, manufactured home turned with its gable end to the street on a concrete block foundation. The roof and siding are both made up of metal panels. The façade has a bay window with 6/6 metal frame single-hung sash windows. The entry door is on the side and is not visible.
389. NC 905 Pope Street c 1970 Ranch
One-story, wood frame Ranch with a side facing gable roof of metal panels on a concrete block pier foundation with lattice panels. There is a slight projection of the roof for the entry with no supports over a concrete entry stoop. The façade is four-bays (W, D, W, W) with board-and-batten siding. The window to the left of the door is a 9/6 metal frame single-hung sash window and the other two windows are 6/6 metal frame single-hung sash. All of the windows have applied paneled shutters. The entry door is metal clad wood with a four-division fanlight over four projecting panels. The eaves are boxed.
390. C 907 Pope Street c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation. A partial width front facing gable roof projecting entry porch is supported by knee braces over a concrete stoop. The façade is four-bays (W-paired, D, W-paired, W) with vinyl siding. The windows are 3/1 wood double-hung sash. The entry door is wood with three vertical lights over three horizontal recessed panels with an outer metal and glass storm door. Exposed rafter tips are visible.
391. C 908 Pope Street c 1955
One-story, wood frame residence with a gable-on-hip roof of asphalt shingles on a foundation covered with corrugated plastic panels. There is no entry porch; however, there is a wood deck attached to the front of the house with concrete steps. The façade is three-bays (W, D, W) with horizontal wood Dutch lap siding and corner boards. The windows are single light wood frame picture windows with applied louvered shutters. The entry door is wood with three horizontal lights over a single panel with an outer metal and glass storm door. The door is flanked by pilasters. The gable has board-and-batten siding and an octagonal louvered vent. There is a shed roof carport attached to the rear right side of the house supported by metal poles.
392. NC 911 Pope Street c 1970
One-story, wood frame residence with a side facing gable roof of metal panels on a concrete foundation. The façade is five-bays (Carport, W-paired, D, W-paired, Carport) with board-and-batten siding. The windows are 2/2 metal frame single-hung sash and the entry door is a wood slab with an outer metal and glass storm door. There is an interior brick chimney visible. The carport openings are partially enclosed by lattice panels. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7

Page: 116

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Rogers Street

393. C 802 Rogers Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with brick infill. Partial width gable front projecting entry porch supported by wood turned columns with a turned wood balustrade on a wood porch deck with concrete steps. There is a pent metal awning that wraps around the porch. The façade is three-bays (W-paired, D, W-paired) and sided in vinyl. The windows are 3/1 wood double-hung sash and the window not under the porch is covered with a pent metal awning. There is a shed roof carport attached to the rear of the house supported by metal poles. The eaves are boxed.
394. C 803 Rogers Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick foundation. The gable front projecting entry porch is supported by wood box columns on a brick porch deck with brick steps. The façade is three-bays (W-paired, D, W-paired) with horizontal Dutch lap siding. The windows are 3/1 wood double-hung sash and the entry door is wood with fifteen lights and a glass storm door. There is a shed roof carport attached to the left side of the house supported by metal poles. Exposed rafter tips are visible.
395. C 805 Rogers Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a brick pier foundation. Full width undercut porch is supported by wood posts on a wood porch deck. Façade is four-bays (W, D, D, W) with thin strip horizontal wood lap siding with corner boards. Windows are 3/1 wood double-hung sash and the left entry door is wood with three vertical lights over three recessed horizontal panels, the door on the right is a metal clad wood door with nine lights over two projecting vertical panels. Both doors have an outer metal and glass storm door. The eaves are boxed. There is a carport attached to the rear right side of the house with a shed roof supported by metal poles.
396. NC 806 Rogers Street c 1970
Two-story, concrete block residence with a side facing gable roof of asphalt shingles on a concrete block foundation. There is a full width front double gallery porch under the main roof supported by metal box columns with a mix of a metal panel balustrade and metal rail balustrade between the columns. The first floor façade is four-bays (W-paired, D, W, D) and the second floor façade is four-bays (W-paired, D, D, W). The windows on the first floor are 2/2 metal frame single-hung sash. The door on the left is a wood slab door and the other door is a six panel metal clad wood door. On the second floor the windows are 6/6 wood double-hung sash and the doors are wood with four lights over a panel.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 117 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

397. C 807 Rogers Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a brick pier foundation. Full width undercut porch is supported by wood posts on a wood porch deck. Façade is three-bays (D, D, W) with thin strip horizontal wood lap siding with corner boards. The window is a 3/1 wood double-hung sash and the entry doors are metal clad wood with six panels. Exposed rafter tips are visible. A wood handicap ramp has been attached to the front porch and has wood supports and rail.
398. C 808 Rogers Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a gable-on-hip roof of asphalt shingles on a brick pier foundation. Full width undercut porch supported by wood box columns with a square wood balustrade on a wood porch deck with concrete steps. Façade is four-bays (W, D, D, W) with horizontal HardiBoard siding with corner boards. Windows are 4/4 wood double-hung sash and the entry doors are wood with three vertical lights over three recessed horizontal panels. There is a triangular vent in the gable covered with lattice. The entry doors are wood with three vertical lights over three recessed horizontal panels; the door on the right is a metal clad wood door with nine lights over two projecting vertical panels. Both doors have an outer wood screen door with a projecting low panel. Exposed rafter tips are visible.
399. NC 811 Rogers Street c 1960
Temple Baptist Church
One-story, brick veneer L-shaped church with a cross-gable roof of asphalt shingles on a brick foundation. There is a gable front projecting entry porch supported by round metal fluted columns on a concrete deck attached to the front facing gable portion of the building. The façade is two-bays (D, D). The entry door under the entry porch is an aluminum and glass commercial door. On the side facing gable portion of the building there is also an entry porch with a flat roof supported by wood posts. The paired entry door is wood slab. The eaves are boxed.
400. NC 812 Rogers Street c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut front porch supported by decorative metal posts on a concrete porch deck with brick steps. The façade is four-bays (Carport, W-paired, D, W-tripled). The paired window is a 2/2 metal frame single-hung sash and the other window is a three part metal frame sliding window. The entry door is metal clad wood with an oval light with two projecting panels below. The carport is supported by decorative metal posts. The eaves are boxed.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 118 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

401. C 814 Rogers Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation with lattice panels. Partial width undercut screened entry porch supported by a wood box column on a brick pier with cast stone cap. The porch deck is wood with concrete steps. The façade is three-bays (W-paired, D, W) with thin strip horizontal wood lap siding with corner boards. The windows are 3/1 wood double-hung sash with the paired window having applied louvered shutters. The entry door is wood with three vertical lights over three horizontal recessed panels. There is a slight gable visible at the top of the roof for the portion of the house behind the side facing gable. Exposed rafter tips are visible. There is one internal brick chimney visible.

402. C 820 Rogers Street c 1925 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of composition shingles on a brick pier foundation. Full width undercut front porch supported by wood box columns with simplified capitals with a square balustrade between on a wood porch deck with concrete steps. The façade is five-bays (W, W, D, W, W) with horizontal wood lap siding and corner boards. The windows are 9/1 wood double-hung sash and the entry door is wood with nine lights over two vertical recessed panels and a two light transom above. There is a shed roof dormer with paired single light windows. Exposed rafter tips are visible. There is a carport attached to the rear left side of the house supported by wood box columns.

Royal Street

403. C 709 Royal Street c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asbestos shingles with ridge caps on a brick pier foundation with brick infill. Small front facing gable entry porch supported by knee braces over concrete steps with a low brick wing wall with cast stone caps. Façade is three-bays (W-paired, D, W-tripled) with thin-strip horizontal wood lap siding and corner boards. The paired windows are 3/1 wood double-hung sash and the tripled window unit has two outer 1/1 wood double-hung sash with a picture window in between. The entry door is a modern metal clad wood door with a leaded glass oval light over two projecting vertical panels. Exposed rafter tips are visible. There is a carport addition to the rear left side of the house with a shed roof and supported by metal poles.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 119 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

404a. C 711 Royal Street c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick pier foundation with lattice panels. There is a full width undercut entry porch supported by full height brick columns at the ends and two wood box columns in the middle, all on a wood porch deck with concrete steps with low brick wing walls with cast stone caps. The façade is three-bays (W, D, W) with horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash and the entry door is wood with fifteen lights. There is rectangular wood louvered vent in the gable. Exposed rafter tips are visible.

404b. C Outbuilding c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with front facing gable roof of asphalt shingles on a brick pier foundation with lattice panels. There is a small cantilevered projecting front facing gable roof entry porch supported by knee braces over concrete steps. The façade is three-bays (W, D, W) with horizontal wood lap siding and corner boards. The windows are 3/1 wood double-hung sash and the entry door is not visible.

404c. C Outbuilding c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a side facing gable roof of asphalt shingles on a brick pier foundation. There is slight roof projection over the entry and concrete steps. The façade is three-bays (W, D, W-paired) with Dutch lap horizontal wood siding and corner boards. The windows are 3/1 wood double-hung sash with applied louvered shutters and the entry door is wood with three vertical lights over three recessed horizontal panels. Exposed rafter tips are visible.

405. NC 713 Royal Street c 1945 Craftsman Bungalow
One-story, wood frame altered Craftsman Bungalow with front facing gable roof of asphalt shingles on a brick pier foundation with brick lattice infill. There is a full width undercut entry porch supported by wood posts on a concrete deck with concrete steps. The façade is three-bays (W, D, W) with horizontal wood lap siding and corner boards. The windows are 3/2 metal frame single-hung sash horizontally divided and the entry door is metal clad wood with six projecting panels. In the gable is rectangular wood louvered vent. Exposed rafter tips are visible. The form of the Craftsman Bungalow style remains however the windows, door, porch deck, and columns are all modern replacements. There is a shed roof carport addition to the rear left side of the house supported by wood posts with lattice panels in between.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 120

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

West Avenue

406. NC 806 West Avenue c 1960 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. There is a concrete entry stoop with concrete steps and decorative metal railing. The façade is five-bays (W-paired, D, W-paired, W, Carport). The paired window on the left is a four light metal frame awning window and the others are three light metal frame awnings. All of the windows have angled brick sills and applied louvered shutters. The entry door is wood with two lights over four recessed panels with an outer glass storm door. The carport is supported by decorative metal posts. The eaves are boxed.

407. NC 810 West Avenue c 1910

One-story, wood frame L-shaped Queen Anne, which has been heavily modified, with a cross-gable roof of asphalt shingles on a brick foundation. Front projecting partial width shed roof entry porch supported by replacement turned columns with a turned balustrade on a concrete deck with concrete steps. The façade is five-bays (W, W, W, D, W) and is a combination of brick veneer over the original siding and paneled siding, also not original. The windows are replacement 6/6 metal frame single-hung sash and the new entry door is metal clad wood with a single light over two projecting panels. The front facing gable has a pent roof and retains the original wood lap siding along with a 3/1 wood double-hung sash window. Underneath the pent of the gable the corners of the projection are chamfered. The eaves are boxed. There is a large two-story rear addition with a double gallery supported by metal poles and wood box columns. Also to the rear is a small free-standing carport supported by metal poles. The changes to the siding, windows, door, and porch have diminished the Queen Anne character of the house.

408a. C 811 West Avenue c 1910 Queen Anne

One-story, wood frame Queen Anne with a gable-on-hip roof of metal panels on a concrete block foundation. Partial width front projecting entry porch with a hip roof of metal panels supported by wood box columns. The façade is six-bays (W, W, W, D, W, W) with thin strip horizontal wood lap siding and corner boards. The windows to the left of the entry door are 4/4 wood double-hung sash and the other windows are 3/1 wood double-hung sash. The entry door is wood with three vertical lights over three horizontal recessed panels with a single light transom above flanked by sidelights with three lights over a single projecting panel. The front facing gable projection has chamfered corners under the pent of the gable with brackets. The gable has a wood louvered vent and decorative cut bargeboard. The eaves are boxed.

408b. C Outbuilding c 1940

One-story, wood frame outbuilding with a front facing gable roof of metal panels on a concrete foundation. The façade is four-bays (W, D, W, W) with a combination of stucco and board-and-batten siding. The windows are 3/1 wood double-hung sash and the entry door is wood with three vertical lights over three recessed panels.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 121 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

408c. NC Outbuilding c 1980

One-story, wood frame outbuilding with a side facing gable roof of metal panels on a concrete block foundation. The façade is two-bays (W, W) with paneling. The windows are four light fixed wood frame windows. The entry door is on the side of the building.

408d. NC Outbuilding/Barn c 1970

One-story, wood frame barn type structure with a side facing gable roof of corrugated metal panels on a concrete foundation. The façade is covered in metal panels.

409. C 815 West Avenue c 1925 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a hip on hip roof of asphalt shingles on a brick pier foundation with concrete block infill. There are two entry stoops each with concrete steps and a pent metal awning above. The façade is seven-bays (W-paired, D, W, W, W, W, D) and is combination of thin strip horizontal wood lap siding and Dutch lap horizontal wood lap siding both with corner boards. The paired window unit is made up of 3/1 wood double-hung sash windows and the rest of the windows are 1/1 wood double-hung sash. The entry doors are wood with a single light over three recessed panels and the one on the right has a metal screen door. Exposed rafter tips are visible.

410. C 818 West Avenue c 1950 Minimal Traditional

One-story, wood frame Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation. There is a concrete entry stoop with concrete steps and a pent metal awning supported by decorative metal posts. The facade is three-bays (W, D, W-tripled) with asbestos shingle siding. The single window is a 6/6 wood double-hung sash window with applied louvered shutters. The tripled window unit is made up of an 8/8 wood double-hung sash flanked by 4/4 wood double-hung sash windows also with applied louvered shutters. There is a triangular louvered vent in the front facing gable which has gable returns. The eaves are boxed. A shed roof carport is attached to the left side of the house and is supported by decorative metal posts with a low brick wall in between with cast stone caps and a wood post screen above.

411. C 912 West Avenue c 1950 Minimal Traditional

One-story, wood frame Minimal Traditional with a cross-gable roof of asphalt shingles on a brick foundation. There is an undercut entry partial width entry porch supported by a decorative metal post on a concrete stoop with concrete steps. The façade is four-bays (W, W-tripled, D, W) with asbestos shingle siding. The tripled window is made up of a central single light picture window flanked by 4/4 wood double-hung sash windows. The other windows are 6/6 wood double-hung sash. All of the windows have applied louvered shutters. The entry door is wood with two upper lights over four recessed panels. There is a wood louvered vent in the gable. The eaves are boxed.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 122 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

412a. C 914 West Avenue c 1920

One-story, wood frame residence with a hip roof of asphalt shingles on a brick pier foundation. There is a partial width front projecting entry porch with a hip roof of asphalt shingles supported by wood box columns on a wood porch deck with concrete steps. The façade is three-bays (W-tripled, D, W-tripled) with thin strip horizontal wood lap siding and corner boards. The window units are made up of a central 12/12 wood double-hung sash window with flanking 9/9 wood double-hung sash windows. The entry door is wood with a single segmentally arched light over three projecting panels and flanked by sidelights with four lights over a single projecting panel. There is a wide fascia board under the eaves which are boxed.

412b. C Garage c 1940

One-story, wood frame two-car garage with a front facing gable roof of asphalt shingles on a concrete foundation. There is a single opening with wood barn doors.

413a. C 916 West Avenue c 1955 Minimal Traditional

One-story, wood frame Minimal Traditional with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. There is a slight roof projection over the entry door and the concrete entry stoop with concrete steps. The façade is four-bays (W, D, W, W) with asbestos shingle siding. The windows flanking the entry door are 12/12 wood double-hung sash and the other window is 6/6 wood double-hung sash. All of the windows have applied paneled shutters. The eaves are boxed.

413b. C Garage c 1955

One-story, wood frame two-car garage with a front facing gable roof of asphalt shingles on a concrete foundation. There is one large opening with chamfered corners which has been partially infilled by a door. The siding is asbestos shingles and the eaves are boxed.

414. NC 932 West Avenue c 1980 Ranch

One-story, brick veneer Ranch with a side facing gable roof on a brick foundation. There is a partial width undercut entry porch with a brick stoop and step. The façade is eight-bays (W, W, W, D, W, W, W, W). All of the windows are 12/12 metal frame single-hung sash except for the one to the left of the door which is a 1/1 metal frame single-hung sash window. All of the windows have angled brick sills. The entry door is wood with two upper lights over four recessed panels. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7 Page: 123 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

415. C 933 West Avenue c 1950 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. There is a concrete entry stoop with a concrete step and metal railing. The façade is five-bays (W-paired, D, W-tripled, W, W) with Masonite siding. The windows are all 2/2 wood double-hung sash horizontally divided with the tripled window having a single light picture window in the center. All of the windows have applied louvered shutters. The entry door is a wood slab with single upper diamond light. There is an internal brick chimney visible.

416a. NC 935 West Avenue c 1920
One-story, wood frame residence with a cross-gable roof of asphalt shingles on a brick pier foundation with brick infill and metal vents. Partial width front projecting entry porch with a shed roof of asphalt shingles supported by wood box columns on a wood porch deck with concrete steps. The façade is three-bays (W-paired, D, W-paired) with vinyl siding. The windows are 3/2 metal frame single-hung sash and the entry door is wood with a single light over three horizontal recessed panels. There is a wood louvered vent in the gable. The house has been significantly altered with new siding windows, and porch columns.

416b. NC Garage c 1970
One-story, concrete block garage with a side facing gable roof of metal panels. There is a single opening and wood siding in the gable.

417. NC 936 West Avenue c 1970
One-story, brick veneer residence with a side facing gable roof of metal panels on a brick foundation. There is a partial width shed roof projecting entry porch supported by wood Tuscan columns on a brick concrete porch deck with brick steps. The façade is three-bays (W-paired, D, W). The windows are 6/6 metal frame single-hung sash with applied louvered shutters and angled brick sills. The entry door is wood with an oval leaded light over two vertical panels. A carport is attached to the rear left side of the house and is supported by full height brick columns. The eaves are boxed.

418. NC 938 West Avenue c 1965 Ranch
One-story, brick veneer Ranch with a hip roof of asphalt shingles on a brick foundation with metal vents. There is a projecting hip roof partial width entry porch supported by decorative metal posts on a concrete porch deck with brick steps. The façade is four-bays (Carport, W-tripled, D, W-paired). The tripled window has a 1/1 metal frame single-hung sash window flanked by 2/2 metal frame single-hung sash windows horizontally divided. The paired window is 2/2 metal frame single-hung sash horizontally divided. The entry door is wood with four vertical lights over eight projecting panels. The carport is under the main roof and supported by decorative metal posts. The eaves are boxed.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 124 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

419. NC 943 West Avenue c 1935 Craftsman Bungalow
One-story, wood frame altered Craftsman Bungalow with a gable-on-hip roof of metal panels on a brick foundation with brick infill and metal vents. Full width undercut entry porch supported by wood box columns on a wood porch deck with concrete steps. The façade is four-bays (W, D, D, W) with thin strip horizontal wood lap siding and corner boards. The windows are 9/6 metal frame single-hung sash and the entry doors are metal clad wood with a leaded arched fanlight over four projecting panels and outer wood screen doors. There is a rectangular wood louvered vent in the gable. The changes in the roof material, windows, and doors have diminished the Craftsman character of the house.

420. C 1002 West Avenue c 1920
One-story, commercial building sided in stucco with a flat roof behind a parapet wall. The façade is six-bays (W, D, W, W, D, W). Three of the windows are covered with rolling metal security screens and the other is a single plate glass window. The doors are both wood with a single light over a panel. The door on the left has an outer wood screen door. Above all of the openings are three light wood transoms, and two of them are filled with air conditioning units. [Photo #25]

Westwood Court

421. NC 510 Westwood Court c 1980 Ranch
One-story, brick veneer Ranch with a cross-gable roof of asphalt shingles on a brick foundation. The façade is three-bays (W, W, Carport). The windows are 1/1 metal frame single-hung sash with applied louvered shutters. The entry door faces the side and is a wood slab door. The carport is supported by metal poles. The eaves are boxed.

422. NC 513 Westwood Court c 1965 Ranch
One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Partial width undercut entry porch supported by decorative metal posts on a concrete foundation with a concrete step. The façade is five-bays (W, W, D, W-paired, Carport) with a combination of brick veneer and board and batten siding. The windows are three light metal frame awning windows with applied louvered shutters. The entry door is wood with six recessed panels. The carport is infilled with two openings by siding. The eaves are boxed.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7 Page: 125 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

423. C 514 Westwood Court c 1955 Ranch

One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation. Partial width undercut entry porch supported by a decorative metal post on a low brick wall which becomes a brick planter. The entry stoop is concrete with concrete steps and a metal handrail. The façade is seven-bays (W, D-paired, W, W-paired, W, D, W-paired) with Masonite siding. The two windows on the far left are 9/6 metal frame single-hung sash. Following that is a 2/2 wood double-hung sash window horizontally divided. Next is a twenty light steel casement window. The last window is a 2/2 wood double-hung sash horizontally divided. The doors are all wood with six recessed panels and the single entry door has an outer metal screen door. There is one internal brick chimney visible. The eaves are boxed.

424. C 515 Westwood Court c 1955 Ranch

One-story, wood frame Ranch with a side facing gable roof of asphalt shingles on a brick foundation. There is a slight roof projection for the partial width entry porch supported by decorative metal posts. The porch covers a brick planter and a concrete entry stoop with concrete steps and a metal rail. The façade is four-bays (W-paired, W, W, D) with a brick veneer wainscot with angled top and Masonite siding above. The windows are 2/2 wood double-hung sash horizontally divided except for the window next to the door which is a twenty-five light steel casement window. The entry door is a wood slab with a wood screen door with the bottom half louvers. The eaves are boxed. There is an attached carport with a shed roof to the rear left side of the house and supported by decorative metal posts.

425. NC 516 Westwood Court c 1980 Ranch

One-story, brick veneer Ranch with a side facing gable roof of asphalt shingles on a brick foundation with metal vents. Undercut partial width entry porch supported by a decorative metal post on a concrete entry stoop with a concrete step. The façade is seven-bays (W, W, W, D, W, W, W-tripled). The three windows to the left of the entry door are 1/1 wood double-hung sash and the window to the right of the door is a three light sliding window, the next window is single light in a wood frame, and the last window is a three-part jalousie window. The eaves are boxed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 7

Page: 126

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Wilks Avenue

426. C 103 Wilks Avenue c 1930 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a front facing gable roof metal panels on a brick pier foundation with metal panels. Front facing gable roof projecting and undercut entry porch supported by a wood box column on a wood porch deck with concrete steps and low brick wing walls with cast stone caps. The front porch has a shed roof extension with metal panels. The façade is three-bays (W, D, W) with thin strip horizontal wood lap siding and corner boards. Only one window is visible and it is a 3/1 wood double-hung sash with applied louvered shutters. The other window is covered with a sheet and is probably paired due to its size, applied louvered shutters are visible. There is a rectangular wood louvered vent in the gable. Exposed rafter tips are visible.

427a. C 104 Wilks Avenue c 1930 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with a hip roof of asphalt shingles on a concrete block foundation. Full width undercut entry porch supported by wood box columns with tapered capitals on a wood porch deck with concrete steps. The façade is five-bays (W-paired, D, W, W, D) with thin strip horizontal wood lap siding and corner boards. The windows are 2/2 wood double-hung sash horizontally divided with applied louvered shutters. The two windows under the front porch both have a panel below the window and to the floor. The addition to the right side has a gable front projecting entry porch for the door supported by knee braces.

427b. C Garage c 1950

One-story, wood frame garage with a front facing gable roof of metal panels and asbestos shingle siding with a single cased opening.

428. C 105 Wilks Avenue c 1945 Craftsman Bungalow

One-story, wood frame Craftsman Bungalow with side facing gable roof of metal panels on a concrete block foundation. There is a partial width front facing gable roof projecting entry porch supported by decorative metal posts on a concrete porch deck. The façade is five-bays (W-paired, W, D, W, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the entry door is wood with four vertical lights over three recessed panels with a metal screen door. The paired windows and the front porch all have a pent metal awning. The eaves are boxed. The plan is a mirror image to 107 Wilks Street.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 7

Page: 127

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

429. C 107 Wilks Avenue c 1945 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with side facing gable roof of asphalt shingles on a concrete block foundation. There is a partial width front facing gable roof projecting entry porch supported by decorative metal posts on a concrete porch deck. The façade is five-bays (W-paired, W, D, W, W-paired) with asbestos shingle siding. The windows are 3/1 wood double-hung sash and the entry door is modern metal clad wood door with a leaded glass arched light over four projecting panels. Exposed rafter tips are visible. The plan is a mirror image to 105 Wilks Street.

430. C 108 Wilks Avenue c 1930 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a concrete block foundation. There is a full width undercut entry porch with a pent roof supported by wood box columns on a wood porch deck with concrete steps. The façade is three-bays (W, D, W) with thin strip horizontal wood lap siding and corner boards. The windows are 9/1 wood double-hung sash in a Craftsman pattern with a panel below the window to the floor with one raised panel. The entry door is wood with nine lights over three recessed horizontal wood panels and an outer metal screen door. There is an arched louvered vent in the gable. Exposed rafter tips are visible. There is a shed roof carport attached to the rear right of the house supported by metal poles with lattice in between.

431. C 109 Wilks Avenue c 1940 Craftsman Bungalow
One-story, wood frame Craftsman Bungalow with a front facing gable roof of asphalt shingles on a brick foundation. There is a projecting partial width front facing gable roof screened entry porch supported by wood box columns with simplified capitals on a wood porch deck. Under the porch is artificial stone veneer siding. The façade is three-bays (W-paired, D, W-paired) with aluminum siding. The windows are 3/1 wood double-hung sash and the entry door is metal clad wood with six projecting panels. There is triangular louvered vent in both gables. Exposed rafter tips are visible.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 8

Page: 128

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

STATEMENT OF SIGNIFICANCE

Summary

The Columbia North Residential Historic District, located in Columbia, Mississippi, represents an example of residential development in the early to mid twentieth century on subdivided land outside of the commercial center to accommodate the growth of a small, but developing town. The district has a rich tapestry of building styles, sizes, and construction dates, all of which give the district a unique pattern of development and character. The Columbia North Residential Historic District is eligible for listing on the National Register of Historic Places for significance under criteria A in the area of community planning and development, and criteria C in the area of architecture. The period of significance is from circa 1895, the date of the earliest documented resource in the district¹, to 1959, fifty years prior to this nomination. The district's significance also derives from a concentration of intact residential, religious, and educational resources illustrating not only the popular architectural styles of the period between 1895 and 1959, but also vernacular forms common at the time.

The history of the Columbia North Residential Historic District is closely tied to the history and development of downtown Columbia. As the downtown grew with new commerce and industry so did the residential area east of the commercial core. With the increase in population the residential area of Columbia developed with houses for the new successful merchants and those for the workers of the new mills and factories. Those structures offer built proof of the eras in which the town expanded and the styles that were current in those eras.

Town Founding to 1899

Although the town of Columbia was founded as the county seat of Marion County (originally comprising all the area of present-day Marion, Lawrence, Pike, Walthall and parts of Covington, Lincoln, Lamar, Pearl River, and Jefferson Davis counties²) in the early nineteenth century and served as the temporary state capitol from February 27, 1821 to November 28, 1821, it did not begin its period of rapid growth until the very end of the nineteenth century. The Pearl River brought settlers to the area mainly from South Carolina and thus they named the new river

¹ Marion County Historical Society, *History of Marion County*, p. 141.

² *Downtown Columbia Historic District* - National Register Nomination, p. 19

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section: 8 Page: 129 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

settlement 'Columbia' for their former state capitol.³ Through much of the nineteenth century, Columbia served as the primary trading center connecting the agricultural production of Marion County from Jackson, Mississippi to the Gulf Coast via the keel boats and steamboats which plied the Pearl River.⁴ The land surrounding Columbia was never good enough to support many large plantations, but small farms were able to prosper by growing cotton and corn as cash crops and food crops for the family.⁵ The Pearl River served as the main transportation route to Columbia and served the town until the Gulf and Ship Island Railroad arrived in 1899.

Early Expansion of Columbia East of the Commercial Core

The railroad was a great boon to Columbia as goods could more easily and readily flow in and out of Columbia. Beginning in 1900, Columbia was home to a mere 500 and by 1910, the population exploded into 2,009.⁶ With the expansion of Columbia the old frame courthouse no longer suited the growing town and county and a new courthouse was constructed in 1905 in the Neoclassical Revival style at the end of Main Street.⁷ In 1907, a second railroad, the New Orleans Great Northern (later the Gulf, Mobile, and Northern, and then the Gulf, Mobile, and Ohio) built its line across the Pearl River into Columbia, connecting Columbia with New Orleans and Jackson, Mississippi.⁸ With the expanding railroad service commerce increased and businesses such as Hill Hardware Co., Inc., the Lampton Company, and Sandy Hook, George F. and James W. Hart, Inc. had successful operations in downtown Columbia. The increase in commerce and the new rail lines brought more people to Columbia and the need for additional housing. The earliest housing in Columbia started along Broad Street and Church Street and spread east and then north moving into the Columbia North Residential Historic District including streets such as Dale, High School, Ford, Garden, Jackson, Lafayette, and North Main.

³ Ford, Gene and Linda. *Columbia Survey Report*, p.2.

⁴ WPA Historical Research Project for Marion County. "History," p. 2; "Transportation."

⁵ WPA Historical Research Project for Marion County. "Agriculture."

⁶ Ford, Gene and Linda. *Columbia Survey Report*, p.2.

⁷ The Marion County Courthouse is located in the Columbia Downtown Historic District listed in the National Register of Historic Places in 1997.

⁸ *Downtown Columbia Historic District* - National Register Nomination, p. 19.

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 8

Page: 130

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

The Rise and Fall of the J.J. White Lumber Company

In 1911, Hugh Lawson White (1881-1965) purchased seventeen thousand acres of pine forest in Marion County and shortly after that investment the J. J. White Lumber Co. opened.⁹ White was at the helm and mill jobs boosted the employment numbers in Columbia and all of Marion County. The lumber mill and other businesses helped create the need for additional housing and most likely supplied lumber to many of the new houses being built.

When World War I ended, prosperity came to the U.S. and into small town Columbia. During the decade of the twenties, twelve passenger trains a day ran through Columbia. By 1925, the population in Columbia had risen to 3,500.¹⁰ Altogether, by the end of the 1920s, Columbia boasted eight major industries besides the White company, including the Columbia Compress Company and Columbia Ice and Power Company.¹¹

In the district 5% of the houses were constructed between 1920 and 1930, although there may have been more that were built and replaced by newer homes later on. Most of the houses built during that time period in Columbia were of the Craftsman Bungalow style with low hip roofs, wide porches, and exposed rafter tips. Unlike their Queen Anne predecessors these were built for more modest families and are scattered throughout the district. Interestingly on Garden Street there were five modest Craftsman houses built before 1925¹² of the same size and configuration with full width frontal porches. Four of them survive today and include, 909 (#155), 913 (#157, Photo #12), 917 (#158), and 921 (#159) Garden Street. Larger more architecturally significant versions of the style built before 1930 are located at 820 Rogers Street (#403), 907 Oak Street (#325), and 921 Oak Street (#328).

As the decade progressed, the number of pine trees declined and the pine forests were diminished to such an extent that the J. J. White Lumber Mill closed in 1929.¹³ Although the largest employer in Columbia was gone, the company's owner, Hugh White, remained. By that time he was the Mayor of Columbia and was not willing to let Columbia fall into ruin.

⁹ Ibid, p. 3.

¹⁰ Sanborn Insurance Co., *Sanborn Map 1925, Columbia Mississippi*.

¹¹ *Downtown Columbia Historic District - National Register Nomination*, p. 21.

¹² Sanborn Insurance Co., *Sanborn Map 1925, Columbia Mississippi*.

¹³ Ford, Gene and Linda, *Columbia Survey*, p. 3.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 8

Page: 131

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

The Columbia Plan

With the help of several prominent Columbia citizens, Mayor White decided to fight the economic decline of Columbia. They developed the Columbia Plan in 1929 which was the forerunner of the Balance Agriculture with Industry (BAWI) program that led White to the Governor's office in 1936. White was a businessman and politician with vision. Timber and cotton had powered Mississippi's economy since the state's inception. White wanted to pioneer a new path for Columbia. The plan was simply not to rely on agriculture as the single provider for jobs in the city. At the time, there were too many natural roadblocks including soil erosion and boll weevils that made agriculture unstable. Mayor White combined forces with Columbian merchants to court industry to come to Columbia. Together this local group bought the land and built a building for the Reliance Manufacturing Company which agreed to come if the town would provide a building suitable for its operations. This the townspeople did, raising the money to build a huge plant in 1932. Other businesses also built in Columbia during the 1930s, including the Dorgan-McPhillips Packing Corporation, located south of town on High School Avenue, the Columbia Knitting Mill, the Kentucky Lumber Company (just north of the former White mill), and the Southern Naval Stores Company. The Columbia Plan was a success and together the new industries that came to Columbia played an important role in the town's continued development through the 1930s. The jobs they provided even sustained the local economy during the Great Depression.¹⁴ In fact 12% of the houses in the district were built between 1930 and 1939 showing that those jobs provided the funds needed to build new houses. During that time more Craftsman style homes were built in the district with significant ones at 429 High School (#151), 433 Ford Street (#153, Photo #11), 811 High School Street (#227a), and 926 High School Street (#237). Even an example of the new popular Tudor Revival style sweeping the country was built in the district at 936 Main Street (#300, Photo #19).

Post World War II Development

When World War II ended, employment numbers grew along with the population of Columbia which went from 4,900 in 1931 to 8,000 in 1946.¹⁵ Returning veterans with new families and factory workers needed housing. However, it took some time for the housing industry to recover after the war. Once it did recover in the late 1940s, houses were produced in record numbers. Capitalizing on federal assistance for war veterans, housing developers in Columbia built modest houses based on traditional Colonial Revival and Tudor Revival designs in a new style called Minimal Traditional. Between the end of World War II and 1959, 33% of the buildings in the

¹⁴ *Downtown Columbia Historic District* - National Register Nomination, p. 21

¹⁵ Ford, Gene and Linda, *Columbia Survey*, p. 4.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 8

Page: 132

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

district were constructed. There was even a post war subdivision called the G&K Subdivision built along Broadmor Street with the best collection of intact Minimal Traditional homes in Columbia. Besides the G&K Subdivision, Columbia developers built numerous houses of the Minimal Traditional style throughout the district including significant examples at 408 Dale Street (#92a, Photo #4), 916 Park Avenue (#349), and 1219 Park Avenue (#387, Photo #24). In 1953, Columbia voted to build a plant for the New Orleans Furniture Manufacturing Company. This vote won by a landslide with 1304 in favor to 3 against the bond issue. Endorsement of the \$550,000.00 bond issue was passed, securing some 350 to 400 jobs for the community. Governor Hugh White, serving his second term as Governor of Mississippi, pointed to this vote for industry as clear proof of the Balancing Agriculture with Industry in action¹⁶. Residential construction continued to keep pace with the demand the new factory created for housing. Once again popular styles changed and more modern streamlined Ranch style houses were built. Some good examples of the style in the district include twin houses at 1009 (#28) and 1011 (#30, Photo #1) Beatrice Street, 803 Lafayette Street (#282), and 1000 Park Avenue (#353).

The progress of development in the 1950s also brought about the need for updated schools and churches. The Columbia Primary School (#103) at 501 Dale Street was built in 1951 replacing an earlier school on the site. Like the progressiveness of the industrial development in Columbia, the school system was also progressive in building a school in the new Modern style with clean horizontal lines and window walls for the classrooms. The architect for the school was N.W. Overstreet, a prolific Mississippi architect, who also designed the highly modern for its time 1937-1938 Columbia High School. In 1957 a new church was built at 1001 Park Avenue (#354, Photo #23) in the Modern style as well with a mix of low-pitched and high-pitched roofs with large overhangs along with slit windows of colored glass. Bucking the trend of the Modern style, the First Baptist Church of Columbia constructed an impressive Neoclassical Revival structure in 1959 to replace their earlier and smaller sanctuary on the same site at 409 Dale Street (#93, Photo #6).

Construction of houses after the period of significance for this district continued with several built throughout the district. In the 1960s and 1970s they were built mostly in the Ranch style replacing earlier houses or built on vacant lots throughout the district. In the district there is also a 1960s to 1970s subdivision built on Greymont Drive and Camellia Court. From that period on

¹⁶ Ford, Gene and Linda, *Columbia Survey*, p. 5.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 8

Page: 133

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

there was a small amount of new houses built in various modern styles spread throughout the district.

Architecture

Houses in the Columbia North Residential District cover the majority of the architectural styles of the late nineteenth to mid-twentieth century. The styles found in the district include: Queen Anne, Free Classic Queen Anne, Neoclassical Revival, Tudor Revival, Spanish Revival, Craftsman, Minimal Traditional, Ranch, and Modern.

Excellent examples of the Queen Anne style can be found at 516 Dale Street (#107a), 923 High School Street (#235), 934 Main Street (#298), 1209 Main Street, North (#312a, Photo #22), and 811 West Street (#409a). Several houses of the Free Classic Queen Anne style were constructed in the district with significant examples found at 433 Dale Street (#102), and 611 Dale Street (#112a). Interestingly several Neoclassical Revival style homes were built in the 400 block of Dale Street including 419 Dale (#94a), 421 Dale (#96a), 423 Dale (#97), and a significant one-and-a-half-story example at 425 Dale (#99, Photo #7). A later and very grand example of the Neoclassical style can be found in the First Baptist Church at 409 Dale (#93, Photo #6).

The Craftsman style became very popular in Columbia, most likely due to the availability of materials via the railroad, and a move to a simpler, more restrained style from the previous highly decorative Queen Anne homes and the classical Neoclassical and Colonial Revival homes. There are several outstanding examples in the district of the Craftsman style including a two-story example at 433 Ford Street (#153, Photo #11), a brick example at 429 Ford Street (#151), 811 High School Street (#227a), 926 High School Street (#237a) with a matching porte cochere, and 820 Rogers Street (#403). Other good examples of the style include 809 Beauvoir Street (#35), 704 Dale Street (#115), 222 Dewey Street (#131), 808 East Street (#133a), 1121 Gill Street (#194a), 1219 Gill Street (#204), 312 Lafayette Street (#248), 404 Lafayette Street (#254a), 1214 Main Street, North (#316a), 1218 Main Street North (#317a), 907 Oak Street (#325), 911 Oak Street (#326), 921 Oak Street (#328), and 814 Rogers Street (#402).

The Spanish Colonial Revival and Tudor Revival styles were not as popular in the district as only one of each remain in the district. The Spanish Colonial Revival house is located at 1003 Main Street, North (#304, Photo #20) and the Tudor Revival style house is a restrained brick example at 936 Main Street (#300, Photo #19).

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 8 Page: 134 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

Just before World War II a new style called Minimal Traditional emerged combining elements of earlier styles. A great number of these houses were constructed in the district, mostly at the eastern end, including a small subdivision of the Minimal Traditional style houses on Broadmor Street called the G&K Subdivision. Outstanding examples of the style include 1006 Broadmor (#64), 1019 Broadmor Street (#75), 408 Dale Street (#92a, Photo #4), 916 Park Avenue (#349), 1213 Park Avenue (#384), and 1219 Park Avenue (#387, Photo #24). Good examples include 1003 Beatrice (#22) 1004 Broadmor Street (#63), 1008 Broadmor Street (#65), 1010 Broadmor Street (#66), 1013 Broadmor Street (#69), 1015 Broadmor Street (#71a), 1107 Gill Street (#191), and 902 Lafayette Street (#295a, Photo 18).

The boom of housing construction after World War II used the Minimal Traditional style but also started using the Ranch style featuring more streamlined and horizontally massed houses with less classical detail. Again the majority of the Ranch Houses were built at the eastern end of the district. Good examples of the style include 1009 Beatrice Street (#28), 1011 Beatrice Street (#30, Photo #1), 811 Central Street (#90), 723 Dale Street (#122), 803 Lafayette Street (#282), and 1000 Park Avenue (#353).

There are two outstanding examples of the Modern style in the district. One is the Columbia Primary School at 501 Dale Street (#103) built in 1951 and the other is the First Assembly of God Church at 1001 Park Avenue (#354, Photo #23) built in 1957.

Conclusion

Today the southern Mississippi town of Columbia is much as it was when a Chamber of Commerce brochure dating from the 1930s described the residential sections of the town as being filled with "exquisite homes-charming homes-'homey' homes-palatial homes-modest homes-modern homes-old Southern homes-tiny homes-large homes-homes suitable for every income" and that the residential yards of Columbia are filled "with flowers, shrubs, beautiful lawns, and trees."¹⁷ These residences of stately Queen Anne cottages, Neoclassical Revivals, Craftsman Bungalows, Minimal Traditionals and other styles line the residential streets of the Columbia North Residential Historic District and represent Columbia's past economic successes which led to the constriction of these homes to house the workers for the booming industry and commerce in the city. Columbia grew from a small river town before 1900 to one that prospered with the introduction of the railroad. The town then survived the Great Depression through a

¹⁷ Ford, Gene and Linda, *Columbia Survey*, p. 5.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 8

Page: 135

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

program of economic diversity emphasizing the development of industry and commerce in combination with agriculture which has helped to sustain Columbia through the twentieth century.

The Columbia North Residential Historic District is certainly a unique residential community in Mississippi and one that visually expresses the growth of Columbia from its early beginnings to one that decided to balance agriculture with industry which has made it the city it is today. Buildings of different styles of architecture from circa 1895 to the present survive, giving the Columbia North Residential Historic District a unique mix of significant historic structures which give Columbia its unique historic character.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 9 Page: 136 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

BIBLIOGRAPHY

Broad Street – Church Street Historic District National Register Nomination. 2008. On file at the Historic Preservation Division of the Mississippi Department of Archives and History (Jackson, MS).

Downtown Columbia Historic District National Register Nomination. 1997. On file at the Historic Preservation Division of the Mississippi Department of Archives and History (Jackson, MS).

Historic Resources Inventory, Marion County. Historic Preservation Division, Mississippi Department of Archives and History (Jackson, Miss).

Marion County Historical Society. *History of Marion County, Mississippi.* Walsworth Publishing Company: Marceline, Missouri, 1976.

Sanborn Insurance Co. Fire insurance maps of Columbia, Mississippi: 1915, 1925, 1931, 1931 corrected to 1946. On microfilm at the Mississippi Department of Archives and History (Jackson, Miss).

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 10

Page: 137

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

GEOGRAPHICAL DATA

Verbal Boundary Description: The district boundaries are delineated on the accompanying map.

Boundary Justification: The district includes a group of contiguous residential, commercial, institutional, and religious buildings that represent the historic and architectural development of the residential area Columbia in the North Residential area during the period of significance, circa 1895 to 1959.

PHOTOGRAPHS

The following information is the same for all photographs:

- 1.) Columbia North Residential Historic District
- 2.) Marion County, Mississippi
- 3.) David Preziosi, Mississippi Heritage Trust
- 5.) Mississippi Department of Archives and History

- | | |
|-----------------------|--|
| Photo 1 of 25: | 1.) 1011 Beatrice Street, S facade |
| | 4.) January, 2009 |
| | 6.) view to N |
| Photo 2 of 25: | 1.) Streetscape 1000 block Broadmor Street |
| | 4.) January, 2009 |
| | 6.) view to N |
| Photo 3 of 25: | 1.) 808 Central Street, W facade |
| | 4.) December, 2008 |
| | 6.) view to E |
| Photo 4 of 25: | 1.) 408 Dale Street, N facade |
| | 4.) November, 2008 |
| | 6.) view to S |
| Photo 5 of 25: | 1.) 408 Dale Street, N facade |
| | 4.) November, 2008 |
| | 6.) view to S |

United States Department of the Interior
National Park Service

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section: 10

Page: 138

Columbia North Residential Historic District
Columbia, Marion County, Mississippi

- Photo 6 of 25:** 1.) 409 Dale Street, S Façade
4.) November, 2008
6.) view to N
- Photo 7 of 25:** 1.) 425 Dale Street, S Façade
4.) November, 2008
6.) view to N
- Photo 8 of 25:** 1.) Streetscape, 600 block Dale Street
4.) January, 2009
6.) view to NE
- Photo 9 of 25:** 1.) 611 Dale Street, S elevation
4.) December, 2008
6.) view to N
- Photo 10 of 25:** 1.) Streetscape 700 block Dale Street
4.) March 2009
6.) view to NW
- Photo 11 of 25:** 1.) 433 Ford Street, S façade
4.) March, 2009
6.) view to N
- Photo 12 of 25:** 1.) 913 Garden Street, E façade
4.) November, 2008
6.) view to W
- Photo 13 of 25:** 1.) Streetscape, 900 block Gill Street
4.) January, 2009
6.) view to NE
- Photo 14 of 25:** 1.) Streetscape, 1100 block Gill Street
4.) January, 2009
6.) view to S
- Photo 15 of 25:** 1.) 1200 Gill Street, N Façade
4.) January, 2009
6.) view to E
- Photo 16 of 25:** 1.) Streetscape, 900 block High School Street
4.) January, 2009
6.) view to NW

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**


Section: 10 Page: 139 Columbia North Residential Historic District
Columbia, Marion County, Mississippi

- Photo 17 of 25:** 1.) Streetscape, 400 block Jackson Street
4.) January, 2009
6.) view to NE
- Photo 18 of 25:** 1.) 902 Lafayette Street, N façade
4.) January, 2009
6.) view to S
- Photo 19 of 25:** 1.) 936 Main Street, W façade
4.) December, 2008
6.) view to E
- Photo 20 of 25:** 1.) 1003 Main Street, North, E façade
4.) December, 2008
6.) view to W
- Photo 21 of 25:** 1.) Streetscape, 1200 block Main Street, North
4.) January, 2009
6.) view to NW
- Photo 22 of 25:** 1.) 1209 Main Street, North, N façade, E elevation
4.) December, 2008
6.) view to SW
- Photo 23 of 25:** 1.) 1001 Park Avenue, E façade, N elevation
4.) January, 2009
6.) view to SW
- Photo 24 of 25:** 1.) 1219 Park Avenue, E façade
4.) March, 2009
6.) view to W
- Photo 25 of 25:** 1.) 1002 West Street, W façade, S elevation
4.) December, 2008
6.) view to NE

Columbia North Residential Historic District

Columbia, Marion County

- Map Key:**
- District Boundary
 - Contributing
 - Non-Contributing
 - V Vacant
 - P Photograph Number

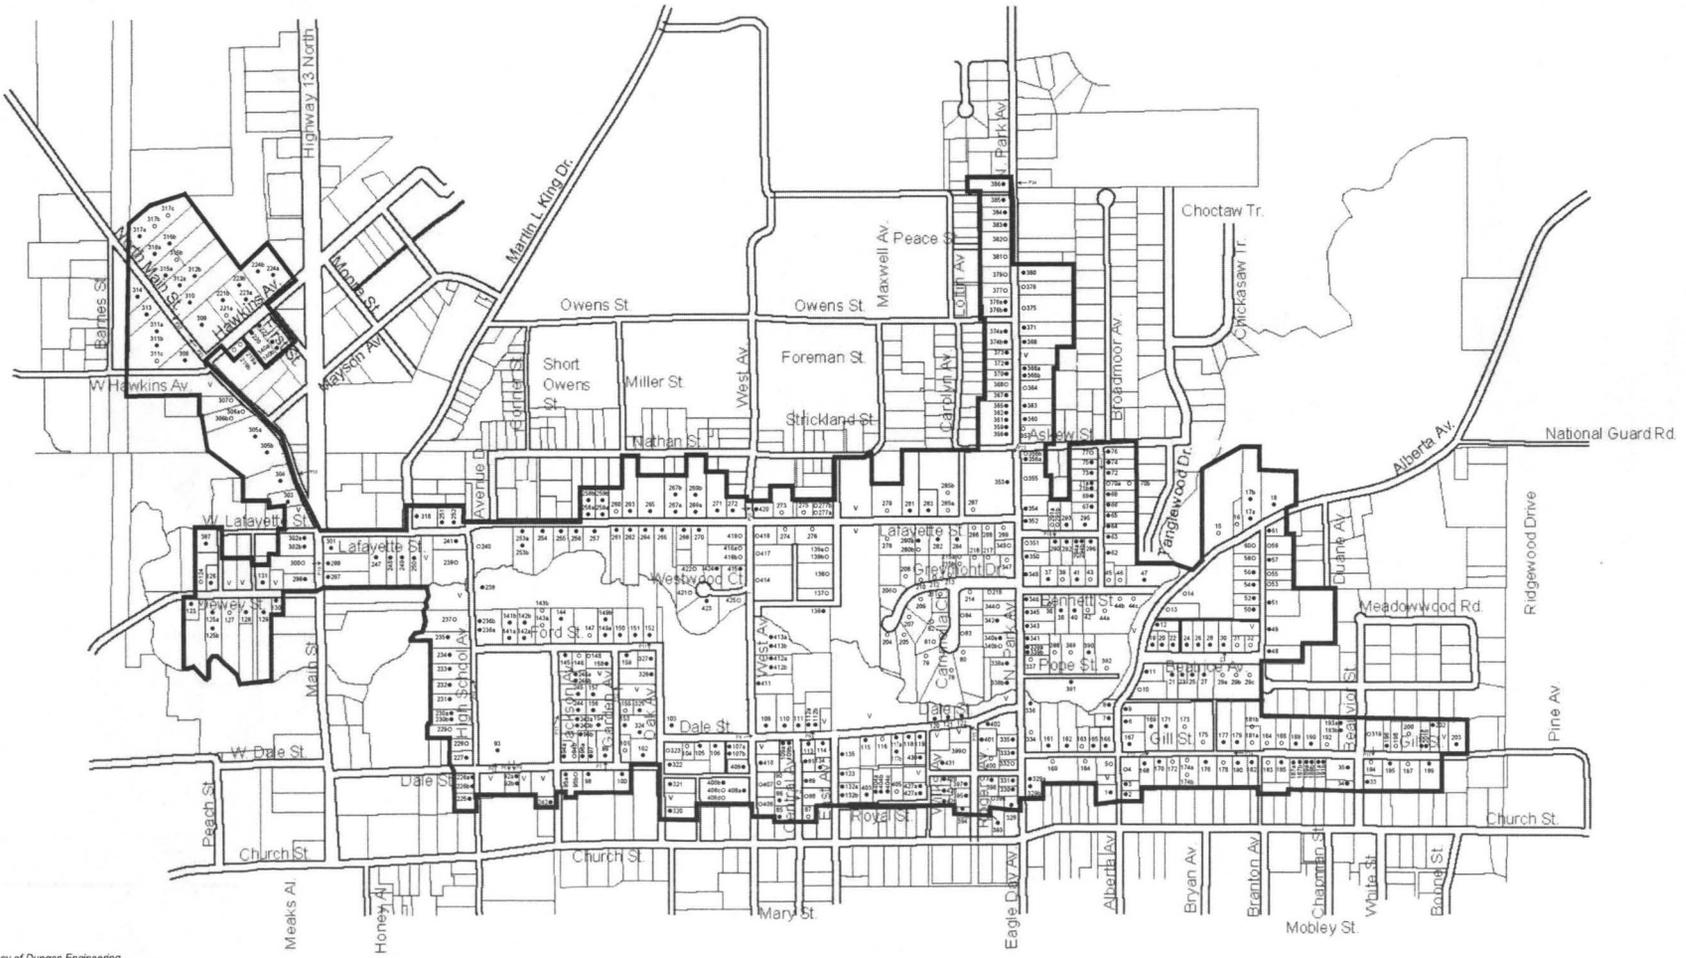



1011 Beatrice Street

#30

Columbia, Marion County, Mississippi
Columbia North Residential Historic District

Photo 1 of 25



Streetscape

1000 block Broadmor Street

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 2 of 25



808 Central Street

#88

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 3 of 25




408 Dale Street

92 ~~A~~

Columbia, Marion County, Mississippi
Columbia North Residential Historic District

Photo 4 of 25

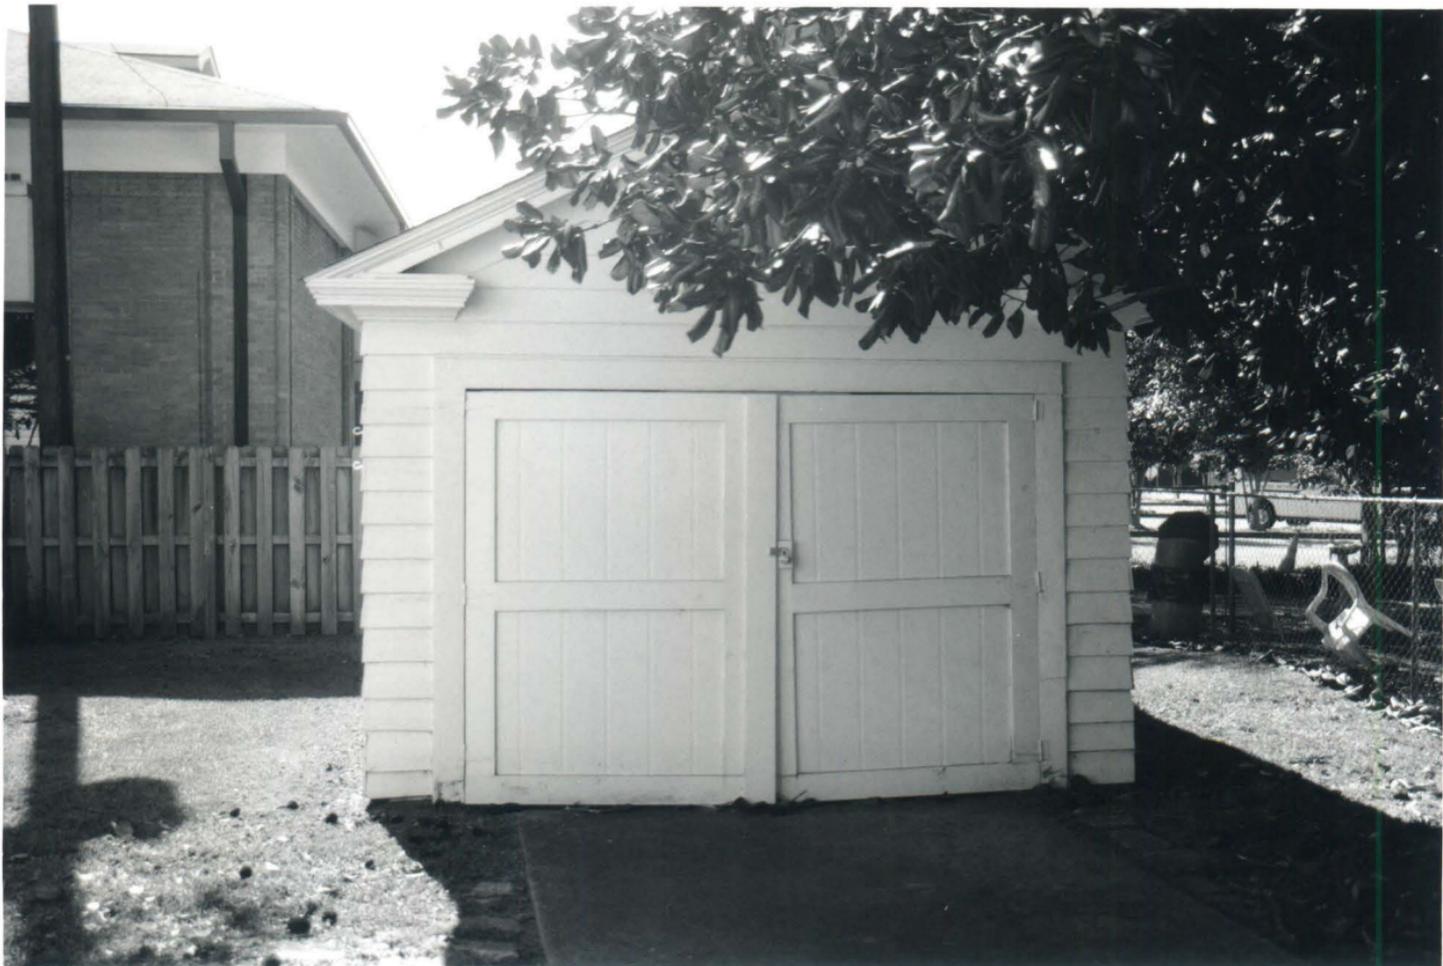

408 Dale

926

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 5 of 25



First Baptist Church

409 Dale Street

#93

Columbia, Marion County, Mississippi

Columbia North Residential Historic
District

Photo 6 of 25



425 Dale Street

#99

Columbia, Marion County, Mississippi;
Columbia North Residential Historic District

Photo 7 of 25



Streetscape

600 Block Dale Street - Odd Side

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 8 of 25



611 Dale Street

112a

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 9 of 25



Streetscape
700 block Dale Street
Columbia, Marion County, Mississippi
Columbia North Residential Historic District
Photo 10 of 25



433 Ford Street

#152

Columbia, Marion County, Mississippi;
Columbia North Residential Historic District

Photo 11 of 25



913 Garden Street

#156

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 12 of 25



Streetscape

900 block Gill Street

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 13 of 25



Streetscape

1100 block Gill Street

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 14 of 25



1200 Gill Street

#194

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 15 of 25



Streetscape

900 block High School Street

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 16 of 25



Streetscape

400 block Jackson Street

Columbia, Marion County, Mississippi
Columbia North Residential Historic District

Photo 17 of 25



902 Lafayette Street

290

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 18 of 25



936

~~1003~~ Main Street

~~303~~ 299

Columbia, Marion County, Mississippi

Columbia North Residential Historical District

Photo ~~20~~ of 25
19



1003 Main Street, North

303

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 20 of 25



Streetscape

1200 block Main Street, North
Columbia, Marion County, Mississippi
Columbia North Residential Historic District

Photo 21 of 25



1209 Main Street, North

311 a

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 22 of 25



First Assembly of God Church

1001 Park Avenue

353

Columbia, Marion County, Mississippi

Columbia North Residential Historic District

Photo 23 of 25



1219 Park Avenue

306

Columbia, Madison County, Mississippi

Columbia North Residential Historic District

Photo 24 of 25



1002 West Street
#420

Columbia, Marion County, Mississippi
Columbia North Residential Historic District
Photo 25 of 25